



DCX A Rack Mount Power Supply

Instruction Manual

Branson Ultrasonics Corp.
120 Park Ridge Road
Brookfield, CT 06804
(203) 796-0400
<http://www.bransonultrasonics.com>

BRANSON

Manual Change Information

At Branson, we strive to maintain our position as the leader in ultrasonics plastics joining, metal welding, cleaning and related technologies by continually improving our circuits and components in our equipment. These improvements are incorporated as soon as they are developed and thoroughly tested.

Information concerning any improvements will be added to the appropriate technical documentation at its next revision and printing. Therefore, when requesting service assistance for specific units, note the Revision information found on this document, and refer to the printing date which appears on this page.

Copyright and Trademark Notice

Copyright © 2024 Branson Ultrasonics Corporation. All rights reserved. Contents of this publication may not be reproduced in any form without the written permission of Branson Ultrasonics Corporation.

Mylar is a registered trademark of DuPont Teijin Films.

WD-40 is a registered trademark of WD-40 Company.

Windows 7, Windows Vista, and Windows XP are registered trademarks of Microsoft Corporation.

Other trademarks and service marks mentioned herein are held by their respective owners.

Foreword

Congratulations on your choice of a Branson Ultrasonics Corporation system!

The Branson DCX A Rack Mount Power Supply system is process equipment for the joining of plastic parts using ultrasonic energy. It is the newest generation of product using this sophisticated technology for a variety of customer applications. This Instruction Manual is part of the documentation set for this system, and should be kept with the equipment.

Thank you for choosing Branson!

Introduction

This manual is arranged into several structured chapters which will help you find the information you may need to know to safely handle, install, set up, program, operate, and/or maintain this product. Please refer to the [Table of Contents](#) and/or the [Index](#) of this manual to find the information you may be looking for. In the event you require additional assistance or information, please contact our Product Support department (see [1.3 How to Contact Branson](#) for information on how to contact them) or your local Branson representative.

Table of Contents

Chapter 1: Safety and Support

1.1	Safety Requirements and Warnings	2
1.2	General Precautions	6
1.3	How to Contact Branson	9

Chapter 2: Introduction

2.1	Models Covered	16
2.2	Compatibility with other Branson Products	18
2.3	Features	19
2.4	Controls and Indicators	22
2.5	Welding Systems	28
2.6	Glossary	29

Chapter 3: Delivery and Handling

3.1	Shipping and Handling	32
3.2	Receiving	33
3.3	Unpacking the Power Supply	34
3.4	Take Inventory of Small Parts	35
3.5	Returning Equipment	36

Chapter 4: Technical Specifications

4.1	Technical Specifications	38
4.2	Physical Description	40
4.3	Declaration of Conformity	41
4.4	UK Declaration of Conformity	42

Chapter 5: Installation and Setup

5.1	About Installation	44
5.2	Installation Requirements	45
5.3	Installation Steps	50
5.4	User I/O	53
5.5	Power Supply Setup	69
5.6	Assembling the Acoustic Stack	70
5.7	Converter Cooling	75
5.8	Testing the Installation	77
5.9	Still Need Help?	78

Chapter 6: Converters and Boosters

6.1	Converters and Boosters	80
-----	-----------------------------------	----

Chapter 7: Operation

7.1	Setting Primary Parameters	92
7.2	Setting Limits	103
7.3	Setting the Amplitude	116
7.4	Resetting the Power Supply Alarms	118
7.5	Configuring the Power Supply Registers	119
7.6	Save/Recall Presets	124
7.7	LCD Bar-Graph	127
7.8	Ultrasonics Test Procedure	130

7.9	Using the I/O Connections	132
-----	-------------------------------------	-----

Chapter 8: Maintenance

8.1	General Maintenance Considerations	134
8.2	DCX A Rack Mount Power Supply Preventive Maintenance	136
8.3	Recommended Spare Stock.	142
8.4	Troubleshooting.	148
8.5	Cold Start Procedure	152

Appendix A: Alarms

A.1	Overload Alarms (Group 0)	154
A.2	Cutoff Alarms (Group 1)	156
A.3	Setup Alarms (Group 2)	157
A.4	Cycle Modified Alarms (Group 3)	158
A.5	Warning Alarms (Group 4)	159
A.6	Limit Alarms (Group 5)	160
A.7	Equipment Failure Alarms (Group 6)	161
A.8	No Cycle Alarms (Group 7)	163
A.9	Communication Failure Alarms (Group 8)	164
A.10	Hardware Alarms (Group A)	165
A.11	Non-Cycle Overload Alarms (Group B)	166

Appendix B: Timing Diagrams

B.1	Timing Diagrams	170
-----	---------------------------	-----

Appendix C: Manual's Revisions

C.1	Manual's Revisions.	176
-----	-----------------------------	-----

List of Figures

Chapter 1: Safety and Support

Figure 1.1	Safety-related Labels found on the DCX A Rack Mount Power Supply	4
Figure 1.2	Safety-related Labels found on the DCX A Rack Mount Power Supply	5

Chapter 2: Introduction

Figure 2.1	The DCX A Rack Mount Power Supply	17
Figure 2.2	DCX A Rack Mount Power Supply Front Panel Controls and Indicators.	22
Figure 2.3	LCD Description	24
Figure 2.4	DCX A Rack Mount Power Supply Back Panel	27

Chapter 3: Delivery and Handling

Chapter 4: Technical Specifications

Figure 4.1	Declaration of Conformity	41
Figure 4.2	UK Declaration of Conformity.	42

Chapter 5: Installation and Setup

Figure 5.1	DCX A Rack Mount Power Supply Dimensional Drawing (Small)	46
Figure 5.2	DCX A Rack Mount Power Supply Dimensional Drawing (Medium)	47
Figure 5.3	DCX A Rack Mount Power Supply Dimensional Drawing (Large)	48
Figure 5.4	LCD Viewing Angle	51
Figure 5.5	DCX A Rack Mount Power Supply Connections	52
Figure 5.6	User I/O Cable Identification and Wire Color Diagram.	54
Figure 5.7	Typical Digital I/O Wiring Examples	65
Figure 5.8	Typical Analog I/O Wiring Examples	65
Figure 5.9	RF Cable Connection.	66
Figure 5.10	Assembling the Acoustic Stack.	71
Figure 5.11	Connecting Tip to Horn	74

Chapter 6: Converters and Boosters

Figure 6.1	20 kHz typical Converter Dimensions	80
Figure 6.2	20 kHz Booster Dimensions	81
Figure 6.3	20 kHz Converter/Booster/Horn, Typical Dimensions	82
Figure 6.4	30 kHz Converter Dimensions	83
Figure 6.5	30 kHz Booster Dimensions	84
Figure 6.6	30 kHz Converter/Booster/Horn, Typical Dimensions	85
Figure 6.7	40 kHz Booster Dimensions	86
Figure 6.8	40 kHz Converter/Booster/Horn, Typical Dimensions	87

Chapter 7: Operation

Figure 7.1	Power Window Limits	111
Figure 7.2	LCD at Power Up	116
Figure 7.3	LCD when in External Amplitude Control Mode.	117
Figure 7.4	Test Connections	132

Chapter 8: Maintenance

Figure 8.1	Reconditioning Stack Mating Surfaces.	139
------------	---	-----

Appendix A: Alarms

Appendix B: Timing Diagrams

Figure B.1	RF Switching I/O Direct With Feedback With And Without Alarm	170
Figure B.2	RF Switching I/O Direct With Feedback With And Without Alarm And Load On Start	170
Figure B.3	RF Switching I/O With Off With And Without Alarm And Load On Start	171
Figure B.4	RF Switching I/O With Off With Feedback With And Without Alarm	171
Figure B.5	Timing Diagram For All Other Modes With Actuator	172
Figure B.6	Timing Diagram For Cycle Abort With Actuator	173
Figure B.7	Timing Diagram For Ground Detect With Actuator	174

Appendix C: Manual's Revisions

Figure C.1	Manufacturing date on the Information label	176
Figure C.2	Location of the Information label on the back of the DCX A Rack Mount Power Supply	177

List of Tables

Chapter 1: Safety and Support

Table 1.1	Authorized Service Center (North America)	9
Table 1.2	Authorized Service Centers (South America)	9
Table 1.3	Authorized Service Centers (Asia)	10
Table 1.4	Authorized Service Centers (Europe)	12

Chapter 2: Introduction

Table 2.1	Models Covered in this Manual	16
Table 2.2	Power Supply Compatibility with Branson Converters	18
Table 2.3	Control Features	19
Table 2.4	DCX A Rack Mount Power Supply Front Panel Controls and Indicators.	22
Table 2.5	LCD Description	24
Table 2.6	Connections to the DCX A Rack Mount Power Supply	27
Table 2.7	Glossary	29

Chapter 3: Delivery and Handling

Table 3.1	Shipping Specifications	32
Table 3.2	Inspect the Power Supply	33
Table 3.3	Unpacking the Power Supply	34
Table 3.4	Small Parts included with the Power Supply Assemblies	35
Table 3.5	DCX A Rack Mount Power Supply System Cables	35

Chapter 4: Technical Specifications

Table 4.1	Environmental Specifications	38
Table 4.2	Electrical Input Operating Voltages.	38
Table 4.3	Input Current and Fuse Specifications.	39
Table 4.4	Continuous Duty Maximum Power	39
Table 4.5	Dimensions and Weights of DCX A Rack Mount Power Supply	40

Chapter 5: Installation and Setup

Table 5.1	Environmental Requirements	49
Table 5.2	Input Current and Circuit Breaker Specifications	49
Table 5.3	DCX A Rack Mount Power Supply Connections	52
Table 5.4	User I/O Cable Identification and Wire Color Diagram.	54
Table 5.5	User I/O Cable Pin Assignments.	55
Table 5.6	Default Branson User I/O Connector Pin Assignments.	57
Table 5.7	Digital Input Functions	59
Table 5.8	Digital Output Functions	61
Table 5.9	Analog Input Functions	63
Table 5.10	Analog Output Functions	64
Table 5.11	RF Cable Connection.	66
Table 5.12	Input Power Connection	67
Table 5.13	Power Supply Features	69
Table 5.14	Acoustic Stack Description.	71
Table 5.15	Stack Torque Values.	72
Table 5.16	Tools	72
Table 5.17	20 kHz System	73
Table 5.18	30 kHz System	73
Table 5.19	40 kHz System	73

Table 5.20	Tip to horn torque values	74
Table 5.21	Continuous Duty Max. Power & Full Power Duty Cycle	75
Table 5.22	Converter Cooling Procedure	76

Chapter 6: Converters and Boosters

Table 6.1	20 kHz Converter	80
Table 6.2	20 kHz Booster	81
Table 6.3	20 kHz Converter/Booster/Horn	82
Table 6.4	30 kHz Converter	83
Table 6.5	30 kHz Booster	84
Table 6.6	30 kHz Converter/Booster/Horn	85
Table 6.7	40 kHz Booster	86
Table 6.8	40 kHz Converter/Booster/Horn	87

Chapter 7: Operation

Table 7.1	Summary of Weld Modes	92
Table 7.2	Continuous Mode Operational Sequence	93
Table 7.3	Time Mode Parameters	95
Table 7.4	Time Mode Operational Sequence	95
Table 7.5	Energy Mode Parameters	97
Table 7.6	Energy Mode Operational Sequence	97
Table 7.7	Peak Power Mode Parameters	99
Table 7.8	Peak Power Mode Operational Sequence	99
Table 7.9	Ground Detect Mode Parameters	101
Table 7.10	Ground Detect Mode Operational Sequence	101
Table 7.11	Time Window Limit High Parameters	103
Table 7.12	Time Window Limit High Operational Sequence	104
Table 7.13	Time Window Limit Low Parameters	105
Table 7.14	Time Window Limit Low Operational Sequence	106
Table 7.15	Energy Window Limit High Parameters	107
Table 7.16	Energy Window Limit High Operational Sequence	108
Table 7.17	Energy Window Limit Low Parameters	109
Table 7.18	Energy Window Limit Low Operational Sequence	110
Table 7.19	Power Window Limit High Parameters	112
Table 7.20	Power Window Limit High Operational Sequence	113
Table 7.21	Power Window Limit Low Parameters	114
Table 7.22	Power Window Limit Low Operational Sequence	115
Table 7.23	Setting the Amplitude Using the Front Panel Controls	116
Table 7.24	Resetting the DCX A Rack Mount Power Supply	118
Table 7.25	Steps to Configure the Power Supply Registers	119
Table 7.26	Power Supply Registers	121
Table 7.27	Save Preset	124
Table 7.28	Recall Preset	125
Table 7.29	Power Bar-Graph Interpretation Examples	127
Table 7.30	Frequency Bar-Graph Interpretation - 20 kHz (50 Hz Segment)	128
Table 7.31	Frequency Bar-Graph Interpretation - 30 kHz (76 Hz Segment)	128
Table 7.32	Frequency Bar-Graph Interpretation - 40 kHz (100 Hz/Segment)	129
Table 7.33	Frequency Bar-Graph Interpretation Examples	129
Table 7.34	Power Supply Ultrasonic Test Procedure (Front Panel)	130
Table 7.35	Power Supply Ultrasonic Test Procedure (User I/O)	132

Chapter 8: Maintenance

Table 8.1	Stack Reconditioning Procedure	138
Table 8.2	Reconditioning Stack Mating Surfaces	139
Table 8.3	Stack Torque Values	139
Table 8.4	Stack Reassembly for a 20 kHz System	140
Table 8.5	Stack Reassembly for a 30 kHz System	140

Table 8.6	Stack Reassembly for a 40 kHz System	141
Table 8.7	Stud Torque Values	141
Table 8.8	DCX A Rack Mount Power Supply System Cables	142
Table 8.9	Suggested Spares	143
Table 8.10	Converters Compatible with the DCX A Rack Mount Power Supply	144
Table 8.11	DCX A Rack Mount Power Supply Compatible Boosters	145
Table 8.12	Other Items used with the DCX A Rack Mount Power Supply	147
Table 8.13	Troubleshooting	148
Table 8.14	Troubleshooting Common Electrical Problems	149
Table 8.15	Troubleshooting Ultrasonic Power Problems	150
Table 8.16	Troubleshooting Weld Cycle Problems	151
Table 8.17	Steps to Perform a Cold Start	152

Appendix A: Alarms

Table A.1	Overload Alarms (Group 0)	154
Table A.2	Cutoff Alarms (Group 1)	156
Table A.3	Setup Alarms (Group 2)	157
Table A.4	Cycle Modified Alarms (Group 3)	158
Table A.5	Warning Alarms (Group 4)	159
Table A.6	Limit Alarms (Group 5)	160
Table A.7	Equipment Failure Alarms (Group 6)	161
Table A.8	No Cycle Alarms (Group 7)	163
Table A.9	Communication Failure Alarms (Group 8)	164
Table A.10	Hardware Alarms (Group A)	165
Table A.11	Non-Cycle Overload Alarms (Group B)	166

Appendix B: Timing Diagrams

Appendix C: Manual's Revisions

Table C.1	Manual's Revisions	176
-----------	------------------------------	-----

Chapter 1: Safety and Support





1.1 Safety Requirements and Warnings2
1.2 General Precautions6
1.3 How to Contact Branson9




1.1 Safety Requirements and Warnings

This chapter contains an explanation of the different Safety Notice symbols and icons found both in this manual and on the product itself and provides additional safety information for ultrasonic welding. This chapter also describes how to contact Branson for assistance.

1.1.1 Symbols Found in this Manual

These symbols used throughout this manual warrant special attention:

WARNING	General Warning
	If these risks are not avoided, death or severe injury might result.
WARNING	High Voltage Hazard
	High voltage. Turn power off before servicing.
WARNING	Corrosive Material Hazard
	Corrosive material. Avoid contact with eyes and skin. Wear proper protection.
CAUTION	General Warning
	If these risks are not avoided, slight or minor injury might result.

CAUTION	Loud Noise Hazard
	<p>Loud noise hazard. Ear protection must be worn.</p>
CAUTION	Heavy Object
	<p>Heavy object. To avoid muscle strain or back injury, use lifting aids and proper lifting techniques.</p>
NOTICE	
	<p>If this situation is not avoided, the system or something in its vicinity might get damaged.</p> <p>Application types and other important or useful information are emphasized.</p>

1.1.2 Symbols Found on the Product

The DCX A Rack Mount Power Supply has several safety-related labels on it to indicate the presence of hazardous voltages inside the unit.

Figure 1.1 Safety-related Labels found on the DCX A Rack Mount Power Supply

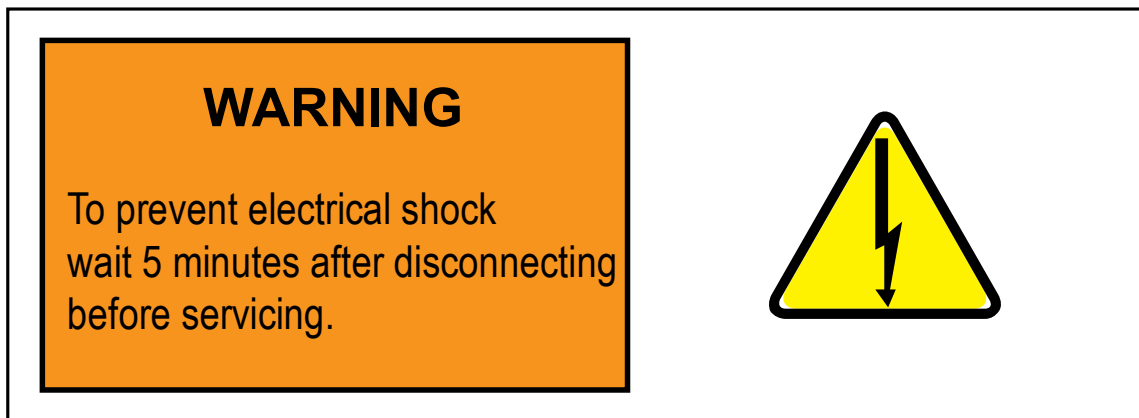




Figure 1.2 Safety-related Labels found on the DCX A Rack Mount Power Supply





MADE IN MEXICO		 WARNING
		GROUND UNIT BEFORE OPERATING


1.2 General Precautions

Take the following precautions before servicing the power supply:

- Be sure the power is disconnected before making any electrical connections
- To prevent the possibility of an electrical shock, always plug the power supply into a grounded power source
- To prevent the possibility of an electrical shock, ground the power supply by securing an AWG #14 grounded conductor to the ground screw located next to the air outlet
- Power supplies produce high voltage. Before working on the power supply assembly, do the following:
 - Turn off the power supply
 - Unplug main power
 - Allow at least 5 minutes for capacitors to discharge
- High voltage is present in the power supply. Do not operate with the cover removed
- High line voltages exist in the ultrasonic power supply assembly. Common points are tied to circuit reference, not chassis ground. Therefore, use only non-grounded, battery-powered multimeters when testing the power supply assembly. Using other types of test equipment can present a shock hazard
- Keep hands from under the horn. Down force (pressure) and ultrasonic vibrations can cause injury
- Do not cycle the welding system if either the RF cable or converter is disconnected
- When using larger horns, avoid situations where fingers could be pinched between the horn and the fixture
- Ensure power supply installation is performed by qualified personnel and in accordance with local standards and regulations

CAUTION	Loud Noise Hazard
	<p>Sound level and frequency of the noise emitted during the ultrasonic assembly process may depend upon a. type of application, b. size, shape and composition of the material being assembled, c. shape and material of the holding fixture, d. welder setup parameters and e. tool design.</p> <p>Some parts vibrate at an audible frequency during the process. Some or all of these factors may result in an uncomfortable noise being emitted during the process.</p> <p>In such cases operators may need to be provided with personal protective equipment. See 29 CFR (Code of Federal Regulations) 1910.95 Occupational Noise Exposure.</p>

NOTICE	
	<p>When the battery is worn out, dispose it under the ordinance of each local government.</p>

CAUTION	Corrosive Material Hazard
	<p>First aid measures (in case of electrolyte leakage from the battery):</p> <p>Eye Contact: Flush the eyes with plenty of clean water for at least 15 minutes immediately, without rubbing. Get immediate medical treatment.</p> <p>If appropriate procedures are not taken, this may cause eye injury.</p> <p>Skin Contact: Wash the affected area under tepid running water using a mild soap. If appropriate procedures are not taken, this may cause sores on the skin. Get medical attention if irritation develops or persists.</p> <p>Inhalation: Remove to fresh air immediately. Get medical treatment immediately.</p>

1.2.1 Intended Use of the System


The DCX A Rack Mount Power Supply and components are designed to be used as part of an ultrasonic welding system. These are designed for a wide variety of welding or processing applications.

If the equipment is used in a manner not specified by Branson, the protection provided by the equipment may be impaired.

Branson Ultrasonics Corporation designs and manufactures machines giving the first priority to safety precautions, to allow customers to use the machines safely and effectively. Only trained operators should run and service the equipment. Untrained operators can misuse the equipment or ignore safety instructions that can result in personal injury or equipment damage. It is most essential that all operators and service personnel pay attention to safety instructions when operating and servicing the equipment.

1.2.2 Emissions

Because of the various types of toxic or injurious gases that may be liberated during the welding based on the material being processed, sufficient ventilation should be provided to prevent a concentration of these gases in excess of 0.1 ppm. Check with your materials suppliers for recommended protection when processing their materials.

CAUTION	Corrosive Material Hazard
	Processing of many materials, such as PVC, can be hazardous to an operator's health and could cause corrosion/damage to the equipment. Use proper ventilation and take protective measures.

1.2.3 Setting up the Workplace

Measures for setting up a workplace for safe operation of the ultrasonic welder are outlined in [Chapter 5: Installation and Setup](#).

1.2.4 Regulatory Compliance

This product meets electrical safety requirements and EMC (Electromagnetic Compliance) requirements for North America, Great Britain, and the European Union.

1.3 How to Contact Branson

Branson is here to help you. We appreciate your business and are interested in helping you successfully use our products. To contact Branson for help, use the following telephone numbers, or contact the office nearest you.

1.3.1 Authorized Service Center (North America)

Table 1.1 Authorized Service Center (North America)

Name	Address	Tel/Fax Number
Branson Ultrasonics Corp. Global Headquarters United States	120 Park Ridge Road Brookfield, CT 06804	Tel: 1-203-796-0400 Fax: 1-203-796-0593 info@bransonultrasonics.com

1.3.2 Authorized Service Centers (South America)

Table 1.2 Authorized Service Centers (South America)

Name	Address	Tel/Fax Number
Intersonic Argentina	Av. Cramer 2361 1C Buenos Aires 1428	Tel: 011-54-11-4781-2327 Fax: 011-54-11-4782-2412
Branson do Brasil Brasil	Rua Goiatuba, 81 06465-300 – Barueri / SP	Tel: 55-11-4208-1652

1.3.3 Authorized Service Centers (Asia)

Table 1.3 Authorized Service Centers (Asia)

Name	Address	Tel/Fax Number
Branson Ultrasonics (Shanghai) Co. Ltd. – China Headquarters China	758 Rong Le Dong Road, Song Jiang Song Jiang Industry Zone CN-Shanghai, 201613 PRC	Tel: 86-21-3781-0588 Fax: 86-21-5774-5100 c.service@emerson.com
Branson Ultrasonics Co. Ltd. Beijing Office	Room 216, Flat B, 12 Hong Da North Road, Chuangxin Technological Mansion Beijing Department Area. Beijing 100176 PRC	Tel: 86-10-6787-7806 Fax: 86-10-6787-3378
Branson Ultrasonics Co. Ltd. Tianjin Office		Tel: 86-22-2732-5233 Fax: 86-22-2732-3581
Branson Ultrasonics Co. Ltd. Dongguan Office		Tel: 86-769-8541-0736 Fax: 86-769-8541-0735
Branson Ultrasonics Co. Ltd. Suzhou Office		Tel: 86-512-6295-3652 Fax: 86-512-6295-3651
Branson Ultrasonics Asia Pacific Co. Ltd. Hong Kong Office	Flat A, 5/F Pioneer Building 213 Wai Yip Street, Kwung Tong Kowloon, Hong Kong	Tel: 852-2790-3393 Fax: 852-2341-2716 info@emerson.com
Branson Ultrasonics Div. of Emerson Electric Co. P. Ltd. "Ajanta House" India	8/35, Marol Co-Op Industrial Estate M.V. Road, Andheri (East) Mumbai 400 059, India	Tel: 91-22-2850-5570 Fax: 91-22-2850-8681
Branson Ultrasonics Japan Headquarters Division of Emerson Japan Ltd.	4-3-14 Okada, Atsugi-Shi Kanagawa 243-0021 Japan	Tel: 81-46-228-2881 Fax: 81-46-288-8892
Branson Korea Co., Ltd. Korea	#803, 8F Dongil Techno Town 823, Kwan Yang-2dong, Dong An-gu An Yang-si, Kyung Ki-do, 431-062 Korea	Tel: 82-1577-0631 Fax: 82-31-422-9572

Table 1.3 Authorized Service Centers (Asia)

Name	Address	Tel/Fax Number
Branson Ultrasonics Div. of Emerson Elec (M) Sdn Bhd. Malaysia	No. 20, Jalan Rajawali 3, Puchong Jaya Industrial Park Batu 8, Jalang Puchong 47170 Puchong, Selangor Malaysia	Tel: 603-8076-8608 Fax: 603-8076-8302
Branson Ultrasonics Philippines	Emerson Building 104 Laguna Blvd. Laguna Technopark Inc. Sta. Rosa, Laguna, 4026 Philippines	Tel: 63-49-502-8860 Fax: 63-49-502-8860 Mobile: 63-917-5372072
Branson Ultrasonics Singapore	10 Pandan Crescent #03-06 UE Tech Park LL3 Singapore 128466	Tel: 65-6891-7600 Fax: 65-6873-7882
Branson Ultraschall Taiwan	Div. of Emerson Electric (Taiwan) Co. Ltd. 5F-3, No. 1, Wu-Chiuan First Road Wu-Ku Ind Zone, Hsin- Chuang City Taipei Hsien 24892, Taiwan	Tel: 886-2-2298-0828 Fax: 886-2-2298-9985
Emerson Limited Thailand	662/39-40 Rama 3 Road Bangpongpan, Yannawa Bangkok 10120, Thailand	Tel: 66-2-293-01217 Fax: 66-2-293-0129

1.3.4 Authorized Service Centers (Europe)

Table 1.4 Authorized Service Centers (Europe)

Name	Address	Tel/Fax Number
Branson Ultraschall Czech Republic		Tel: 420-374-625-620 Fax: 420-374-625-617
Branson Ultrasons France	1 Rue des Pyrenees Silic 404 94573 Rungis Cedex France	Tel: 33-1-4180-2550 Fax: 33-1-4687-8729
Branson Ultraschall European Headquarters Germany	Niederlassung der EMERSON Technologies GmbH & Co. OHG Waldstraße 53-55 63128 Dietzenbach, Germany	Tel: 49 (0)6074/497-0 Tel: 49 (0)6074/497-784 Fax: 49 (0)6074/497-199 info@branson.de
Branson Ultrasuoni, S.r.l. Italy	Via Dei Lavoratori, 25 20092 Cinisello Balsamo Milano, Italy	Tel: 39-02-660-8171 Fax: 39-02-660-10480
Branson Ultrasonics B.V. Netherlands	P.O. Box 9, 3760 Soest The Netherlands	Tel: 31-35-60-98101
Branson Ultrasonidos S.A.E. Portugal	Rua General Orlando Barbosa 74, RC-NP 4490-640 Póvoa de Varzim Portugal	Tel: 351-936-059-080 Mobil: 351-252-101-754
Emerson a.s., division Branson Slovakia	Piestandska 1202/44 91528 Nove Mesto Nad Vahom Slovak Republic	Tel: 421-32-7700-501 Fax: 421-32-7700-470
Branson Ultrasonidos S.A.E. Spain	Edificio Emerson C/Can Pi, 15 1ª Planta (Antigua Carretera del Prat) Polígono Industrial Gran Vía Sur 08908 HOSPITALET DE LLOBREGAT (BARCELONA) Spain	Tel: 34-93-586-0500 Fax: 34-93-588-2258

Table 1.4 Authorized Service Centers (Europe)

Name	Address	Tel/Fax Number
Branson Ultrasonics S.A. Switzerland	Sonifers: Case Postale 1031 Brasonics: Chemin du Faubourg-de-Cruseilles 9 CH 1227, Carouge, Switzerland	Tel: 41-22-304-8340 Tel: 41-58-611-1222 Fax: 41-22-304-8359
Branson Ultrasonics United Kingdom	158 Edinburgh Avenue Slough, Berkshire England SL1 4UE	Tel: 44-1753-756675 Fax: 44-1753-551270
Branson Ultraschall Rusia	Torfyanaya road, 7F 197374, Saint-Petersburg Russia	Tel: 7-812-449-35-24 Mobile: 7-962-693-77-12

Chapter 2: Introduction

2.1 Models Covered16
2.2 Compatibility with other Branson Products18
2.3 Features19
2.4 Controls and Indicators22
2.5 Welding Systems.28
2.6 Glossary29

2.1 Models Covered

This manual covers all models of the DCX A Rack Mount Power Supply.

Table 2.1 Models Covered in this Manual

Frequency	Power	EDP
20 kHz	1250 W	101-132-2057
	2500 W	101-132-2058
	4000 W	101-132-2059
30 kHz	1500 W	101-132-2056
40 kHz	800 W	101-132-2055

2.1.1 Overview of these Models

Figure 2.1 The DCX A Rack Mount Power Supply



The DCX A Rack Mount Power Supply generates ultrasonic energy through an ultrasonic converter for welding plastics. Several models are available, depending on the desired frequency (for example, 20 kHz) and the desired power range (for example, 4.0 kW). The power supply also contains a microprocessor-based controller module that provides for control and monitoring of welding operations.

The power supply provides the following features:

End of Weld Store: Allows the power supply to track and store the frequency of the last weld.

Timed Seek: Tracks and starts the stack on the correct frequency. It does this by running the horn at a low-level amplitude (10 %) to find and lock on to the stack operating frequency. Seeks are timed from the moment sonics was last activated.

Line Regulation: Maintains converter amplitude by regulating for variances in the line voltages.

Load Regulation: Maintains converter amplitude over the full range of rated power.

System Protection: Protects the power supply by providing six levels of protection.

- Voltage
- Current
- Phase
- Temperature
- Power
- Frequency

Web Page Interface: Provides access, via Ethernet connection, to power supply information, diagnostics, and configuration web pages.

2.2 Compatibility with other Branson Products

Table 2.2 Power Supply Compatibility with Branson Converters

DCX A Rack Mount Models	Converter
20 kHz	CR-20S
	CR-20C
	CH-20S (932 AH SPL)
	CH-20C
	CS-20S
	CS-20C
30 kHz	CR-30S
	CR-30C
	CH-30S
	CH-30C
	CS-30S
	CS-30C
40 kHz	CR-40S (4TH)
	CR-40C
	4TP

2.3 Features

2.3.1 The Welding System

The welding system consists of a DCX A Rack Mount Power Supply and a converter-booster-horn stack. The system can perform ultrasonic welding, inserting, staking, spot welding, swaging, degating, and continuous ultrasonic operations. It is designed for automated, semi-automated and/or manual production operations.

2.3.2 The Power Supply

The DCX A Rack Mount Power Supply consists of an ultrasonic power supply assembly with a system controller and user interfaces. The ultrasonic power supply assembly converts conventional 50/60 Hz line current to 20 kHz, 30 kHz or 40 kHz electrical energy. The system controller controls the welding system.

Listed below are the control features of the Branson DCX A Rack Mount Power Supply ultrasonic welding system:

Table 2.3 Control Features

Name	Description
Autotuning	Branson power supply tuning ensures that the system is running at peak efficiency.
Digital Amplitude Setting	This feature allows you to set the exact amplitude necessary for your application, allowing increased range and setting repeatability over analog systems.
Frequency Offset	This process feature allows a user to set an offset relative to the starting frequency, for certain specific applications, where the force imparted on the fixture or anvil causes a frequency shift in the stack's operation. You should only use this feature when advised to do so by Branson.
Horn Signature	Using the DCX A Rack Mount Power Supply Web Page Interface, you may scan your ultrasonic stack to view its operating frequency on your computer, using digital readouts to give you the best picture of the stack's operation.
LCD (Liquid Crystal Display)	Provides a clear visual interface to monitor and configure the system.
Line Regulation	Maintains converter amplitude by regulating for variances in the line voltages.
Load Regulation	Maintains converter amplitude over the full range of rated power.
Membrane Keys	Front panel controls are designed for high reliability and immunity from factory dust and oils.
User ID and Passcodes	Allows for keeping track of user access to the DCX A Rack Mount Power Supply Web Page Interface.
Ramp Starting	The starting of the DCX A Rack Mount Power Supply and horn is done at a rate that helps reduce electrical and mechanical stress on the system. The horn start rate may be adjusted for some tough-to-start applications.

Table 2.3 Control Features

Name	Description
Seek	Ensures operation at resonance; minimizes tuning errors; and operates the stack at low amplitude (10%), then provides a means of sensing and storing the resonant operating frequency value.
Start-up Diagnostics	At start-up, the controls test the major internal components.
System Protection	Protects the power supply by providing six levels of protection: voltage, current, phase, temperature, power, and frequency.
Timed Seek	When enabled, will do a Seek once every minute to update horn resonant frequency to memory. This is especially useful when the welding process affects the actual temperature of the horn, causing a resonant frequency shift.
True Watt-meter	The controls on the power supply include a true watt-meter for accurate measurement of power and energy.
Web Page Interface	Provides access, via Ethernet connection, to power supply information, diagnostics, and configuration web pages.

2.3.3 The Actuator

The DCX A Rack Mount Power Supply can interface with actuator signals.

2.3.4 Converter/Booster/Horn Assembly

The Converter

The ultrasonic electrical energy from the power supply is applied to the converter (sometimes called the transducer). This transforms the high frequency electrical oscillations into mechanical vibrations at the same frequency as the electrical oscillations. The heart of the converter is piezoelectric ceramic elements. When subjected to an alternating voltage, these elements alternately expand and contract, resulting in better than 90 % conversion of electrical to mechanical energy.

The Booster

Success in ultrasonic assembly depends on the right amplitude of movement at the horn face. Amplitude is a function of horn shape, which is largely determined by the size and form of the parts to be assembled. The booster can be used as a mechanical transformer to increase or decrease the amplitude of vibrations applied to the parts through the horn.

The booster is a resonant half-wave section of aluminum or titanium. It is mounted between the converter and the horn, as part of the ultrasonic stack. It also provides a clamping point for rigid stack mounting.

Boosters are designed to resonate at the same frequency as the converter with which they are used. Boosters are usually mounted at a nodal (minimum vibration) point of axial motion. This minimizes the loss of energy and prevents vibration from being transmitted to the stack supporting structure.

The Horn

The horn is selected or designed for a specific application. Each horn is tuned typically as a half-wave section that applies the necessary force and vibration uniformly to the parts to be assembled. It transfers ultrasonic vibrations from the converter to the workpiece. The horn is mounted to the booster as part of the ultrasonic stack.

Depending on their profile, horns are referred to as stepped, conical, exponential, bar, or catenoidal. The shape of the horn determines the amplitude at the face of the horn. Depending on the application, horns can be made from titanium alloys, aluminum, or steel. Titanium alloys are the best materials for horn fabrication due to their high level of strength and low loss. Aluminum horns are usually chrome- or nickel-plated or hard-coated to reduce wear. Steel horns are for low amplitude requiring hardness, such as ultrasonic insertion applications.

2.4 Controls and Indicators

2.4.1 DCX A Rack Mount Power Supply Front Panel

Figure 2.2 DCX A Rack Mount Power Supply Front Panel Controls and Indicators



Table 2.4 DCX A Rack Mount Power Supply Front Panel Controls and Indicators




Reference	Description
	<p>LCD</p> <p>For detailed information refer to Figure 2.3 LCD Description and Table 2.5 LCD Description.</p>
	<p>Up/Down Keys</p> <p>Use to adjust the amplitude of ultrasonic vibrations (10 % to 100 %). Also used to adjust weld mode parameters, select registers and edit register values.</p>
	<p>Alarm Reset Key</p> <p>Use the Reset key to reset alarms.</p> <p>When changing system registers, use the Reset key to set a register back to its default value after entering the register and before editing the value.</p>

Table 2.4 DCX A Rack Mount Power Supply Front Panel Controls and Indicators






Reference	Description
	<p>Configuration Key</p> <p>Use the Configuration key to change system registers. Registers are used to change system parameters. For information on using the Configuration key to set system registers see 7.5 Configuring the Power Supply Registers.</p>
	<p>Ultrasonics Test Key</p> <p>Use the Test key to perform an ultrasonic test. Test performs a seek and then ramps the amplitude to the current setting.</p>
	<p>Ethernet Port</p> <p>Use the Ethernet Port to connect to the DCX A Rack Mount Power Supply Web Page Interface.</p>
	<p>Power-On Indicator</p> <p>Lights when the power supply is connected to main power and the power is on.</p>
	<p>24 V Indicator</p> <p>Lights when 24 V DC are supplied to the DCX A Rack Mount Power Supply.</p>

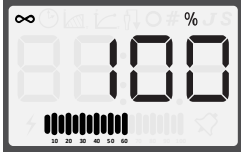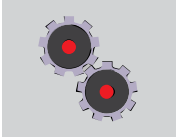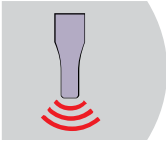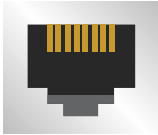Figure 2.3 LCD Description

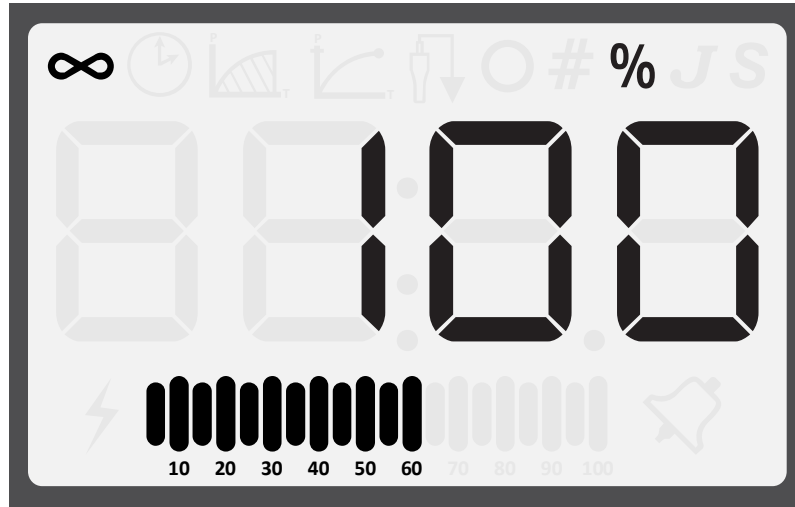


Table 2.5 LCD Description




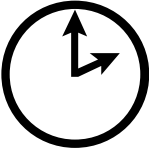
Reference	Description
	<p>Numeric Display</p> <p>Displays the Power Supply amplitude settings, weld time settings, weld energy settings, peak power settings, scrub time settings, register numbers, register values or alarm numbers.</p>
	<p>Continuous Mode Icon</p> <p>Indicates the power supply is running in Continuous mode. When in Continuous mode, the amplitude setting is shown on the numeric display in conjunction with the % icon. The amplitude setting may range from 10% to 100%. For more information see Chapter 7: Operation.</p>
	<p>Time Mode Icon</p> <p>Indicates the power supply is running in Time mode. When in Time mode, the weld time setting is shown on the numeric display in conjunction with the S icon. The weld time setting can range from 10 ms to 30 seconds. For more information see Chapter 7: Operation.</p>
	<p>Energy Mode Icon</p> <p>Indicates the power supply is running in Energy mode. When in Energy mode, the weld energy setting is shown on the numeric display in conjunction with the J icon. The energy setting may range from 1 Joule to 9999 Joules. For more information see Chapter 7: Operation.</p>

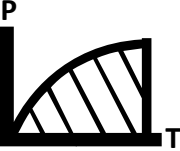Table 2.5 LCD Description

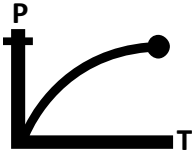
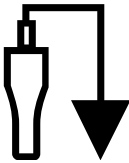





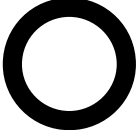
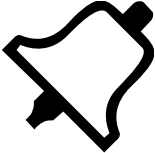

Reference	Description
	<p>Peak Power Icon</p> <p>Indicates the power supply is running in Peak Power mode. When in Peak Power mode, the peak power percentage is shown on the numeric display in conjunction with the % icon. The peak power setting may range from 1% to 100% of the maximum power supply output power. For more information see Chapter 7: Operation.</p>
	<p>Ground Detect Icon</p> <p>Indicates the power supply is running in Ground Detect mode. When in Ground Detect mode, the scrub time setting will be shown on the numeric display in conjunction with the S icon. Scrub time setting may range from 1 millisecond to 500 milliseconds. For more information see Chapter 7: Operation.</p>
	<p>Sonics Active Indicator</p> <p>Indicates ultrasonics is running.</p>
	<p>Time Icon</p> <p>Indicates that the value shown on the numeric display represents time in seconds.</p>
	<p>Joule Icon</p> <p>Indicates that the value shown on the numeric display represents energy.</p>
	<p>Percentage Icon</p> <p>Indicates that the value shown on the numeric display represents a percentage. When in Peak Power mode, the value shown on the numeric display represents a percentage of the power supply rated power. If not in Peak Power mode, the value shown on the numeric represents the amplitude setting.</p>
	<p>Number Sign Icon</p> <p>Indicates that the value shown on the numeric display is a register number. Use up and down keys to select a register. For more information see 7.5 Configuring the Power Supply Registers.</p>

Table 2.5 LCD Description

Reference	Description
	<p>Circle Icon</p> <p>Indicates that the value shown on the numeric display is a register value. Use up and down keys to modify the register value. For more information see 7.5 Configuring the Power Supply Registers.</p>
	<p>Alarm Icon</p> <p>A flashing icon which indicates an alarm condition.</p>
	<p>Power/Frequency Bar-Graph</p> <p>Shows the true percentage of ultrasonic power during a weld cycle. The bar-graph can be configured to show the peak power or the memory frequency at the end of each weld or test cycle. For instructions on how to modify this setting see 7.5 Configuring the Power Supply Registers.</p> <p>For detailed bar-graph description and bar-graph reading examples, see 7.7.1 Power Bar-Graph Interpretation and 7.7.2 Frequency Bar-Graph Interpretation.</p>

2.4.2 DCX A Rack Mount Power Supply Connections

Figure 2.4 DCX A Rack Mount Power Supply Back Panel

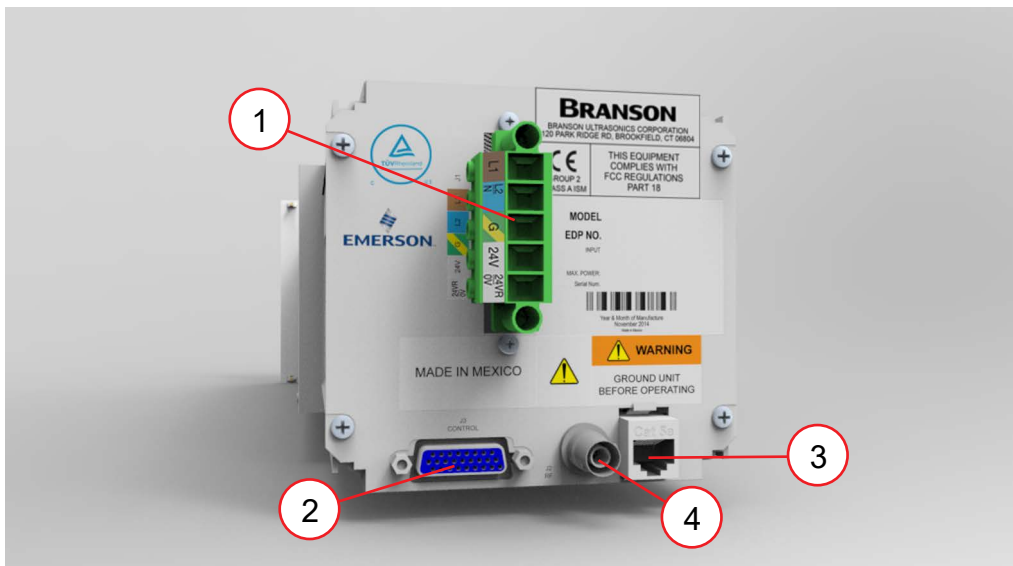


Table 2.6 Connections to the DCX A Rack Mount Power Supply

Item	Name	Function
1	Line Input Connector	Detachable connector block for connecting the input power. For wiring details refer to Chapter 5: Installation and Setup .
2	User I/O Connector	Provides the necessary input/output signals to interface with actuators, user automation or control interfaces. For detailed information on interfacing with the DCX A Rack Mount Power Supply refer to Chapter 5: Installation and Setup .
3	Ethernet Port	Use the Ethernet Port to connect to the DCX A Rack Mount Power Supply Web Page Interface.
4	RF Connector	SHV connector for RF cable, which provides ultrasonic energy to the converter.

2.5 Welding Systems

2.5.1 Principle of Operation

Thermoplastic parts are welded ultrasonically by applying high frequency vibrations to the parts being assembled. The vibrations, through surface and intermolecular friction, produce a sharp rise in temperature at the welding interface.

When the temperature is high enough to melt the plastic, there is a flow of material between the parts. When the vibrations stop, the material solidifies under pressure and a weld results.

2.5.2 Weld System Applications

DCX A Rack Mount Power Supply weld systems can be used for the following applications:

- Ultrasonic welding
- Cutting and sealing thermoplastic fabric and film
- Staking, spot welding, swaging, and degating thermoplastic parts
- Other ultrasonic processing applications

2.6 Glossary

The following terminology may be encountered when using or operating a DCX A Rack Mount Power Supply ultrasonic welding system:

Table 2.7 Glossary

Name	Description
Actuator	The unit which houses the converter/booster/horn stack assembly in a rigid mounting, allowing the stack to move up and down, either mechanically or pneumatically, applying force to the part at a user-adjustable force and velocity.
Alarm	Visual indication of error.
Amplitude Control	The ability to set amplitude digitally or by an external control.
Amplitude	The peak-to-peak movement at the horn face. Always expressed as a percentage of the maximum.
Booster	A one-half-wavelength-long resonant metal section mounted between the converter and horn, sometimes having a change in cross-sectional area between the input and output surfaces. The booster mechanically alters the amplitude of vibrations received from the converter, and imparts the new amplitude to the horn.
Clamping Force	The pounds or kilograms exerted by the horn onto the workpiece.
Cold Start	Restores the settings of the power supply back to its original condition.
Converter	The device that converts electrical energy into mechanical vibrations at a high frequency (an ultrasonic rate).
Counters	A record of the number of preset cycles recorded in the power supply.
Degating	Removing a molded part from its runner system
Energy Director	A triangular-shaped projection of plastic material which concentrates the ultrasonic energy at the joint interface of a plastic part.
External Amplitude Control	Enables you to access real-time amplitude control directly via the user I/O connector.
External Frequency Control	Enables you to access real-time frequency offset control directly via the user I/O connector.
Fixture	A device for holding a part in position for assembly.
Flash	Material displaced from the joint area.
Forming	Reshaping a section of thermoplastic.
Fretting Corrosion	A black surface condition, that results from friction between metal parts, that appears on the converter-booster-horn stack mating surfaces.
Frequency	The operating frequency of the ultrasonic stack. The frequency stored is measured at the end of the ultrasonic portion of the cycle (when ultrasonics are terminated).


Table 2.7 Glossary

Name	Description
Frequency Offset	An offset factor applied to the ultrasonic frequency stored in the power supply.
Gain	The ratio of output to input amplitude of a horn or booster.
Horn	A bar or metal section, usually one half-wavelength-long which transfers vibratory energy to the workpiece.
Horn Amplitude	The peak-to-peak displacement of a horn at its work face.
Horn Signature	A scan to enhance selection of operating frequency and control parameters.
Insertion	The process of embedding a metal component in plastic.
Interface	<ol style="list-style-type: none"> 1. The contact surface of two mating parts. 2. The connection between two pieces of equipment.
Joint	The weld surfaces.
Parameter	A unique factor or element which affects the welding operation in a particular mode.
Parameter Range	Valid range of parameters accepted for a particular setup.
Power Supply	The electronic instrument in an ultrasonic assembly system which changes conventional 50/60 Hz electrical power into high frequency electrical power at 20 kHz, 30 kHz or 40 kHz.
Seek	The activation of ultrasonics at a low-level (10 %) amplitude, for the purpose of finding the resonant frequency of the stack.
Staking	The process of melting and reforming a plastic stud to mechanically lock a dissimilar material in place.
Swaging	The process of capturing another component of an assembly by melting and reforming a ridge of plastic.
Thermoplastic	A polymer which undergoes a reversible change of state when subjected to heat.
Thermoset	A polymer which undergoes an irreversible change when subjected to heat.
Ultrasonic Power	Presence of ultrasonic power at the horn face.
Ultrasonic Welding	The use of ultrasonic vibrations to generate heat and subsequently melt the mating surfaces of two thermoplastic parts. When ultrasonic vibrations stop, the molten material resolidifies, and a weld occurs.
User ID	A unique 12 character long alphanumeric ID used to keep track of user access to the web page interface.
Weld System	A combination of components required to perform an ultrasonic operation. Usually consists of a power supply, converter, booster, and horn, with either an actuator or a handheld device, or in a fixed, mounted location.

Chapter 3: Delivery and Handling

- 3.1 Shipping and Handling32**
- 3.2 Receiving.33**
- 3.3 Unpacking the Power Supply34**
- 3.4 Take Inventory of Small Parts35**
- 3.5 Returning Equipment36**

3.1 Shipping and Handling

CAUTION	Heavy Object
	<p>The power supply may be heavy. Handling, unpacking, and installation may require the assistance of a colleague or the use of lifting platforms or hoists.</p>

3.1.1 Environmental Specifications

The DCX A Rack Mount Power Supply is an electronic unit that converts line voltage to ultrasonic energy and responds to user input for regulating the weld process. Its internal components are sensitive to static discharge, and many of its components can be harmed if the unit is dropped, shipped under improper conditions, or otherwise mishandled.

The following environmental guidelines should be respected in the shipping of the power supply.

Table 3.1 Shipping Specifications

Environmental Condition	Acceptable Range
Storage / Shipping Temperature	-25°C / -13°F to +55°C / +131°F (+70°C / +158°F for 24 hours)
Shock / Vibration (transit)	45 g shock / 0.5 g and (3 to 100 Hz) vibration per ASTM 3332-88 and 3580-90
Drop Test	ISTA Procedure 1 & 2A (while packaged)
Humidity	Maximum 95%, non-condensing

3.2 Receiving

The DCX A Rack Mount Power Supply is a sensitive electronic device. Many of its components can be harmed if the unit is dropped or otherwise mishandled.


Scope of Delivery

Branson equipment is carefully checked and packed before dispatch. It is recommended, however, that you follow the procedure below upon receiving your DCX A Rack Mount Power Supply.


Inspect the Power Supply when it is delivered, take the following steps:

Table 3.2 Inspect the Power Supply

Step	Action
1	Verify that all parts are complete according to the packing slip.
2	Check the packing and the unit for damage (visual inspection).
3	Report any damage claims to your carrier immediately.
4	Determine if any component has become loose during shipping and, if necessary, tighten screws.

NOTICE	
	<p>If the goods delivered have been damaged during shipping, please contact the forwarding agent immediately. Retain packing material (for possible inspection or for sending back the unit).</p>

3.3 Unpacking the Power Supply

NOTICE	
	<p>If there are any visible signs of damage to the shipping containers or the product, or you later discover hidden damage, NOTIFY YOUR CARRIER IMMEDIATELY. Save the packing material.</p>

The power supply is fully assembled. It is shipped in a sturdy cardboard box. Some additional items are shipped in the box with the power supply. Note orientation of packaging material in case return/repack is necessary. When unpacking the power supply, take the following steps:

Table 3.3 Unpacking the Power Supply

Step	Action
1	Unpack the power supply as soon as it arrives. Save the packing material.
2	Verify you have all of the equipment ordered. Some components are packed inside other boxes.
3	Inspect the controls, indicators, and surface for signs of damage.
4	Remove the cover of the power supply to check if any components became loose during shipping.

3.4 Take Inventory of Small Parts

Table 3.4 Small Parts included with the Power Supply Assemblies

Part or Kit	20 kHz	30 kHz	40 kHz
Mylar®* plastic film Washer Kit	X	X	
Silicone Grease			X
Spanners (2)	X	X	X

* Mylar is a registered trademark of DuPont Teijin Films.

3.4.1 Cables

The RF cable connects the power supply to the converter. For automated systems you will also need a user I/O cable to monitor and control the power supply. Check your invoice for cable types and cable lengths.

Table 3.5 DCX A Rack Mount Power Supply System Cables

P/N	Description
100-240-383	Cable, RF 8 ft (2.5 m)
100-240-384	Cable, RF 15 ft (4.5 m)
100-240-385	Cable, RF 25 ft (7.5 m)
100-240-387	Cable, RF right angle 8 ft (2.5 m)
100-240-388	Cable, RF right angle 15 ft (4.5 m)
100-240-389	Cable, RF right angle 25 ft (7.5 m)
100-240-392	Cable, User I/O 25 ft (7.5 m)
100-240-393	Cable, User I/O 50 ft (15 m)
200-240-396	Cable Ethernet Cat 5e 7 ft (2.1 m)


3.5 Returning Equipment

If you are returning equipment to Branson Ultrasonic Corporation, please call your Customer Service Representative to receive approval to return the goods. Refer to [1.3 How to Contact Branson](#).

Chapter 4: Technical Specifications

4.1	Technical Specifications	38
4.2	Physical Description	40
4.3	Declaration of Conformity	41
4.4	UK Declaration of Conformity	42

4.1 Technical Specifications

NOTICE	
	All specifications are subject to change without notice.

4.1.1 Environmental Specifications

The DCX A Rack Mount Power Supply has the following environmental specifications:

Table 4.1 Environmental Specifications

Environmental Condition	Acceptable Range
Ambient Operating Temperature	+41°F to +104°F (+5°C to +40°C)
Storage / Shipping Temperature	-13°F to +131°F (-25°C to +55°C)
Operating Altitude	Up to 6560 ft (2000 m)
Humidity	Maximum 95%, non-condensing
IP Rating	2X
Altitude	Up to 3280ft (1000m)
Pollution degree	2
Overvoltage category	II

4.1.2 Electrical Specifications

The following tables list input voltage and current requirements for the DCX A Rack Mount Power Supply.

Electrical Input Operating Voltages

Table 4.2 Electrical Input Operating Voltages

Power Supply Rating	Input Operating Voltage
All Models	200 V to 240 V Nominal (180 V Min.* to 253 V Max.), 50 Hz or 60 Hz, Single Phase
	24 VDC, 2.5 A

* 200 V Min. for 4 kW units.

Input Current and Fuse Specifications

Table 4.3 Input Current and Fuse Specifications

Model	Power	Current Rating
20 kHz	1250 W	7 A Max. @ 200 - 240 V / 15 A Fuse
	2500 W	14 A Max. @ 200 - 240 V / 15 A Fuse
	4000 W	25 A Max. @ 200 - 240 V / 25 A Fuse
30 kHz	1500 W	10 A Max. @ 200 - 240 V / 15 A Fuse
40 kHz	800 W	5 A Max. @ 200 - 240 V / 15 A Fuse

Continuous Duty Maximum Power

Table 4.4 Continuous Duty Maximum Power

Model	Power	Continuous Duty Max. Power
20 kHz	1250 W	375 W
	2500 W	750 W
	4000 W	1200 W
30 kHz	1500 W	450 W
40 kHz	800 W	240 W

NOTICE



High duty cycles require additional cooling for the converter. For information on converter cooling refer to [5.7 Converter Cooling](#) in [Chapter 5: Installation and Setup](#).

NOTICE



System average power must be limited to the specified continuous maximum. Duty cycle for each power and frequency is 1 second on and 2.4 seconds off.

Cycle Rate – up to 200 cpm. Cycle rate including off time is application and stack dependent.

4.2 Physical Description

This section describes the physical dimensions of the DCX A Rack Mount Power Supply.


NOTICE	
	Dimensions are nominal.

Table 4.5 Dimensions and Weights of DCX A Rack Mount Power Supply

Size	Width	Height	Depth	Weight
Small	4.2" 106 mm	5.07" 128 mm	22" 560 mm	8 lb 3.6 kg
Medium	5.6" 142 mm			12 lb 5.4 kg
Large	8.4" 213 mm			15 lb 6.8 kg

For detailed dimensional information refer to [Chapter 5: Installation and Setup](#).

4.3 Declaration of Conformity

Figure 4.1 Declaration of Conformity

EU DECLARATION OF CONFORMITY

CE

We, the manufacturer

BRANSON ULTRASONICS CORPORATION
120 Park Ridge Rd.
Brookfield, CT 06804
USA

represented in the community by

BRANSON ULTRASONICS, a.s.
Piestanska 1202
91501 Nove Mesto nad Vahom
Slovak Republic

expressly declare under our sole responsibility that the following electrical equipment product:

Ultrasonic Assembly System consisting of an Ultrasonic Power Supply, model:

0.80 DCX(S, A, f-EIP, or f-DP) 40 RACKMT	0.40DCX(s, v, a, f-dp or f-eip)40(VRT, V, H or HOR)
1.50 DCX(S, A, f-EIP, or f-DP) 30 RACKMT	0.80DCX(s, v, a, f-dp or f-eip)40(VRT, V, H or HOR)
1.25 DCX(S, A, f-EIP, or f-DP) 20 RACKMT	0.75DCX(s, v, a, f-dp or f-eip)30(VRT, V, H or HOR)
2.50 DCX(S, A, f-EIP, or f-DP) 20 RACKMT	1.50DCX(s, v, a, f-dp or f-eip)30(VRT, V, H or HOR)
4.00 DCX(S, A, f-EIP, or f-DP) 20 RACKMT	1.25DCX(s, v, a, f-dp or f-eip)20(VRT, V, H or HOR)
DCX RM 222 STD	2.50DCX(S+, s, v, a, f-dp or f-eip)20(VRT, V, H or HOR)
DCX RM 240 STD	4.00DCX(S+, s, v, a, f-dp or f-eip)20(VRT, V, H or HOR)
DCX RM 222 B	4.00DCXs20HD -V
DCX RM 240 B	P/S 0.8 DCX S HD 40 VRT
DCX RM 480 STD	1.50 DCX-S HD 30 HOR
DCX RM 315 STD	1.50 DCX-S HD 30 VRT
DCX RM 211 STD	4.00DCXs20HD -H
DCX RM 480 B	P/S 0.8 DCX S HD 40 HOR
DCX RM 315 B	P/S 4.0KW 20KHZ DCX S LIM RES
DCX RM 211 B	1.6DCX(a, f-dp or f-eip)40(B2H or B2V)
P/S 2.20 DCX STD 20 SIG	

used with converter model: CR-20S, CR-20C, CH-20C, CS-20S, CS-20C, CR-30, CR-30C, CH-30, CH-30C, CS-30S, CS-30C, CR-40C, 4TH, 4TP or 932, and associated cables.

in the state in which it was placed on the market, fulfills all the relevant provisions and their amendments of:

Low Voltage Directive 2014/35/EU
EMC Directive 2014/30/EU
RoHS Directive 2011/65/EU

The object of this declaration is in conformity with relevant Union harmonization legislation. The electrical equipment product, to which this declaration relates, is in conformity with the following standards:

EN 61010-1:2010+A1:2019
EN 55011:2016/A11:2020
EN 61000-6-2:2005/AC:2005

Brookfield, CT, USA

Luis Benavides

Luis Benavides (Sep 23, 2024 10:10 CDT)

Sr. Engineering Manager / Product Safety Officer

4.4 UK Declaration of Conformity

Figure 4.2 UK Declaration of Conformity



UK DECLARATION OF CONFORMITY

We, the manufacturer

BRANSON ULTRASONICS CORPORATION
 120 Park Ridge Rd.
 Brookfield, CT 06804
 USA

expressly declare under our sole responsibility that the following electrical equipment product:

Ultrasonic Assembly System consisting of an Ultrasonic Power Supply, model:

- | | |
|--|---|
| 0.80 DCX(S, A, f-EIP, or f-DP) 40 RACKMT | 0.40DCX(s, v, a, f-dp or f-eip)40(VRT, V, H or HOR) |
| 1.50 DCX(S, A, f-EIP, or f-DP) 30 RACKMT | 0.80DCX(s, v, a, f-dp or f-eip)40(VRT, V, H or HOR) |
| 1.25 DCX(S, A, f-EIP, or f-DP) 20 RACKMT | 0.75DCX(s, v, a, f-dp or f-eip)30(VRT, V, H or HOR) |
| 2.50 DCX(S, A, f-EIP, or f-DP) 20 RACKMT | 1.50DCX(s, v, a, f-dp or f-eip)30(VRT, V, H or HOR) |
| 4.00 DCX(S, A, f-EIP, or f-DP) 20 RACKMT | 1.25DCX(s, v, a, f-dp or f-eip)20(VRT, V, H or HOR) |
| DCX RM 222 STD | 2.50DCX(S+, s, v, a, f-dp or f-eip)20(VRT, V, H or HOR) |
| DCX RM 240 STD | 4.00DCX(S+, s, v, a, f-dp or f-eip)20(VRT, V, H or HOR) |
| DCX RM 222 B | 4.00DCXs20HD -V |
| DCX RM 240 B | P/S 0.8 DCX S HD 40 VRT |
| DCX RM 480 STD | 1.50 DCX-S HD 30 HOR |
| DCX RM 315 STD | 1.50 DCX-S HD 30 VRT |
| DCX RM 211 STD | 4.00DCXs20HD -H |
| DCX RM 480 B | P/S 0.8 DCX S HD 40 HOR |
| DCX RM 315 B | P/S 4.0KW 20KHZ DCX S LIM RES |
| DCX RM 211 B | 1.6DCX(a, f-dp or f-eip)40(B2H or B2V) |
| P/S 2.20 DCX STD 20 SIG | |

used with converter model: CR-20S, CR-20C, CH-20C, CS-20S, CS-20C, CR-30, CR-30C, CH-30, CH-30C, CS-30S, CS-30C, CR-40C, 4TH, 4TP or 932, and associated cables.

in the state in which it was placed on the market, fulfills all the relevant provisions and their amendments of:

- Electrical Equipment (Safety) Regulations 2016
- Electromagnetic Compatibility Regulations 2016
- Restriction of the Use of Certain Hazardous Substances in Electrical and Electronic Equipment Regulations 2012.

The electrical equipment product, to which this declaration relates, is in conformity with the following designated standards:

- EN 61010-1:2010+A1:2019
- EN 55011:2016/A11:2020
- EN 61000-6-2:2005/AC:2005

Brookfield, CT, USA

Luis Benavides

Luis Benavides (Sep 23, 2024 10:10 CDT)


Sr. Engineering Manager / Product Safety Officer

Chapter 5: Installation and Setup

5.1	About Installation	44
5.2	Installation Requirements	45
5.3	Installation Steps	50
5.4	User I/O	53
5.5	Power Supply Setup	69
5.6	Assembling the Acoustic Stack	70
5.7	Converter Cooling	75
5.8	Testing the Installation.	77
5.9	Still Need Help?	78

5.1 About Installation

This chapter is intended to help the installer with the basic installation and setup of your new DCX A Rack Mount Power Supply.

CAUTION	Heavy Object
	The power supply, and related components are heavy. Handling, unpacking, and installation may require the assistance of a colleague or the use of lifting platforms or hoists.

International safety-related labels are found on the power supply. Those that are of importance during installation of the system are identified in [Figure 1.1 Safety-related Labels found on the DCX A Rack Mount Power Supply](#).

5.2 Installation Requirements


This section covers the location requirements, mounting options, power supply dimensions, environmental requirements, and electrical requirements, to help you plan and execute your installation successfully.

5.2.1 Installing the DCX A Rack Mount Power Supply in a Customer Rack

The power supply units can be installed in any rack complying with the 19" industrial standard.

For successful installation in a rack, the respective demands on the electric and cooling system have to be met.

- If multiple drawers are to be installed in a rack we recommend to provide three phase power to the rack in order to provide each drawer with a dedicated supply and one phase to each drawer.
- Particular care has to be taken that the heat generated during operation is dissipated. The heat generated depends on the power output by the module and the ambient conditions.
- The heat sink of the module is mounted on the right. Make sure that the cooling device is mounted in a way allowing the cooling air to pass freely on this side.
- For each group of four power supply modules installed one cooling drawer is required. The cooling drawers must be installed directly under the power supplies in order to ensure sufficient cooling.
- In case a filter element is used to clean the intake air, regular inspection and cleaning of the filter depending on the ambient conditions is required to maintain the airflow volume.
- To prevent thermal overload, the system is protected by thermostats which are reset automatically after cooling down.

NOTICE	
	<p>Three 105 CFM fans must be placed directly underneath each unit for cooling.</p>

5.2.2 Location

The power supply should be accessible for parameter changes and settings. The power supply should be located in an area away from radiators or heating vents.

The DCX A Rack Mount Power Supply must not be positioned so that is difficult to plug in or unplug the main power plug.

5.2.3 Dimensions

Refer to the illustrations on the pages that follow for dimensional drawings. All dimensions are approximate and may vary slightly:

[Figure 5.1 DCX A Rack Mount Power Supply Dimensional Drawing \(Small\)](#)

[Figure 5.2 DCX A Rack Mount Power Supply Dimensional Drawing \(Medium\)](#)

[Figure 5.3 DCX A Rack Mount Power Supply Dimensional Drawing \(Large\)](#)

Figure 5.1 DCX A Rack Mount Power Supply Dimensional Drawing (Small)

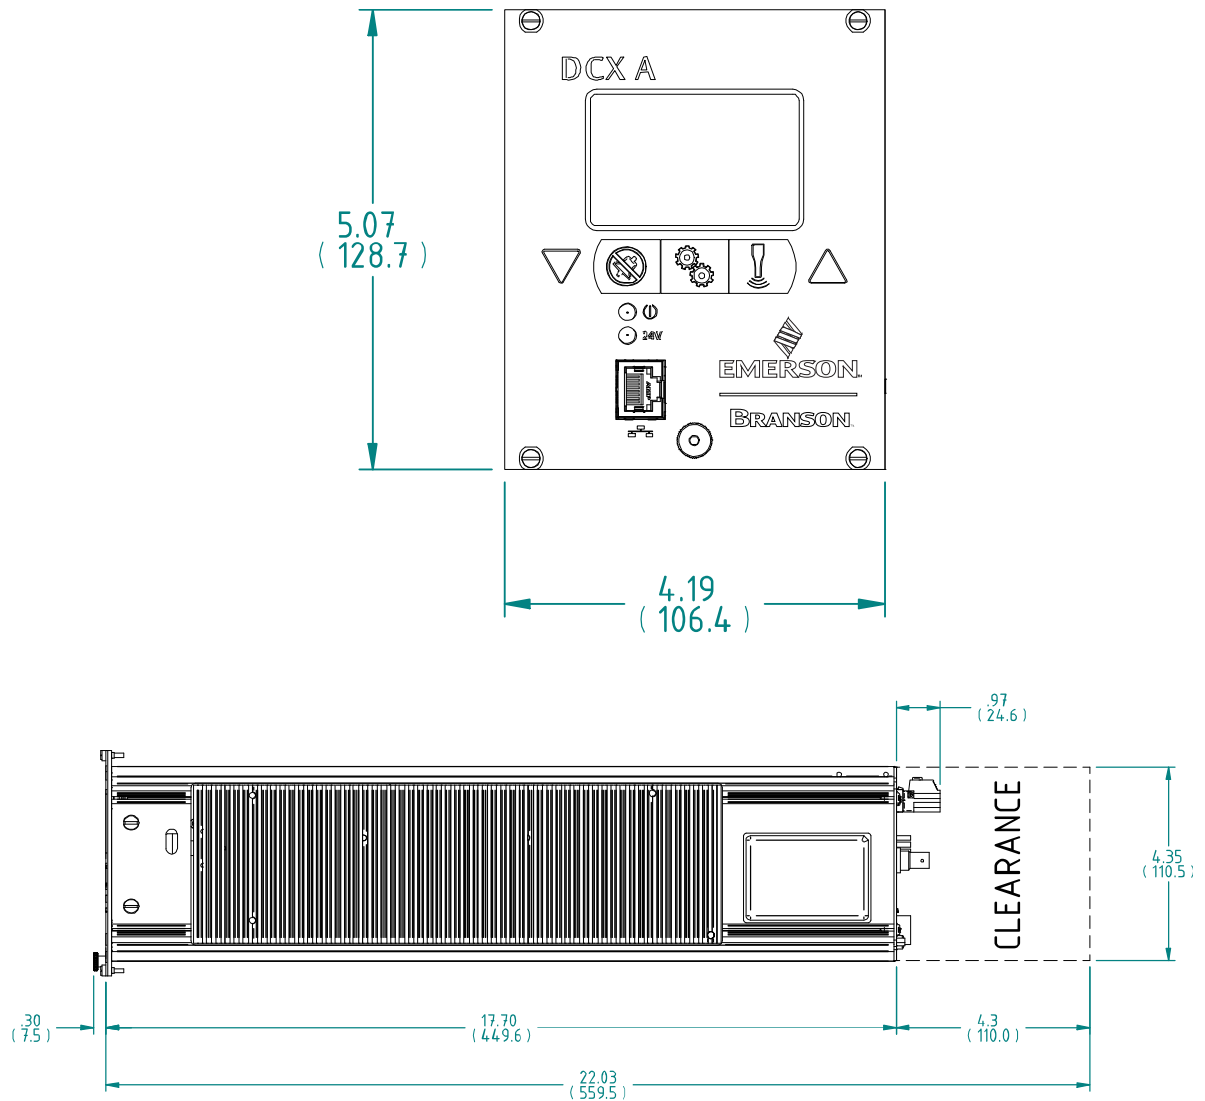


Figure 5.2 DCX A Rack Mount Power Supply Dimensional Drawing (Medium)


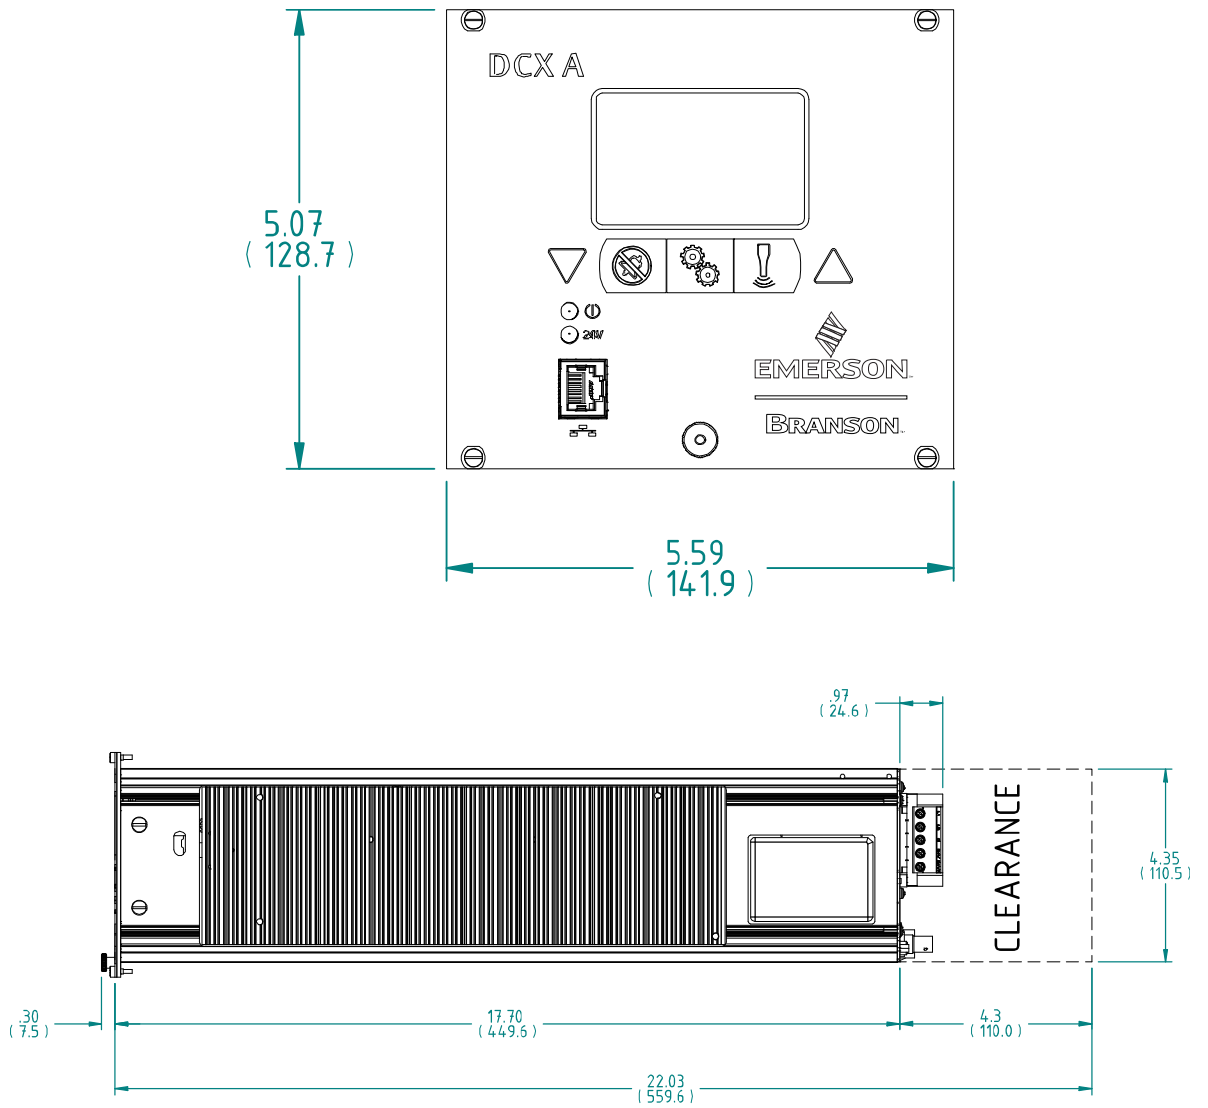


Figure 5.3 DCX A Rack Mount Power Supply Dimensional Drawing (Large)

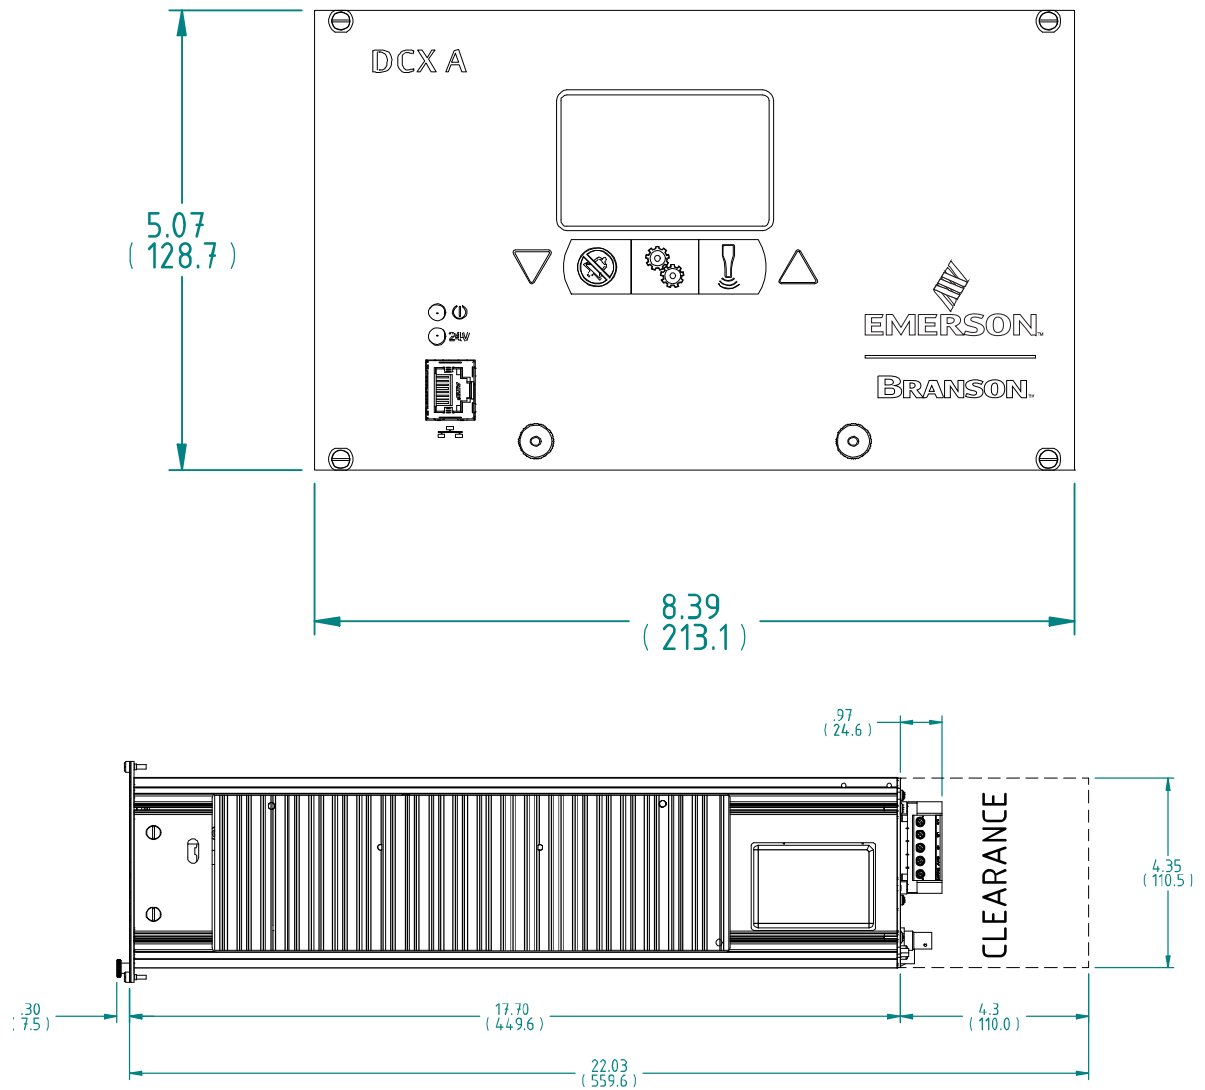

5.2.4 Environmental Requirements

Verify the DCX A Rack Mount Power Supply is operated in an environment that meets the temperature and humidity requirements indicated in [Table 5.1 Environmental Requirements](#).

Table 5.1 Environmental Requirements

Environmental Condition	Acceptable Range
Ambient Operating Temperature	+41°F to +104°F (+5°C to +40°C)
Storage / Shipping Temperature	-13°F to +131°F (-25°C to +55°C)
Operating Altitude	Up to 6560 ft (2000 m)
Humidity	Maximum 95%, non-condensing
IP Rating	2X
Altitude	Up to 3280ft (1000m)
Pollution degree	2
Overvoltage category	II

5.2.5 Electrical Input Power Ratings

Connect the power supply to a single-phase, grounded, 3-wire, 50 Hz or 60 Hz 200 V to 240 V power source. [Table 5.2 Input Current and Circuit Breaker Specifications](#) lists the current and breaker ratings for the various models.

Table 5.2 Input Current and Circuit Breaker Specifications

Model	Power	Current Rating
20 kHz	1250 W	7 A Max. @ 200 - 240 V / 15 A Breaker
	2500 W	14 A Max. @ 200 - 240 V / 15 A Breaker
	4000 W	25 A Max. @ 200 - 240 V / 25 A Breaker
30 kHz	1500 W	10 A Max. @ 200 - 240 V / 15 A Breaker
40 kHz	800 W	5 A Max. @ 200 - 240 V / 10 A Breaker


5.2.6 Pneumatic Requirements

Your welding system may require a cooling air stream for the converters. In continuous operations, or applications with longer duty cycles, it may be necessary to cool the horn as well as the converter.

Typically 80 cubic feet (2.26 m³) per hour of clean, dry, compressed air are required to cool most welding operations.

To verify the 80 cubic feet (2.26 m³) per hour cooling air stream required for your welding system, refer to [5.7 Converter Cooling](#).

5.3 Installation Steps

WARNING	High Voltage Hazard
	<p>To prevent the possibility of an electrical shock:</p> <ul style="list-style-type: none"> • Ensure the power source is disconnected before beginning work on line connections • Always plug the power supply into a grounded power source • To prevent the possibility of an electrical shock, ground the power supply by securing an AWG #14 grounded conductor to the ground screw located next to the air outlet • Ensure power supply installation is performed by qualified personnel and in accordance with local standards and regulations

All persons who are involved with installation, commissioning, operation and maintenance must have the required qualification, strictly follow this operating manual.


Basic installation notes:

- To avoid problems associated with EMI, you should route high power lines (AC and Ultrasonic RF) away from low power lines (controls signals).
- You should consider future troubleshooting and repair when installing all wiring. All wiring should be either color coded or tagged with industrial wire tags.
- The minimum cable bend radius is 5 times the cable outer diameter for RF cables.
- The minimum cable bend radius is 10 times the cable outer diameter for user I/O & Ethernet cables.
- Ground wires should not be shared with other equipment.
- All inductive coils must be suppressed with appropriate devices, such as diodes or RC networks.

5.3.1 Mount the Power Supply

The cable lengths are limited based on the operating frequency of the welding system. Performance and results can suffer if the RF cable is crushed, pinched, damaged or modified. Contact your Branson Representative if you have special cable requirements.


Do not place the power supply on the floor or in other locations that will allow dust, dirt or contaminants to be drawn into the power supply.


NOTICE	
	<p>Do not block exhaust and intake air circulation, which is needed to maintain a safe operating temperature.</p>

5.3.2 Mounting Considerations

In addition to the considerations mentioned above, the LCD's viewing angle should be taken into account when selecting a location for your DCX A Rack Mount Power Supply. The LCD is designed to be viewed from the top. Please refer to [Figure 5.4 LCD Viewing Angle](#) below when selecting a location for your DCX A Rack Mount Power Supply.

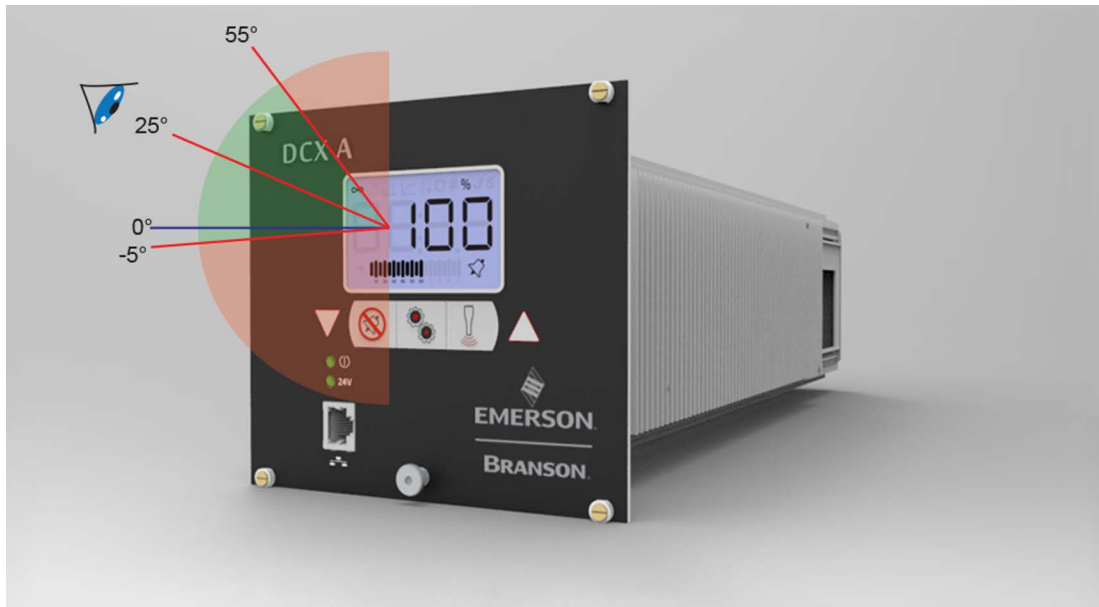Figure 5.4 LCD Viewing Angle



NOTICE	
	<p>Optimal viewing angle is 25° above the normal to the display (indicated by 0°).</p>

5.3.3 Electrical Connections

Figure 5.5 DCX A Rack Mount Power Supply Connections

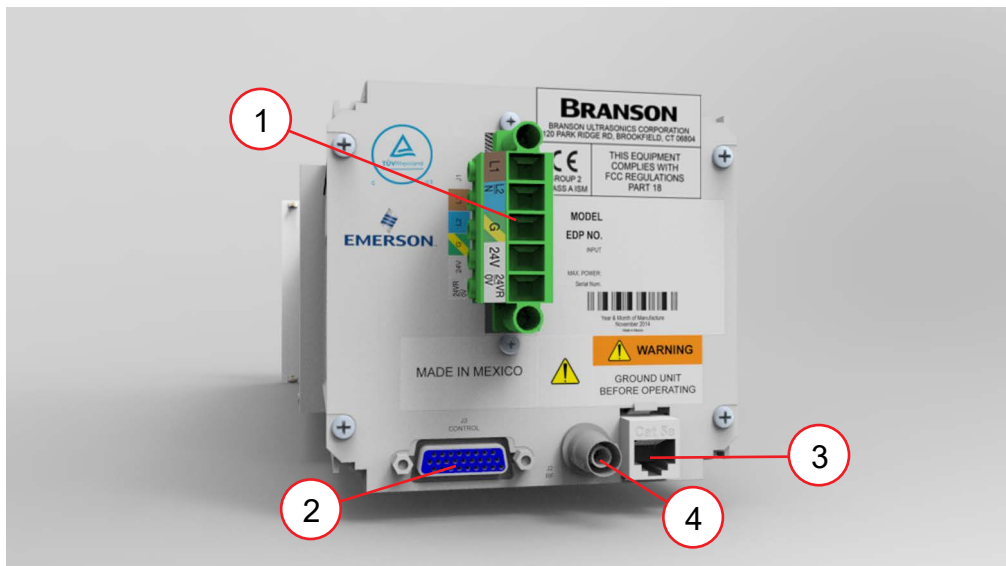



Table 5.3 DCX A Rack Mount Power Supply Connections


Item	Name
1	Line Input Connector
2	User I/O Connector
3	Ethernet Port
4	RF Connector

5.4 User I/O

5.4.1 User I/O Connections

NOTICE	
	User I/O interface is only available in manual mode.

The user I/O is a standard interface for automation, provided on the power supply. It provides the ability to make your own interface for your automation, actuator interface, special control, or reporting needs. The interface cable has a 26-pin HD male D-Sub connector on one end, and wires on the other end. Pins are wired to ICEA standard color code (see [Figure 5.6 User I/O Cable Identification and Wire Color Diagram](#) and [Table 5.5 User I/O Cable Pin Assignments](#)).

NOTICE	
	Ensure all unused wires are properly isolated. Failure to do so may result in a power supply malfunction.

Digital I/O functions can be configured to either active-high or active-low using the DCX A Rack Mount Power Supply Web Page Interface. [Table 5.7 Digital Input Functions](#) to [Table 5.10 Analog Output Functions](#) list the input and output functions available on the DCX A Rack Mount Power Supply. See [Table 5.6 Default Branson User I/O Connector Pin Assignments](#) for the default user I/O pin assignments.

[Figure 5.7 Typical Digital I/O Wiring Examples](#) and [Figure 5.8 Typical Analog I/O Wiring Examples](#) show typical wiring examples.

Figure 5.6 User I/O Cable Identification and Wire Color Diagram

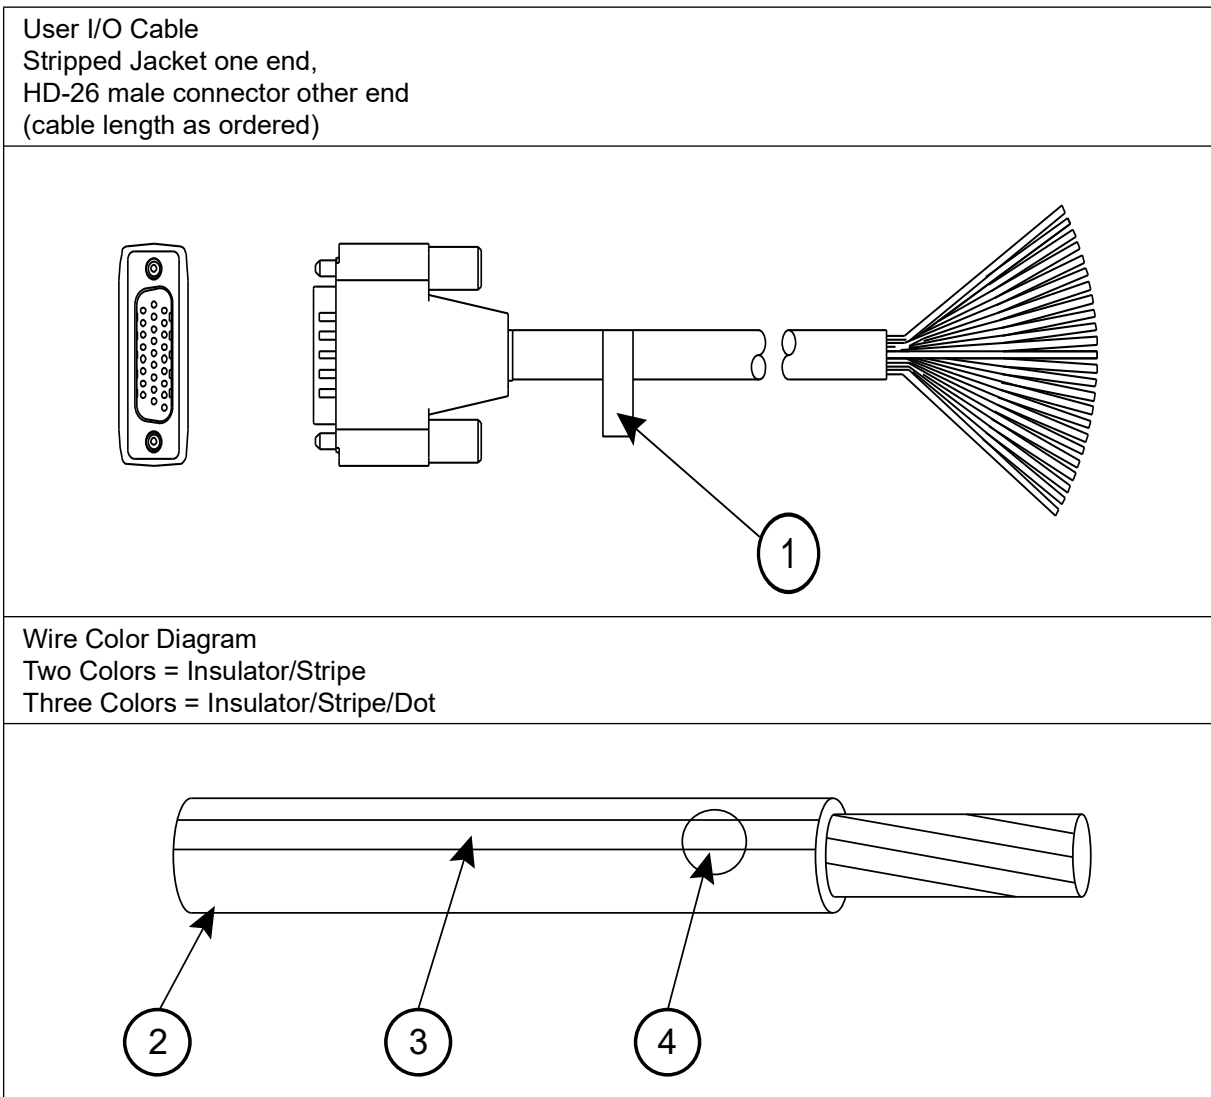


Table 5.4 User I/O Cable Identification and Wire Color Diagram

Item	Description
1	Part number
2	Insulation
3	Stripe
4	Dot

5.4.2 User I/O Cable Pin Assignments

Table 5.5 User I/O Cable Pin Assignments

Pin	Input/Output	Available Function	Signal Type	Signal Range	Color
1	Digital in 1	See Table 5.7 Digital Input Functions	Digital Input	0V to 24V \pm 10%, 12mA	Blk
2	Digital in 2				Wht
3	Digital in 3				Red
4	Digital in 4				Grn
5	+24V	N/A	24V Source	24V \pm 10%, 250mA Max	Orn
6					Blu
7	Digital out 1	See Table 5.8 Digital Output Functions	Digital Output	0V to 24V, \pm 10%, 25mA Max	Wht/Blk
8	Digital out 2				Red/Blk
9	Digital out 3				Grn/Blk
10	Digital out 4				Orn/Blk
11	Digital in 5	See Table 5.7 Digital Input Functions	Digital Input	0V to 24V \pm 10%, 12mA	Blu/Blk
12	Digital in 6				Blk/Wht
13	Digital in 7				Red/Wht
14	Ground	N/A	24V Ground	0V	Grn/Wht
15					Blu/Wht
16	Digital in 8	See Table 5.7 Digital Input Functions	Digital Input	0V to 24V \pm 10%, 12mA	Blk/Red
17	Analog in 1	See Table 5.9 Analog Input Functions	Analog Input	0V to +10V, 2mA	Wht/Red
18	Analog in 2				Orn/Red
19	Digital out 5	See Table 5.8 Digital Output Functions	Digital Output	0V to 24V \pm 10%, 12mA Max	Blu/Red
20	Digital out 6				Red/Grn
21	Digital out 7				Orn/Grn
22	Digital out 8				Blk/Wht/Red
23	Digital in 9	See Table 5.7 Digital Input Functions	Digital Input	0V to 24V \pm 10%, 12mA	Wht/Blk/Red

Table 5.5 User I/O Cable Pin Assignments

Pin	Input/Output	Available Function	Signal Type	Signal Range	Color
24	Analog out 1	See Table 5.10 Analog Output Functions	Analog Output	0V to 10V \pm 5%, 1mA Max	Red/Blk/Wht
25	Analog out 2				Grn/Blk/Wht
26	Analog Ground	N/A	Analog Ground	0V	Orn/Blk/Wht

5.4.3 Default Branson User I/O Connector Pin Assignments

Table 5.6 Default Branson User I/O Connector Pin Assignments

Pin	Input/Output	Signal Type	Signal Description
1	STD-External Start	Digital Input	Apply +24VDC to run cycle NOTICE Power supply must be in ready mode before External Start NOTICE Signal must be held for 10ms minimum
2	STD-External Seek		Apply +24VDC to perform a seek
3	STD-External Reset		Apply +24VDC to reset alarm
4	STD-Memory Clear		Apply +24VDC to clear memory
5 6	+24VDC Source	I/O Signal Source	+24V, 250mA Max
7	STD-Ready	Digital Output	+24V indicates the system is ready
8	STD-Sonics Active		+24V indicates ultrasonics are active
9	STD-General Alarm		+24V indicates an alarm occurred
10	STD-Seek/Scan Out		+24V indicates either Seek or a Scan is in progress
11	STD-Recall Preset 1	Digital Input	Bit 0 for preset recall binary code
12	STD-Recall Preset 2		Bit 1 for preset recall binary code
13	ACT-Ground Detect		Apply +24 VDC to activate ground detect
14 15	+24VDC Return and I/O Return	I/O Signal Return	Return for all pins except pins 17, 18, 24, and 25
16	ACT-Cycle Abort	Digital Input	Apply +24 VDC to abort cycle
17	Amplitude In	Analog Input	+1V to +10V (10% to 100%)*
18	Frequency Offset		+1V to +9V (5V is zero offset)

Table 5.6 Default Branson User I/O Connector Pin Assignments

Pin	Input/Output	Signal Type	Signal Description
19	STD-Confirm Preset Change	Digital Output	+24V indicates a load new preset request has occurred and the preset was successfully recalled
20	STD-Overload Alarm		+24V indicates an overload alarm occurred
21	STD-Plus Peak Power Limit Alarm		+24 V indicates a +peak power limit alarm occurred
22	STD-Minus Peak Power Limit Alarm		+24V indicates a -peak power limit alarm occurred
23	STD-Display Lock	Digital Input	Apply +24 VDC to lock the display
24	Power Out	Analog Output	0V to +10V (0% to 100%)
25	Amplitude Out		0V to +10V (0% to 100%)
26	Analog Signal Return	Analog Signal Return	Return for pins 17, 18, 24, and 25

*If the input signals are not within their valid range, or if left unconnected, the power supply will use 50% amplitude and zero frequency offset, respectively.

5.4.4 Digital Input Functions

Table 5.7 Digital Input Functions

Function	Description
ACT-Actuator Present	Must be active at power up to activate TRS, ULS, Interlock, Part in Place.
ACT-Cycle Abort	Will immediately terminate the current weld cycle and not accept another External Start until removed. Reset required is user settable.
ACT-Ground Detect	Will start scrub time. When scrub time expires, ultrasonics will be turned off.
ACT-Interlock In Place	Prevents a cycle from starting until the signal becomes active.
ACT-Part In Place	When enabled, signal must be active before weld cycle is started.
ACT-Trigger Switch (TRS)	Indicates the power supply to start ultrasonics.
ACT-Upperlimit Switch (ULS)	Tells the power supply that the actuator is at home position.
RF-Feedback A, B, C, D	Indicates which relay the RF switch has changed to. Bit 0 to bit 3 are binary coded values indicating the selected RF switch. It can also be uncoded. This function is user settable.
RF-Status Feedback	Indicates the RF switch has changed to the proper relay. NOTICE Single value. Not coded/uncoded like RF-Feedback A, B, C, D.
STD-Cable Detect	When enabled 24 volts must be present on pin at all times. If 24 volts is removed, suggesting that the cable has been removed, ultrasonics will not be allowed to run and will stop if already running.
STD-Display Lock	Locks the front panel display controls. Registers are read only when signal is active.
STD-External Amp Step Trigger	When set to +24 V sets amplitude to Amplitude 2. If set again to 0 V during a weld cycle will set amplitude back to Amplitude 1. Used only if amplitude stepping is turned on and set to external input.
STD-External Horn Scan	Starts horn scan. Signal must be maintained during the scan.
STD-External Reset	Resets alarm conditions.
STD-External Seek	Activates ultrasonic energy at 10 % amplitude for the purpose of finding the ultrasonic stack resonant frequency.

Table 5.7 Digital Input Functions

Function	Description
STD-External Sonics Delay	Delays the start of ultrasonics even if a trigger occurs. This can be used to enable an external operation to be complete before continuing the cycle (e. g. test device or part marking operation). If the delay is maintained for 1 minute, the cycle is aborted and all inputs must be cycled again.
STD-External Start	<p>Activates ultrasonic energy at the currently set amplitude.</p> <p>NOTICE DCX A Rack Mount Power Supply must be in ready mode before External Start.</p> <p>WARNING When using 0 V to activate ultrasonics (External Start signal), it is recommended to assign one input as Cable Detect to prevent sonics from activating if 24 V is lost by accident.</p>
STD-External Test	Performs a test cycle. Signal must be maintained.
STD-Load New Preset	Loads a weld preset as defined by Recall Preset Bits 1-32.
STD-Memory Clear	Centers the power supply start frequency.
STD-Recall Preset 1, 2, 4, 8, 16, 32	Bit 0 to bit 5 for preset recall binary code. This code will be used to recall a preset when Load Preset input is activated.
STD-Sonics Disable	Prevents ultrasonics from coming on. If active throughout a weld cycle, the cycle will be performed but without ultrasonics. Should the weld mode be time indeterminate (energy, power, etc) then the weld time will extend to the cutoff time.
STD-Start Cycle	Starts a cycle.

5.4.5 Digital Output Functions

Table 5.8 Digital Output Functions

Function	Description
ACT-Actuator Home	Indicates that a ULS input has been received.
ACT-Afterburst Delay	Indicates if the weld cycle is in the Afterburst Delay state.
ACT-Afterburst Time	Indicates if the weld cycle is in the Afterburst state.
ACT-End of Hold Time	Indicates the system has reached the end of Hold since the cycle started.
ACT-Holdtime	Indicates if the weld cycle is in the Hold Time state.
RF-Select A-D	Output to select stacks 1 to 4 or a binary coded value (bit 0-3) to select RF relay.
STD-Amp1 Amp2	If output is 0 V, indicates the amplitude setting is Amplitude 1. If output is 24 V, indicates the amplitude setting is Amplitude 2.
STD-Confirm Preset Change	Output will go active when a preset has been recalled.
STD-Custom Alarm	Indicates a Custom Alarm has occurred. This function is user defined.
STD-Cycle Okay	Output will go inactive with cycle start input, and will go high at the end of the cycle if no alarms occurred.
STD-Cycle Start Out	Indicates start signal is active. It will stay active through weld time and hold time.
STD-General Alarm	Indicates an alarm occurred. This function is user configurable.
STD-Minus Energy Limit Alarm	Indicates the weld did not reach the minimum energy set.
STD-Minus Time Limit Alarm	Indicates the weld time has not reached the minimum time set.
STD-Minus Peakpower Limit Alarm	Indicates the weld has not reached the minimum peak power set.
STD-Overload Alarm	Indicates an overload alarm has occurred.
STD-Plus Energy Limit Alarm	Indicates the weld has exceeded the maximum energy set.

Table 5.8 Digital Output Functions

Function	Description
STD-Plus Time Limit Alarm	Indicates the weld time did exceed the maximum time set.
STD-Plus Peakpower Limit Alarm	Indicates the weld has exceeded the maximum peak power set.
STD-Ready	If active, indicates the system is ready to start a weld cycle, enter test mode, or start a horn scan. If inactive, it indicates the system is already cycling, in test mode, performing a horn scan, or has a reset-required alarm.
STD-Seek/Scan Out	Indicates either a seek or a horn scan is in progress.
STD-Sonics Active	Indicates sonics are active.
STD-Start Signal Release	If output is active, it indicates the start signal can be removed. If output is inactive, it indicates start signal is either inactive or that it cannot yet be removed.
STD-Status	To be used to drive an external beeper. Single 0.5 second beeps will occur when trigger is received. Three Beeps indicate an alarm occurred (e.g. overload alarm). Beeps 0.5 seconds on, 0.5 seconds off long are in between each beep.
STD-Weldcycle Complete	Indicates if a weld cycle is no longer in process.

5.4.6 Analog Input Functions

Table 5.9 Analog Input Functions

Function	Description		Valid Range
Amplitude In	Controls the amplitude of ultrasonic energy that will be delivered by the power supply.		1 V to 10 V* (10 % to 100 %)
Frequency Offset	Controls the frequency offset to the power supply operating frequency. Actual offset depends on the power supply operating frequency:		1 V to 9 V* (5 V is zero offset)
	Frequency	Offset Range	
	20 kHz	+/- 400 Hz	
	30 kHz	+/- 600 Hz	
	40 kHz	+/- 800 Hz	

* If the input signals are not within their valid range, or if left unconnected, the power supply will use 50 % amplitude and zero frequency offset, respectively.


5.4.7 Analog Output Functions

Table 5.10 Analog Output Functions

Function	Description			Valid Range
Amplitude Out	Provides a 0 V to 10 V output signal proportional to amplitude (0 % to 100 %).			0 V to 10 V (0 % to 100 %)
Power Out	Provides a 0 V to 10 V output signal proportional to ultrasonic power output (0 % to 100 %).			0 V to 10 V (0 % to 100 %)
Frequency Out	Provides a 0 V to 10 V output signal that indicates memory plus offset. Actual frequency depends on the power supply operating frequency:			0 V to 10 V (5 V is zero offset)
	Frequency	Lower Limit (0 V)	Upper Limit (10 V)	
	20 kHz	19,450 Hz	20,450 Hz	
	30 kHz	29,250 Hz	30,750 Hz	
	40 kHz	38,900 Hz	40,900 Hz	


5.4.8 Typical Digital I/O Wiring Examples

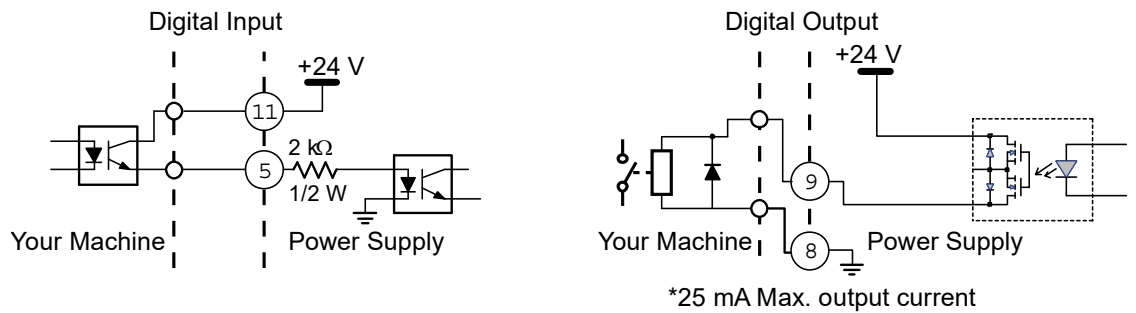Figure 5.7 Typical Digital I/O Wiring Examples



5.4.9 Typical Analog I/O Wiring Examples

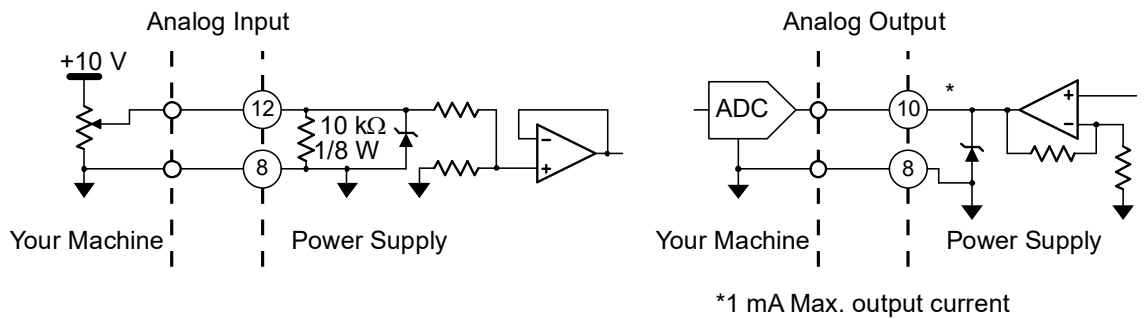
Figure 5.8 Typical Analog I/O Wiring Examples




5.4.10 Output Power (RF Cable) Connection

Ultrasonic energy is delivered to the SHV connector on the power supply, which is then transmitted to the converter via the RF cable. The RF connector position depends on the power supply configuration. For Horizontal models it is located on the rear panel of the power supply. For Vertical models it is located on the bottom panel of the power supply.

To reduce electromagnetic interference (EMI), RF cables are equipped with a ferrite core (plastic case) on one end. This end is meant to be connected to the power supply.

WARNING	High Voltage Hazard
	<p>Operating the System with the RF Cable disconnected or damaged can present an electrical shock hazard.</p>

WARNING	High Voltage Hazard
	<p>To avoid the possibility of electrical shock, converters need to be properly grounded.</p>


NOTICE	
	<p>To avoid the possibility of EMI interference, ensure the RF connection to the power supply is made with the cable end that has the ferrite core box attached (see Figure 5.9 RF Cable Connection).</p>

Figure 5.9 RF Cable Connection

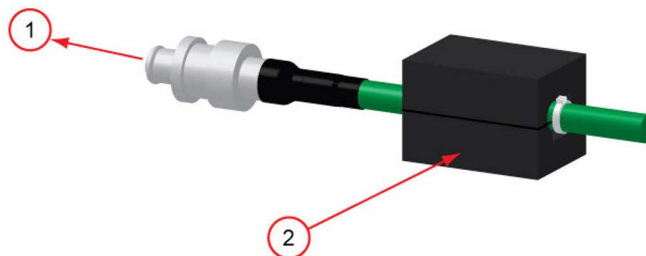





Table 5.11 RF Cable Connection

Item	Description
1	To Power Supply
2	Ferrite Core Box

5.4.11 Input Power Connection

WARNING	High Voltage Hazard
	<p>Ensure all electrical power is off when wiring input power to your DCX A Rack Mount Power Supply connector block.</p> <p>To prevent the possibility of an electrical shock, ground the power supply by securing an AWG #14 grounded conductor to the ground screw located next to the air outlet.</p>

WARNING	High Voltage Hazard
	<p>If miss-wired, the power supply can present an electrical shock hazard.</p>

NOTICE	
	<p>The power supply can be permanently damaged if it is connected to the incorrect line voltage, or if the connection is mis-wired.</p>

Use the following procedure to connect the power supply to a 24 VDC 2.5A external power supply and to a single-phase, grounded 3-wire, 50 Hz or 60 Hz 200 V to 230 V power source. The 24 VDC power supply must be safety certified and agency approved.

Table 5.12 Input Power Connection

Step	Action
1	Detach the connector block on the back of the power supply.
2	Use two properly sized wires (according to local standards) to connect a 24 VDC 2.5A power supply as shown on Figure 5.5 DCX A Rack Mount Power Supply Connections .
3	Use three properly sized wires (AWG #12, 2.5 mm or according to local standards) to connect the line 1, line 2, and ground to the connector block as shown on Figure 5.5 DCX A Rack Mount Power Supply Connections . Choose wires according to the current rating as specified in Table 5.2 Input Current and Circuit Breaker Specifications and on the label located on the back of the unit. Be sure to use agency approved wiring and use sleeving or tubing on each wire for double insulation.
4	Secure an AWG #12 grounded conductor to the ground screw located next to the air outlet.

Table 5.12 Input Power Connection

Step	Action
5	Connect the converter-booster-horn stack to the power supply using the RF cable. See 5.4.10 Output Power (RF Cable) Connection .
6	Ensure the power of the unit is disconnected. Plug the connector block back into the power supply. Tighten the two securing screws.
7	Connect the power supply to a single-phase, grounded, 3-wire, 50 Hz or 60 Hz 200 V to 230 V power source.

5.5 Power Supply Setup

Certain power supply configurations can be modified from the factory setting if needed. Although not usually requiring modifications from the factory setting, the following features are selectable:

Table 5.13 Power Supply Features

Name	Description
Afterburst	Allows for a short activation of ultrasonics at the end of the weld cycle to reliably release parts from the horn.
Cutoffs	Allows for setting parameter values for immediately terminating a weld cycle: Time (S); Energy (J); Peak Power (%); Frequency Low (Hz); Frequency High (Hz); Custom Input1 (V); and Custom Input2 (v).
End of Weld Store	Provides an option for selecting if the stack frequency is stored at the end of each weld cycle.
Energy Brake	Allows the user to set the power supply to reduce the amplitude before the sonics are shut off.
Frequency Offset	Allows for varying the start frequency by way of external controls (analog signal applied through the user I/O analog input) or setting a fixed value using the web page interface. This is useful for certain applications, where the force applied on the fixture or anvil causes a frequency shift in the stack's operation.
Limits	Allows for setting up limits within a weld mode: +/- Continuous; +/- Time (s); +/- Energy (J); or +/- Peak Power (%).
Mode	Allows for selecting the weld mode from the different available options: Continuous; Time (s); Energy (J); Peak Power (%); and Ground detect.
Power Up	Allows an option to configure the power supply to perform a seek on power up; a horn scan on power up; or to perform no action at power up.
Seek Ramp	Provides a selection for different power supply seek ramp times.
Seek Time	Provides an option for selecting seek duration.
Start Ramp	Provides a selection for different start ramp times. This controls how fast the amplitude of the horn rises from 0 to 100. Long ramp times may be useful when using large horns or high gain stacks.
Timed Seek	Provides an option for monitoring, and storing the operating frequency at timed intervals (60 seconds). Periodic frequency seeks may be helpful when welder is not used for long periods of time. Seeks are timed from the moment sonics was last activated.
Weld Amplitude	Allows for varying the amplitude (10% to 100%) using the front panel LCD, the web page interface, or by way of external controls (analog signal applied through the user I/O analog input). Via the web page interface scrub amplitude, afterburst amplitude, and amplitude stepping options may also be configured.

For instruction on how to change the power supply settings refer to [7.5 Configuring the Power Supply Registers](#) in [Chapter 7: Operation](#).

5.6 Assembling the Acoustic Stack




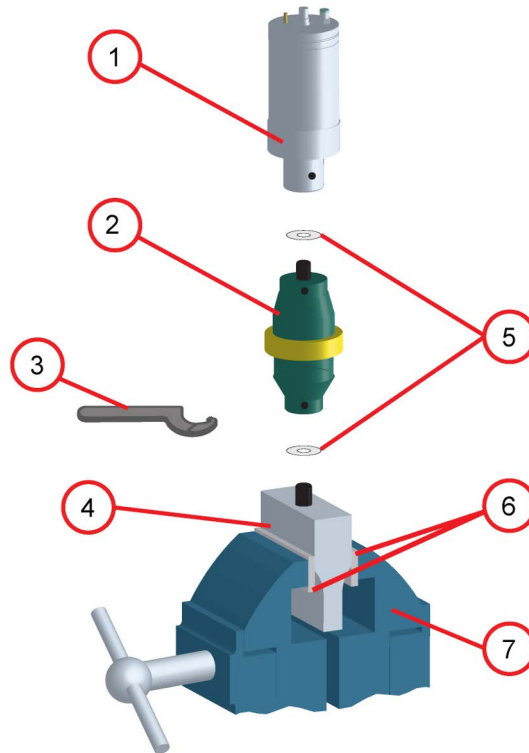
CAUTION	General Warning
	<p>The following procedure must be performed by a setup person. If necessary, secure the largest portion of a square or rectangular horn in a soft jawed vise. NEVER attempt to assemble or remove a horn by holding the converter housing or the booster clamp ring in a vise.</p>
CAUTION	General Warning
	<p>Do not use silicone grease with Mylar plastic film washers. Use only 1 (one) Mylar plastic film washer of the correct inside and outside diameters at each interface.</p>
NOTICE	
	<p>The use of a Branson torque wrench or the equivalent is recommended. P/N 101-063-787 for 20 kHz, and 30 kHz systems and 101-063-618 for 40 kHz systems.</p>

Figure 5.10 Assembling the Acoustic Stack

Acoustic Stack Description

Table 5.14 Acoustic Stack Description

Item	Description
1	Converter
2	Booster
3	Spanner (provided)
4	Horn
5	See stack assembly procedure
6	Vise Jaw protectors (aluminum or soft metal)
7	Vise

Stack Torque Values

Table 5.15 Stack Torque Values

Frequency	Torque
20 kHz	220 in·lb (24.85 N·m)
30 kHz	185 in·lb (21 N·m)
40 kHz	95 in·lb (10.73 N·m)

Tools

Table 5.16 Tools

Tool	EDP Number
20 kHz, and 30 kHz Torque Wrench Kit	101-063-787
40 kHz Torque Wrench	101-063-618
20 kHz Spanner Wrench	101-118-039
30 kHz Spanner Wrench	201-118-033
40 kHz Spanner Wrench	201-118-024
Silicone Grease	101-053-002
Mylar Plastic Film Washers (20 kHz)	100-063-357
Mylar Plastic Film Washers (30 kHz)	100-063-632

5.6.1 For a 20 kHz System

Table 5.17 20 kHz System

Step	Action
1	Ensure that the mating surfaces of the converter, booster, and horn are clean, and that the threaded holes are free of foreign material.
2	Install a single Mylar plastic film washer (matching the size of the washer to the stud) to each interface.
3	Assemble the converter to the booster and the booster to the horn.
4	Torque to 220 in·lb (24.85 N·m) at each interface.

5.6.2 For a 30 kHz System

Table 5.18 30 kHz System

Step	Action
1	Ensure that the mating surfaces of the converter, booster, and horn are clean, and that the threaded holes are free of foreign material.
2	Install a single Mylar plastic film washer (matching the size of the washer to the stud) to each interface.
3	Assemble the converter to the booster and the booster to the horn.
4	Torque to 185 in·lb (21 N·m) at each interface.

5.6.3 For a 40 kHz System

Table 5.19 40 kHz System

Step	Action
1	Ensure that the mating surfaces of the converter, booster, and horn are clean, and that the threaded holes are free of foreign material.
2	Coat each interface surface with a thin film of silicon grease - but do not apply silicon grease to a threaded stud or tip.
3	Assemble the converter to the booster and the booster to the horn.
4	Torque to 95 in·lb (10.73 N·m) at each interface.

5.6.4 Connecting Tip to Horn

1. Ensure that the mating surfaces of the tip and horn are clean. Remove any foreign matter from the threaded stud and hole.
2. Hand assemble the tip to the horn. Assemble dry. Do not use any silicone grease.
3. Use the spanner wrench and an open-end wrench (refer to [Figure 5.11 Connecting Tip to Horn](#)) and tighten to the following torque tip specifications:

Figure 5.11 Connecting Tip to Horn

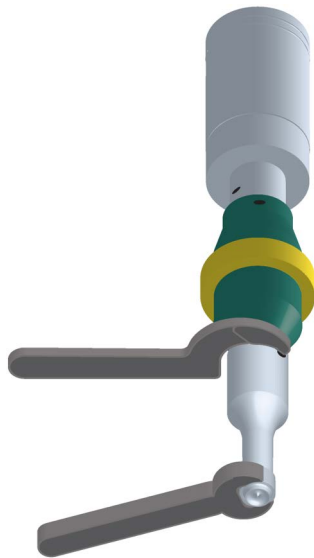


Table 5.20 Tip to horn torque values

Tip Thread	Torque
1/4 - 28	110 in·lbs (12.42 N·m)
3/8 - 24	180 in·lbs (20.33 N·m)

5.7 Converter Cooling

Converter performance and reliability can be adversely affected if the converter ceramics are subjected to temperatures above 140 °F (60 °C). The converter front driver temperature should not exceed 122 °F (50 °C).

To prolong converter life and maintain a high degree of system reliability, the converter should be cooled with clean, dry, compressed air, particularly if your application calls for continuous ultrasonic operation. Converter cooling is especially critical in 40 kHz applications.

Use one of the following procedures to determine if a converter is operating close to the maximum allowable temperature. Check converter temperature immediately after substantial machine operation and without power applied to the horn.

- Press a pyrometer probe (or similar temperature measuring device) against the front driver of the converter assembly. Wait for the probe to reach the temperature of the shell. If the temperature is 120 °F (49 °C) or higher, the converter requires a cooling air stream.
- If a temperature measuring device is unavailable, use your hand to feel the shell of the converter. If the converter is hot to touch, the converter requires a cooling air stream.

High duty cycles require additional cooling for the converter. System average power must be limited to the specified continuous maximum. Higher peak power, up to the maximum acceptable power limit, with an on time of up to 10 seconds may be obtained, if appropriate off time ensures that, on average, the continuous duty maximum power is not exceeded.

Table 5.21 Continuous Duty Max. Power & Full Power Duty Cycle

Configuration	Continuous Duty Max. Power	Full Power Duty Cycle
20 kHz / 1250 W	375 W	1 s on 2.4 s off (30% Duty Cycle)
20 kHz / 2500 W	750 W	1 s on 2.4 s off (30% Duty Cycle)
20 kHz / 4000 W	1200 W	1 s on 2.4 s off (30% Duty Cycle)
30 kHz / 1500 W	450 W	1 s on 2.4 s off (30% Duty Cycle)
40 kHz / 800 W	240 W	1 s on 2.4 s off (30% Duty Cycle)

If converter cooling is required, use the following steps:

Table 5.22 Converter Cooling Procedure

Step	Action
1	Start with a 50 psi (345 kPa) air source or higher from a 0.06 in (1.5 mm) I.D. orifice
2	Perform a run of welding operations.
3	Immediately after completing the welding run, check the converter temperature.
4	If the converter is still too hot, increase the diameter of the orifice in small increments until the temperature falls within the ranges in the chart.

A 0.06 in (1.5 mm) orifice at 50 psi (345 kPa) will result in a reading of 80 ft³ (2.26 m³) per hour. This should be sufficient to cool most operations requiring a cooling air stream. In continuous welding operations, or applications with longer duty cycles, it may be necessary to cool the horn as well as the converter. Horns may require cooling because of the heat transfer from contacting the work piece.

5.8 Testing the Installation

To test the power supply follow the procedure described in [7.8 Ultrasonics Test Procedure](#) in [Chapter 7: Operation](#).

5.9 Still Need Help?

Branson is pleased that you chose our product and we are here for you! If you need parts or technical assistance with your DCX A Rack Mount Power Supply system, call your local Branson representative. Please refer to [1.3 How to Contact Branson](#) for a list of Branson key contacts.

Chapter 6: Converters and Boosters

6.1 Converters and Boosters.....80

6.1 Converters and Boosters

A variety of converters and boosters available for use with the DCX A Rack Mount Power Supply are illustrated in the following pages.


WARNING	High Voltage Hazard
	<p>To avoid the possibility of electrical shock, converters need to be properly grounded.</p>

Figure 6.1 20 kHz typical Converter Dimensions

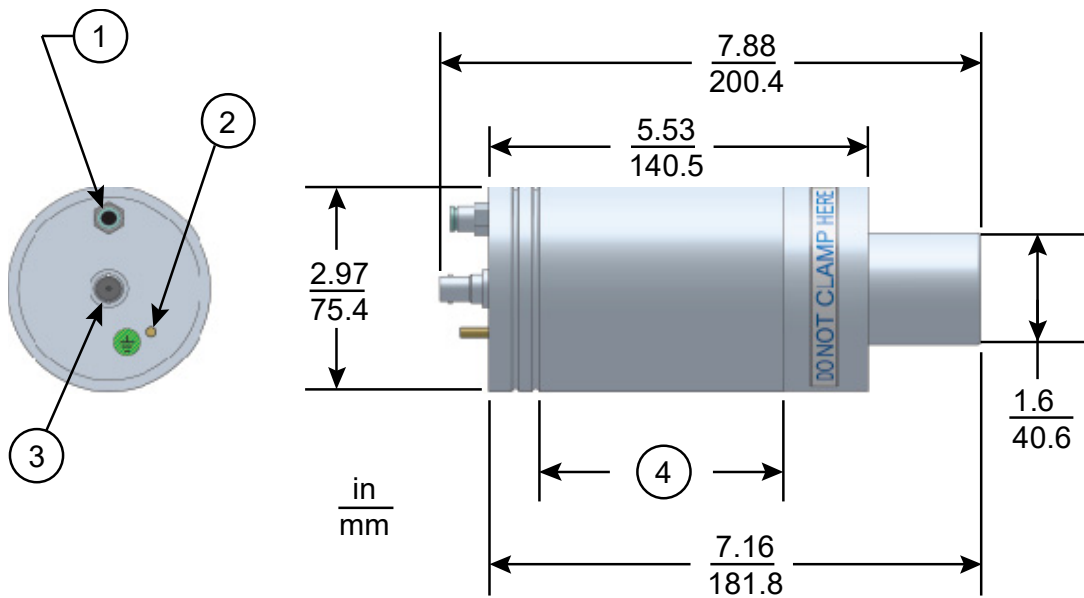


Table 6.1 20 kHz Converter

Item	Description
1	Air inlet
2	Ground stud
3	SHV connector
4	Grip area

Figure 6.2 20 kHz Booster Dimensions

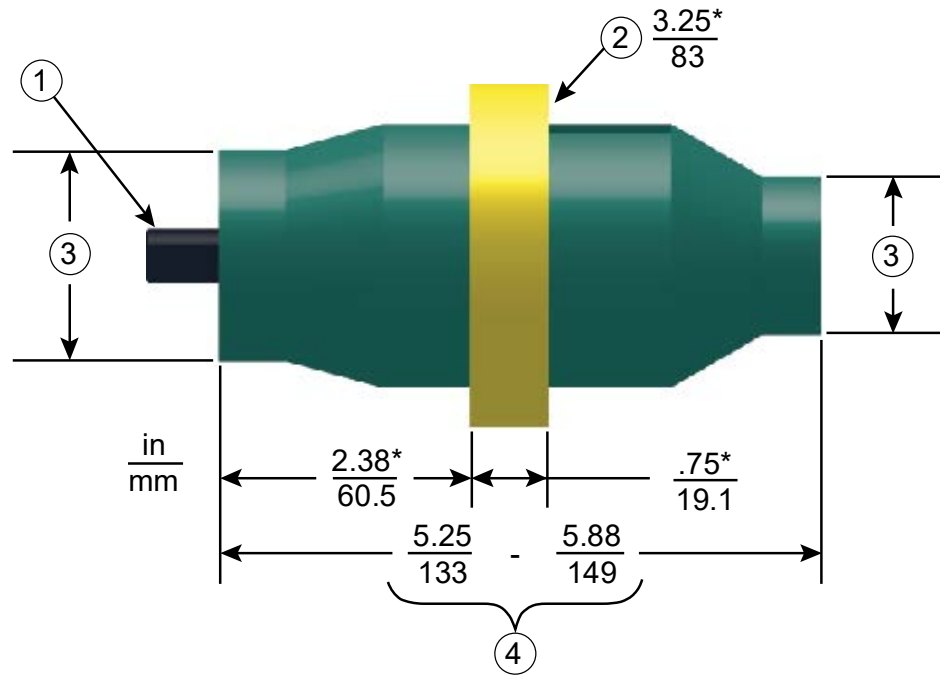


Table 6.2 20 kHz Booster

Item	Description
1	1/2 - 20 x 1 - 1/4 stud (Ti boosters) 1/2 - 20 x 1 - 1/2 stud (Al boosters)
2	Grip Ring Diameter
3	Variable
4	Varies with tuning and gain

* These dimensions do not vary.

Figure 6.3 20 kHz Converter/Booster/Horn, Typical Dimensions

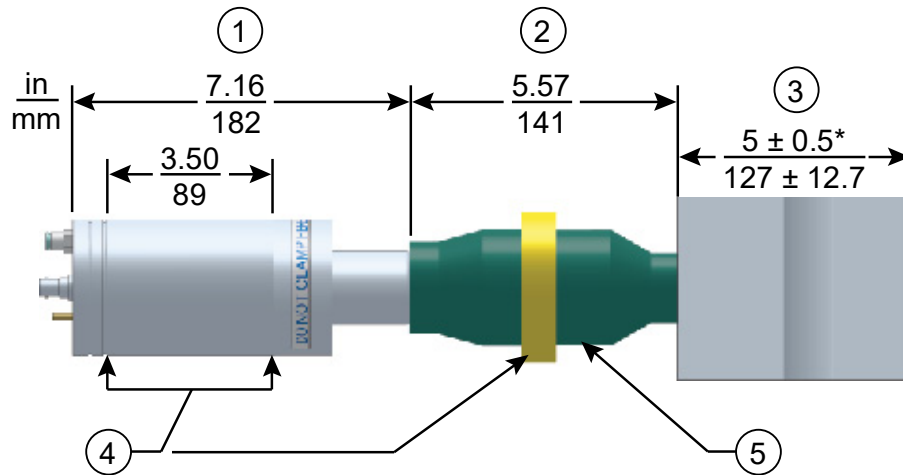


Table 6.3 20 kHz Converter/Booster/Horn

Item	Description
1	Converter
2	Booster
3	One-half wavelength horn
4	Recommended clamping area
5	Booster front end diameter will vary with amplitude

* Overall horn length can vary beyond these typical dimensions depending on the application.

Figure 6.4 30 kHz Converter Dimensions

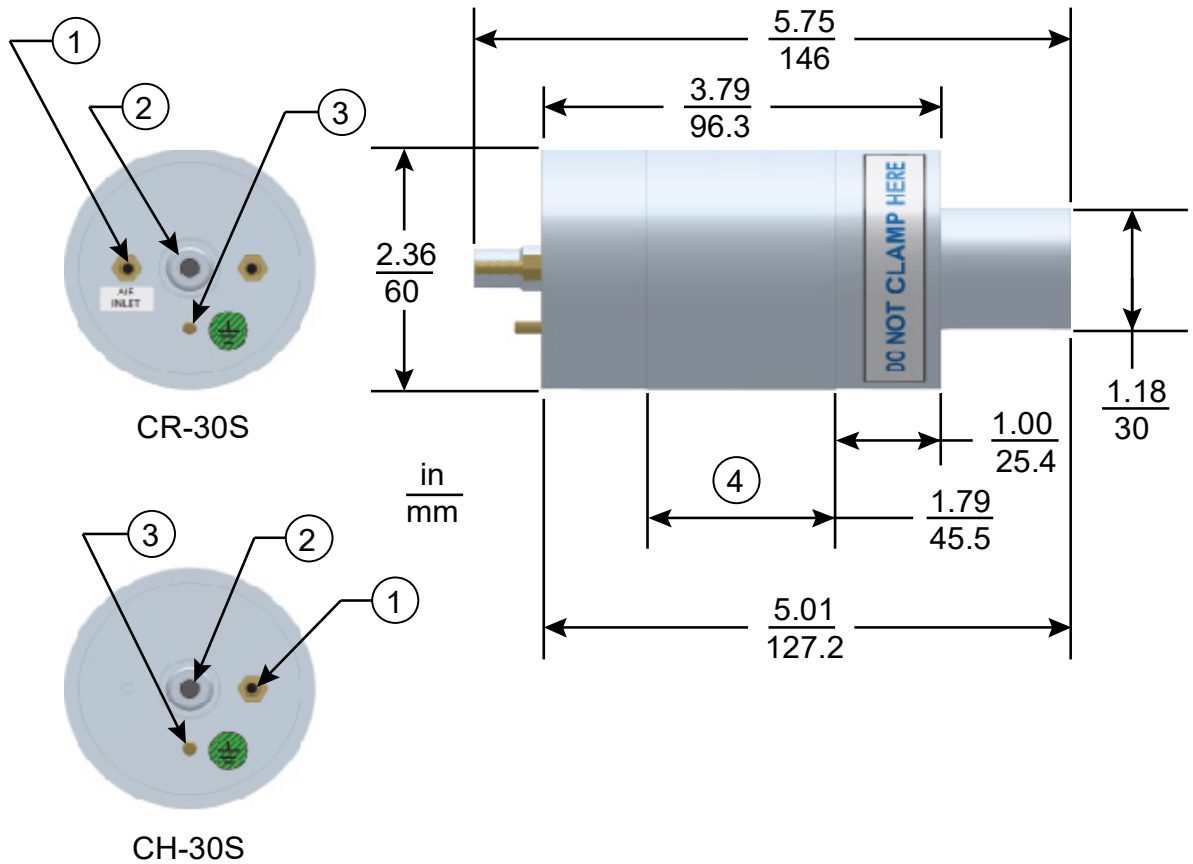


Table 6.4 30 kHz Converter

Item	Description
1	Air inlet
2	SHV connector
3	Ground stud
4	Grip area

CR-30S and CH-30S are dimensionally identical, and differ only in their respective cooling feature.

CR-30S has flow through cooling, and CH-30S has closed loop cooling (air circulates in the converter and returns to its source).

Figure 6.5 30 kHz Booster Dimensions

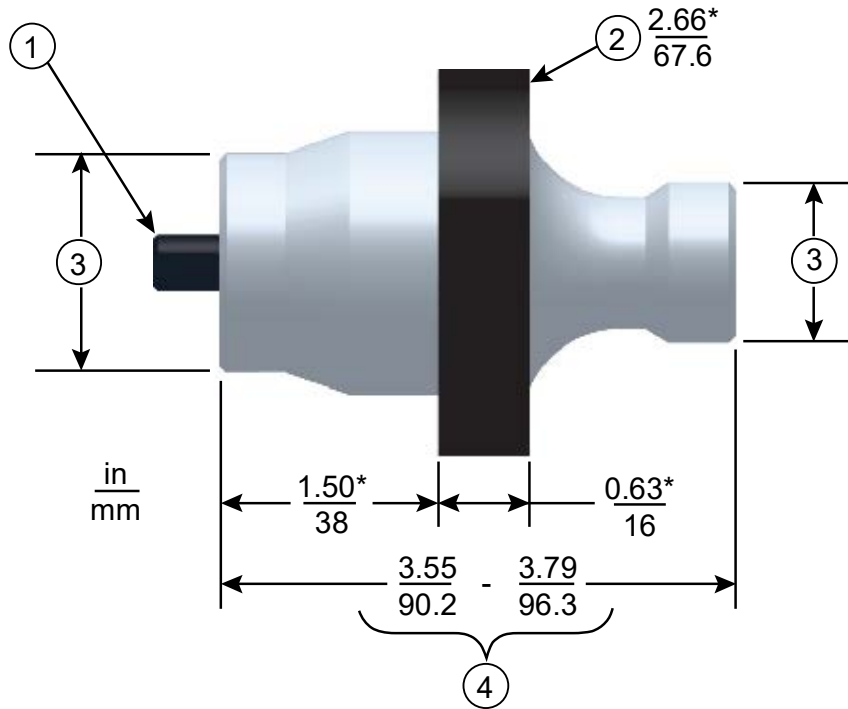


Table 6.5 30 kHz Booster

Item	Description
1	3/8 - 24 x 1 - 1/4 stud
2	Grip Ring Diameter
3	Variable
4	Varies with tuning and gain

* These dimensions do not vary.

Figure 6.6 30 kHz Converter/Booster/Horn, Typical Dimensions

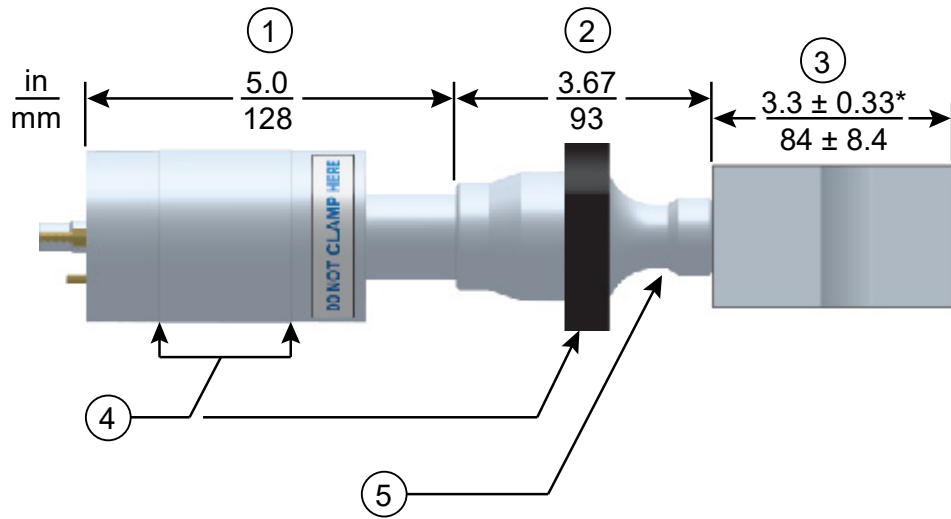


Table 6.6 30 kHz Converter/Booster/Horn

Item	Description
1	Converter
2	Booster
3	One-half wavelength horn
4	Recommended clamping area
5	Booster front end diameter will vary with amplitude

* Overall horn length can vary beyond these typical dimensions depending on the application.

Figure 6.7 40 kHz Booster Dimensions

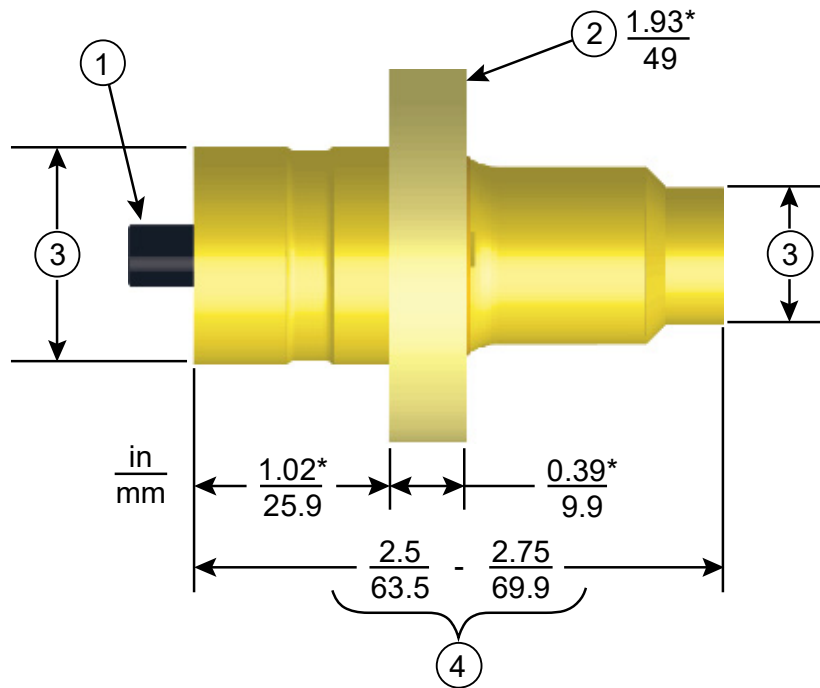


Table 6.7 40 kHz Booster

Item	Description
1	M8 x 1 - 1/4 stud (Ti boosters) M8 x 1 - 1/2 stud (Al boosters)
2	Grip ring diameter
3	Variable
4	Varies with tuning and gain

Figure 6.8 40 kHz Converter/Booster/Horn, Typical Dimensions

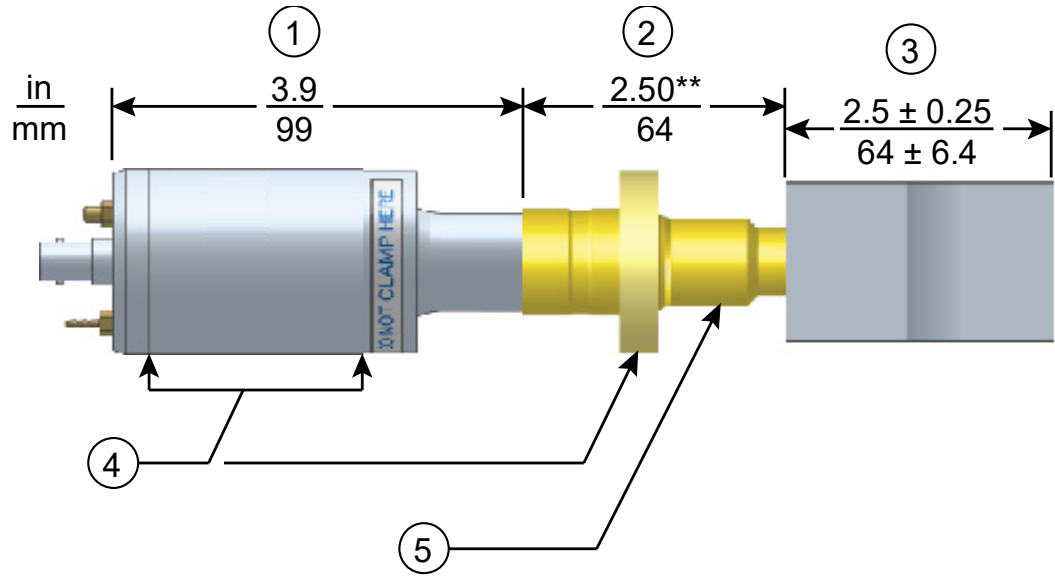


Table 6.8 40 kHz Converter/Booster/Horn

Item	Description
1	Converter
2	Booster
3	One-half wavelength horn
4	Recommended clamping area
5	Booster front end diameter will vary with amplitude

* Overall horn length can vary beyond these typical dimensions depending on the application.

** Dimension varies with tuning and gain.

6.1.1 Component Functional Description

Ultrasonic Stack

Converter

The converter is mounted in the customer's automation as part of the ultrasonic stack. The ultrasonic electrical energy from the power supply is applied to the converter (sometimes called the transducer). This transforms the high frequency electrical oscillations into mechanical vibrations at the same frequency as the electrical oscillations. The heart of the converter are piezoelectric ceramic elements. When subjected to an alternating voltage, these elements alternately expand and contract, resulting in better than 90 % conversion of electrical to mechanical energy.

Booster

It is important to be able to modify the horn face amplitude for successful ultrasonic assembly. The booster provides a means to modify the amplitude. It is designed to couple different ratios of ultrasonic energy to the horn, which will in turn increase or decrease the amplitude at the face of the horn. This is accomplished by varying the ratios of the masses of the input and output half sections of the booster.

The booster is a resonant half-wave section of aluminum or titanium. It is mounted between the converter and the horn, as part of the ultrasonic stack. It also provides a clamping point for rigid stack mounting.

Horn

The horn is selected or designed for a specific application. Each horn is tuned typically as a half-wave section that applies the necessary force and vibration uniformly to the parts to be assembled. It transfers ultrasonic vibrations from the converter to the workpiece. The horn is mounted to the booster as part of the ultrasonic stack.

Depending on their profile, horns are referred to as stepped, conical, exponential, bar, or catenoidal. The shape of the horn determines the amplitude at the face of the horn. Depending on the application, horns can be made from titanium alloys, aluminum, or steel. Titanium alloys are the best materials for horn fabrication due to their high level of strength and low loss. Aluminum horns are usually chrome- or nickel-plated or hard-coated to reduce wear. Steel horns are for low amplitude requiring hardness, such as ultrasonic insertion applications.

Solid Mount Boosters

The solid mount booster is a one-half wave-length resonant section made exclusively of titanium. It is mounted between the converter and the horn, modifying the amplitude of vibration applied to the horn and providing a clamping point.

The solid mount booster is superior to prior versions in that deflection is minimized. This is the result of a redesigned clamp-ring which employs a metal-to-metal press fit rather than an O-ring assembly.

The advantage this booster offers is its improved rigidity. For continuous applications, this means more energy delivered to the product, while in plunge applications, improved alignment is possible. The solid mount provides improved positional alignment and will benefit continuous applications where high force, high side load, or high cycle rates are necessary. In plunge welding applications, overall deflection is reduced by an average of 0.0025 in. (0.064 mm) over a wide variety of materials, joint designs, and operating conditions. The results of this testing in combination with information drawn from field testing indicate that the solid mount will benefit plunge applications where precision alignment is necessary (such as staking, swaging, or insertion) or where concentricity/parallelism is critical.

Chapter 7: Operation

7.1	Setting Primary Parameters	92
7.2	Setting Limits	103
7.3	Setting the Amplitude	116
7.4	Resetting the Power Supply Alarms	118
7.5	Configuring the Power Supply Registers	119
7.6	Save/Recall Presets	124
7.7	LCD Bar-Graph	127
7.8	Ultrasonics Test Procedure	130
7.9	Using the I/O Connections	132


7.1 Setting Primary Parameters

After analyzing your specific application, you can determine the Weld Mode to use to weld your parts. A Weld Mode is a set of parameters that governs the weld. (Contact the Branson Ultrasonics Applications Laboratory for more information on determining the best mode for welding your application. See [1.3 How to Contact Branson](#).)

There are five Weld Modes to choose from Continuous, Time, Energy, Peak Power, and Ground Detect Modes. The following table describes each mode:

Table 7.1 Summary of Weld Modes

Weld Mode	Description
Continuous	On this mode, ultrasonic energy will be delivered continuously while the start signal is present.
Time	You select the length of time (in seconds) that ultrasonic energy will be transmitted to your parts.
Energy	You select the amount of energy (in Joules) that will be transmitted to your parts. (A Joule is one Watt-Second.)
Peak Power	You select the peak power level (as a percentage of full power) at which the weld is terminated.
Ground Detect	<p>The DCX A Rack Mount Power Supply provides ultrasonic energy until the horn comes in contact with your electrically isolated fixture or with the anvil, providing that you made an electrical connection between the actuator and your fixture or anvil.</p> <p>NOTICE Ground detect signal is required to terminate the weld and enter scrub time.</p>

NOTICE	
	<p>In these modes, cutoffs can be used as secondary controls.</p>

7.1.1 Continuous Mode

In this mode, ultrasonic energy will be delivered continuously while the start signal is present. Within Continuous Mode, you can also select several other parameters, ranging from afterburst to limits and cutoffs. For more information on setting the optional parameters within Continuous Mode, or any other welding mode, refer to the DCX A/F Series Web Page Instruction Manual.

Table 7.2 Continuous Mode Operational Sequence

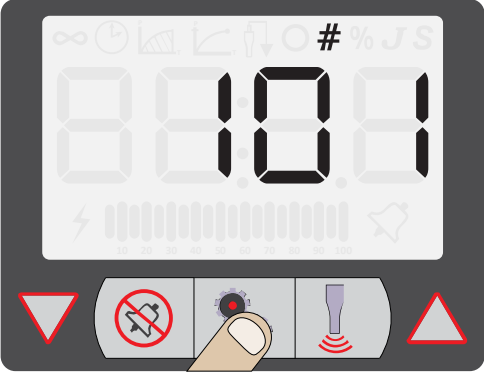
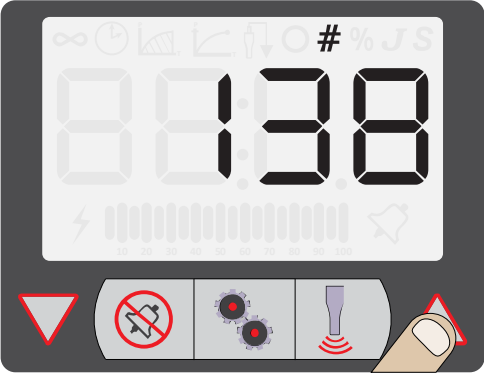
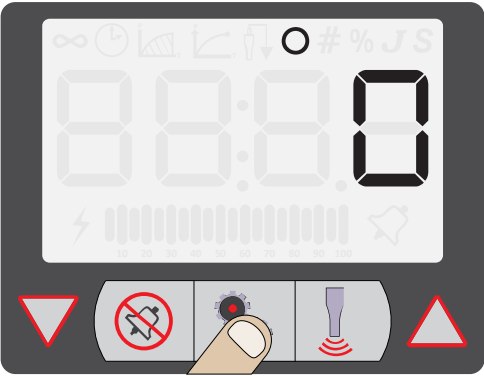
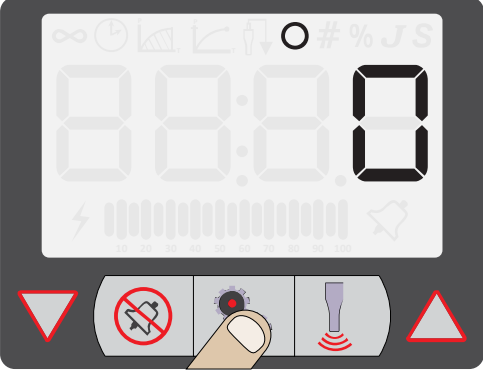

Step	Action	Reference
1	<p>Press the Configuration key until the number icon (#) appears on the LCD.</p> <p>The power supply will display register 101 at every power up.</p>	
2	<p>Press and release the Up/Down arrow keys to select register 138. For a detailed description of available registers refer to Table 7.26 Power Supply Registers.</p>	
3	<p>Once you have reached register 138, press the Configuration key. The register value will be displayed; this is indicated by the circle icon.</p>	

Table 7.2 Continuous Mode Operational Sequence

Step	Action	Reference
4	Use the Up/Down arrow keys to select value 0 (Continuous mode), then press the Configuration key to confirm the selection.	
5	Continuous mode icon and amplitude value will be displayed.	

7.1.2 Time Mode

You can use Time Mode to select the length of time that ultrasonic energy is applied to your parts. Within Time Mode, you can also select several other parameters, ranging from afterburst to limits and cutoffs. For more information on setting the optional parameters within Time Mode, or any other welding mode, refer to the DCX A/F Series Web Page Instruction Manual.

Table 7.3 Time Mode Parameters

Parameter	Default	Max. Value	Min. Value
Time	0.010 seconds	30 seconds	0.010 seconds

Table 7.4 Time Mode Operational Sequence



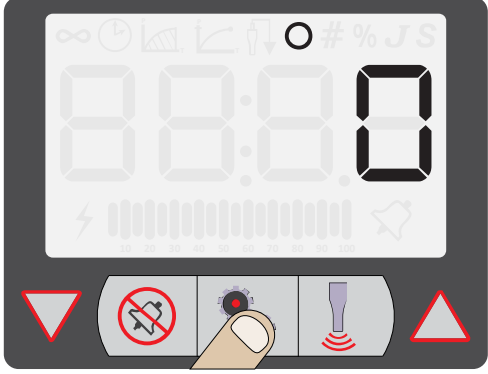
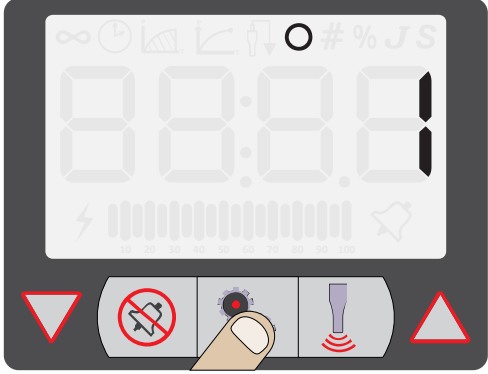

Step	Action	Reference
1	<p>Press the Configuration key until the number icon (#) appears on the LCD.</p> <p>The power supply will display register 101 at every power up.</p>	 <p>The image shows a digital LCD display with the number '101' in the center. Above the number is a '#' icon. The display is surrounded by various icons and symbols, including a power button, a fan, and a warning symbol. Below the display are four physical buttons: a left arrow, a 'no' symbol, a gear, and a right arrow.</p>
2	<p>Press and release the Up/Down arrow keys to select register 138. For a detailed description of available registers refer to Table 7.26 Power Supply Registers.</p>	 <p>The image shows a digital LCD display with the number '138' in the center. Above the number is a '#' icon. The display is surrounded by various icons and symbols, including a power button, a fan, and a warning symbol. Below the display are four physical buttons: a left arrow, a 'no' symbol, a gear, and a right arrow.</p>

Table 7.4 Time Mode Operational Sequence

Step	Action	Reference
3	Once you have reached register 138, press the Configuration key. The register value will be displayed; this is indicated by the circle icon.	
4	Use the Up/Down arrow keys to select value 1 (Time mode), then press the Configuration key to confirm the selection.	
5	Time mode icon and parameter value will be displayed. Use the Up/Down keys to enter the desired parameter value, then press the Configuration key to confirm the selected value.	

7.1.3 Energy Mode

You can use Energy Mode to select the amount of ultrasonic energy that is applied to your parts. Within Energy Mode, you can also select several other parameters, ranging from afterburst to limits and cutoffs. For more information on setting the optional parameters within Energy Mode, or any other welding mode, refer to the DCX A/F Series Web Page Instruction Manual.

Table 7.5 Energy Mode Parameters

Parameter	Default	Max. Value	Min. Value
Energy	500 Joules	9999 Joules	0.1 Joules

Table 7.6 Energy Mode Operational Sequence

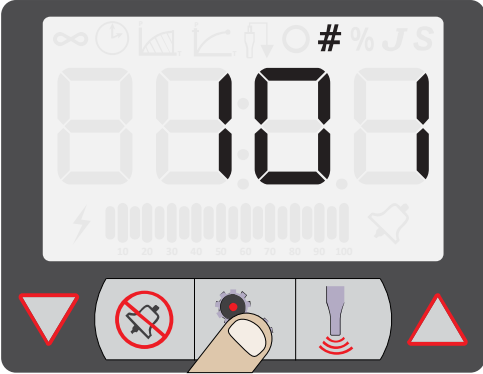

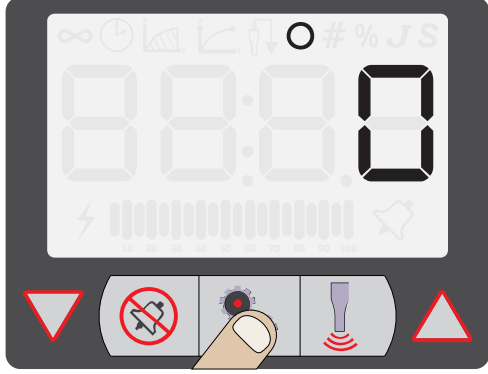
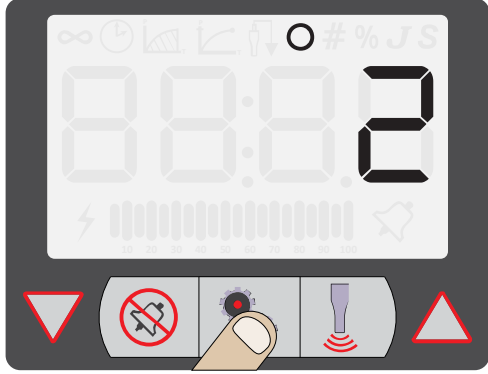

Step	Action	Reference
1	Press the Configuration key until the number icon (#) appears on the LCD. The power supply will display register 101 at every power up.	 <p>The image shows the LCD display with the number '101' in the center. Above the number is a '#' icon. The display also shows various icons at the top and bottom, including a power button, a left arrow, a right arrow, a percentage sign, and 'JS'. Below the display are several control buttons: a red triangle pointing down, a button with a crossed-out wrench and screwdriver, a button with a gear, a button with a lightbulb, and a red triangle pointing up. A hand is shown pressing the gear button.</p>
2	Press and release the Up/Down arrow keys to select register 138. For a detailed description of available registers refer to Table 7.26 Power Supply Registers .	 <p>The image shows the LCD display with the number '138' in the center. Above the number is a '#' icon. The display also shows various icons at the top and bottom, including a power button, a left arrow, a right arrow, a percentage sign, and 'JS'. Below the display are several control buttons: a red triangle pointing down, a button with a crossed-out wrench and screwdriver, a button with a gear, a button with a lightbulb, and a red triangle pointing up. A hand is shown pressing the right arrow button.</p>

Table 7.6 Energy Mode Operational Sequence

Step	Action	Reference
3	Once you have reached register 138, press the Configuration key. The register value will be displayed; this is indicated by the circle icon.	
4	Use the Up/Down arrow keys to select value 2 (Energy mode), then press the Configuration key to confirm the selection.	
5	Energy mode icon and parameter value will be displayed. Use the Up/Down keys to enter the desired parameter value, then press the Configuration key to confirm the selected value.	

7.1.4 Peak Power Mode

You can use Peak Power Mode to select the maximum percentage of the total available power that will be used to process your welds. When the power level you set is reached, ultrasonics will be terminated. From within Peak Power Mode, you can also select several other parameters, ranging from afterburst to limits and cutoffs. For more information on setting the optional parameters within Peak Power Mode, or any other welding mode, refer to the DCX A/F Series Web Page Instruction Manual.

Table 7.7 Peak Power Mode Parameters

Parameter	Default	Max. Value	Min. Value
Peak Power	1%	100%	1%

Table 7.8 Peak Power Mode Operational Sequence



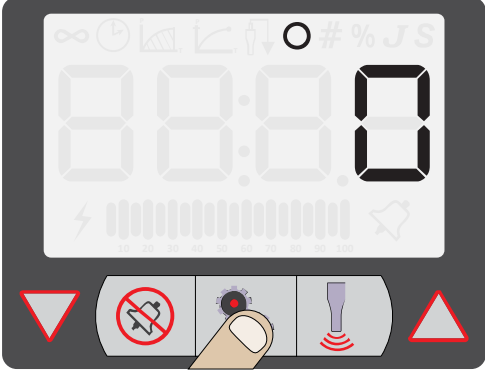

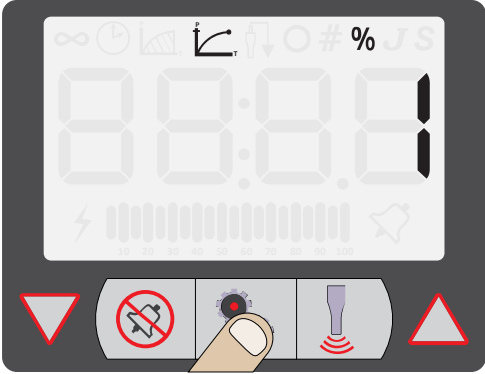
Step	Action	Reference
1	<p>Press the Configuration key until the number icon (#) appears on the LCD.</p> <p>The power supply will display register 101 at every power up.</p>	 <p>The image shows the LCD display with the number '101' in the center. Above the number is a '#' icon. The display also shows various icons at the top and bottom, including a power button, a fan, a left arrow, a right arrow, a percentage sign, and 'JS'. Below the display are several control buttons: a red triangle pointing down, a button with a crossed-out wrench and screwdriver, a button with a red dot, a button with a red dot and a red triangle, and a red triangle pointing up.</p>
2	<p>Press and release the Up/Down arrow keys to select register 138. For a detailed description of available registers refer to Table 7.26 Power Supply Registers.</p>	 <p>The image shows the LCD display with the number '138' in the center. Above the number is a '#' icon. The display also shows various icons at the top and bottom, including a power button, a fan, a left arrow, a right arrow, a percentage sign, and 'JS'. Below the display are several control buttons: a red triangle pointing down, a button with a crossed-out wrench and screwdriver, a button with a red dot, a button with a red dot and a red triangle, and a red triangle pointing up.</p>

Table 7.8 Peak Power Mode Operational Sequence

Step	Action	Reference
3	Once you have reached register 138, press the Configuration key. The register value will be displayed; this is indicated by the circle icon.	 <p>The screenshot shows a digital display with '00:00' and a circle icon. The bottom panel includes a 'No Flash' icon, a red dot icon, a 'Peak Power' icon, and two red triangles.</p>
4	Use the Up/Down arrow keys to select value 3 (Peak Power mode), then press the Configuration key to confirm the selection.	 <p>The screenshot shows a digital display with '00:03' and a circle icon. The bottom panel includes a 'No Flash' icon, a red dot icon, a 'Peak Power' icon, and two red triangles.</p>
5	Peak Power mode icon and parameter value will be displayed. Use the Up/Down keys to enter the desired parameter value, then press the Configuration key to confirm the selected value.	 <p>The screenshot shows a digital display with '00:00' and a Peak Power icon. The bottom panel includes a 'No Flash' icon, a red dot icon, a 'Peak Power' icon, and two red triangles.</p>

7.1.5 Ground Detect Mode

You can use Ground Detect Weld Mode to have ultrasonic energy turn off when the horn comes in contact with your electrically isolated fixture or anvil.

From within Ground Detect Mode, you can also select several other parameters, ranging from Hold Time (in seconds) to Suspect and Reject Limits. For more information on setting the optional parameters within Ground Detect Mode, or any other welding mode, refer to the DCX A/F Series Web Page Instruction Manual.

Table 7.9 Ground Detect Mode Parameters

Parameter	Default	Max. Value	Min. Value
Ground Detect	0.001 seconds	0.500 seconds	0.001 seconds

Table 7.10 Ground Detect Mode Operational Sequence

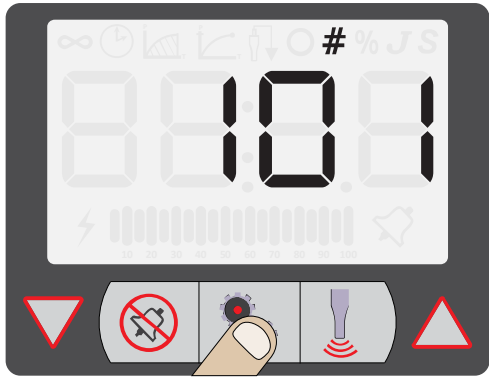

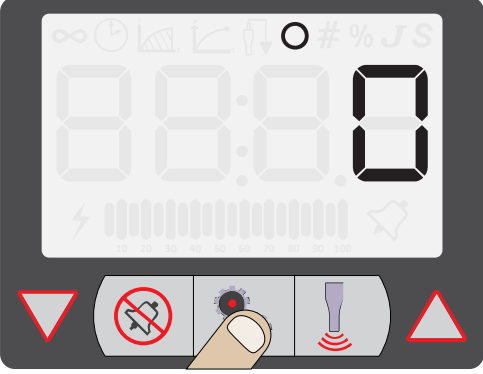
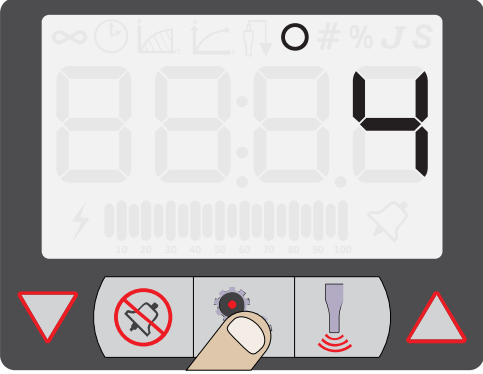
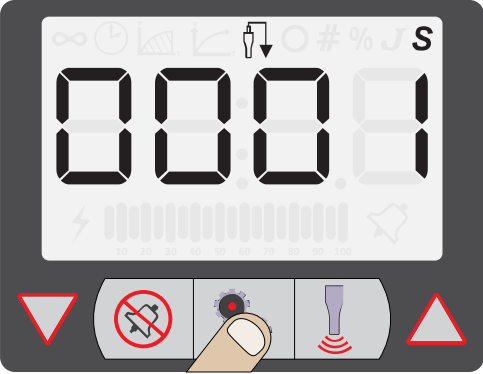

Step	Action	Reference
1	<p>Press the Configuration key until the number icon (#) appears on the LCD.</p> <p>The power supply will display register 101 at every power up.</p>	 <p>The image shows the LCD display with the number '101' in the center. Above the display, a '#' icon is visible. Below the display, there are several control buttons, including a red triangle, a crossed-out wrench and screwdriver, a red dot, a red exclamation mark, and another red triangle. A hand is shown pressing the red dot button.</p>
2	<p>Press and release the Up/Down arrow keys to select register 138. For a detailed description of available registers refer to Table 7.26 Power Supply Registers.</p>	 <p>The image shows the LCD display with the number '138' in the center. Above the display, a '#' icon is visible. Below the display, there are several control buttons, including a red triangle, a crossed-out wrench and screwdriver, a red dot, a red exclamation mark, and another red triangle. A hand is shown pressing the red triangle button.</p>

Table 7.10 Ground Detect Mode Operational Sequence

Step	Action	Reference
3	Once you have reached register 138, press the Configuration key. The register value will be displayed; this is indicated by the circle icon.	
4	Use the Up/Down arrow keys to select value 4 (Ground Detect mode), then press the Configuration key to confirm the selection.	
5	Ground Detect mode icon and parameter value will be displayed. Use the Up/Down keys to enter the desired parameter value, then press the Configuration key to confirm the selected value.	


7.2 Setting Limits


NOTICE	
	Register 114 (Limits) must be set to On before proceeding. See 7.5 Configuring the Power Supply Registers for more information.

7.2.1 Time Window Limit High

Table 7.11 Time Window Limit High Parameters

Parameter	Default	Max. Value	Min. Value
Time Window Limit High	30.00s	30.00s	0.010s

NOTICE	
	Minimum value should be higher than the window limit low value.

NOTICE	
	Set value to 0 to set the window limit high to off.


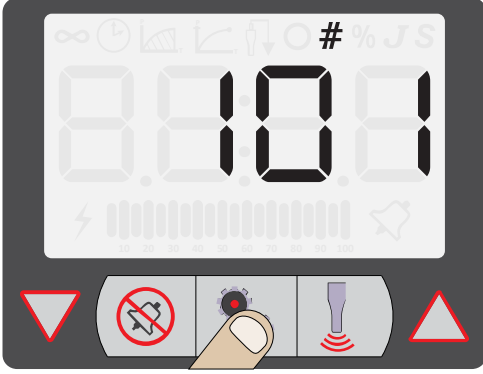


NOTICE	
	Time window limits must be set in multiples of 1.

Table 7.12 Time Window Limit High Operational Sequence

Step	Action	Reference
1	<p>Press the Configuration key until the number icon (#) appears on the LCD.</p> <p>The power supply will display register 101 at every power up.</p>	
2	<p>Press and release the Up/Down arrow keys to select register 158. For a detailed description of available registers refer to Table 7.26 Power Supply Registers.</p>	
3	<p>Once you have reached register 158, press the Configuration key. The register value will be displayed; this is indicated by the circle icon.</p> <p>Use the Up/Down arrow keys to select the desired time window limit high value, then press the Configuration key to confirm the selection.</p> <p>NOTICE Register 114 (Limits) must be set to On before proceeding. Otherwise, the value of the limits cannot be changed.</p>	

7.2.2 Time Window Limit Low

Table 7.13 Time Window Limit Low Parameters

Parameter	Default	Max. Value	Min. Value
Time Window Limit Low	0s	30.00s	0.010s

NOTICE



Maximum value should be lower than the window limit high value.

NOTICE






Set value to 0 to set the window limit high to off.

NOTICE



Time window limits must be set in multiples of 1.

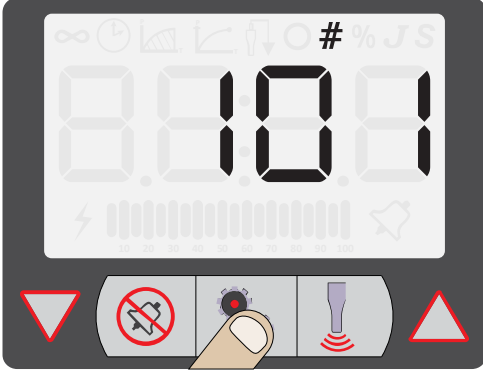Table 7.14 Time Window Limit Low Operational Sequence

Step	Action	Reference
1	<p>Press the Configuration key until the number icon (#) appears on the LCD.</p> <p>The power supply will display register 101 at every power up.</p>	
2	<p>Press and release the Up/Down arrow keys to select register 159. For a detailed description of available registers refer to Table 7.26 Power Supply Registers.</p>	
3	<p>Once you have reached register 159, press the Configuration key. The register value will be displayed; this is indicated by the circle icon.</p> <p>Use the Up/Down arrow keys to select the desired time window limit low value, then press the Configuration key to confirm the selection.</p> <p>NOTICE Register 114 (Limits) must be set to On before proceeding. Otherwise, the value of the limits cannot be changed.</p>	

7.2.3 Energy Window Limit High

Table 7.15 Energy Window Limit High Parameters

Parameter	Default	Max. Value	Min. Value
Energy Window Limit High	0J	9999J	0.1J

NOTICE



Minimum value should be higher than the window limit low value.

NOTICE






Set value to 0 to set the window limit high to off.

NOTICE



Energy window limits must be set in multiples of 1.

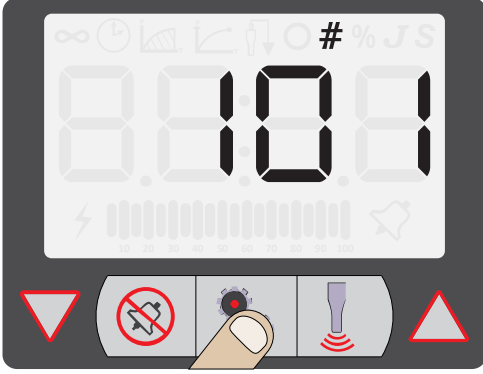Table 7.16 Energy Window Limit High Operational Sequence

Step	Action	Reference
1	<p>Press the Configuration key until the number icon (#) appears on the LCD.</p> <p>The power supply will display register 101 at every power up.</p>	
2	<p>Press and release the Up/Down arrow keys to select register 160. For a detailed description of available registers refer to Table 7.26 Power Supply Registers.</p>	
3	<p>Once you have reached register 160, press the Configuration key. The register value will be displayed; this is indicated by the circle icon.</p> <p>Use the Up/Down arrow keys to select the desired energy window limit high value, then press the Configuration key to confirm the selection.</p> <p>NOTICE Register 114 (Limits) must be set to On before proceeding. Otherwise, the value of the limits cannot be changed.</p>	

7.2.4 Energy Window Limit Low

Table 7.17 Energy Window Limit Low Parameters

Parameter	Default	Max. Value	Min. Value
Energy Window Limit Low	0J	9999J	0.1J

NOTICE



Maximum value should be lower than the window limit high value.

NOTICE






Set value to 0 to set the window limit high to off.

NOTICE



Energy window limits must be set in multiples of 1.

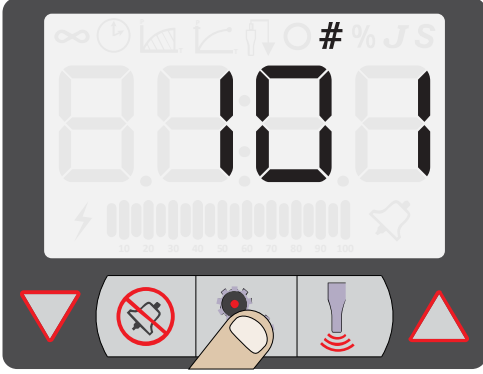
Table 7.18 Energy Window Limit Low Operational Sequence

Step	Action	Reference
1	<p>Press the Configuration key until the number icon (#) appears on the LCD.</p> <p>The power supply will display register 101 at every power up.</p>	
2	<p>Press and release the Up/Down arrow keys to select register 161. For a detailed description of available registers refer to Table 7.26 Power Supply Registers.</p>	
3	<p>Once you have reached register 161, press the Configuration key. The register value will be displayed; this is indicated by the circle icon.</p> <p>Use the Up/Down arrow keys to select the desired energy window limit low value, then press the Configuration key to confirm the selection.</p> <p>NOTICE Register 114 (Limits) must be set to On before proceeding. Otherwise, the value of the limits cannot be changed.</p>	

7.2.5 Setting Power Window Limits

If power window high or power window low limits are enabled, it will display a single slowly blinking segment for the high limit and a single slowly blinking segment for the low limit in the bar-graph. In case of a window limit alarm, the respective segment will blink faster.

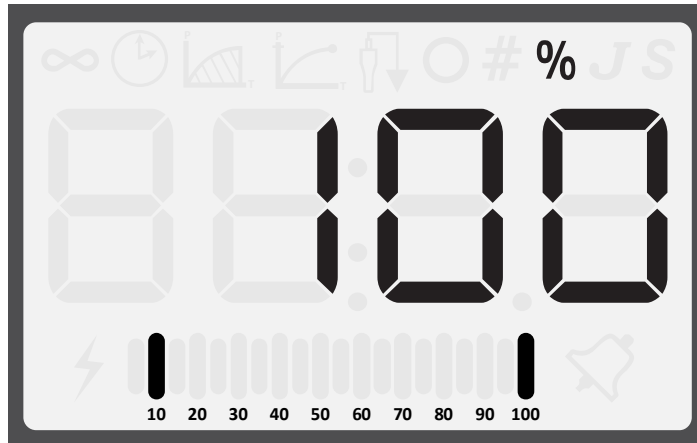
Figure 7.1 Power Window Limits




7.2.6 Power Window Limit High

Table 7.19 Power Window Limit High Parameters

Parameter	Default	Max. Value	Min. Value
Power Window Limit High	0%	100%	1%

NOTICE	
	Minimum value should be higher than the window limit low value.

NOTICE	
	Set value to 0 to set the window limit high to off.


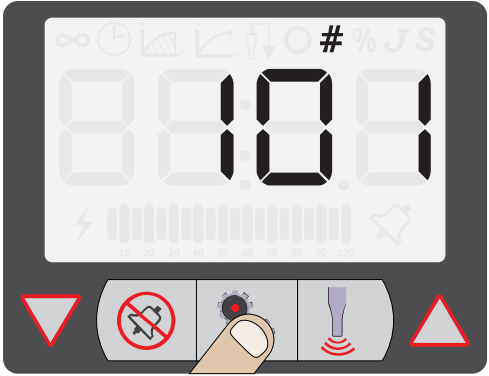


NOTICE	
	Power window limits must be set in multiples of 1.

Table 7.20 Power Window Limit High Operational Sequence


Step	Action	Reference
1	<p>Press the Configuration key until the number icon (#) appears on the LCD.</p> <p>The power supply will display register 101 at every power up.</p>	
2	<p>Press and release the Up/Down arrow keys to select register 162. For a detailed description of available registers refer to Table 7.26 Power Supply Registers.</p>	
3	<p>Once you have reached register 162, press the Configuration key. The register value will be displayed; this is indicated by the circle icon.</p> <p>Use the Up/Down arrow keys to select the desired power window limit high value, then press the Configuration key to confirm the selection.</p> <p>NOTICE Register 114 (Limits) must be set to On before proceeding. Otherwise, the value of the limits cannot be changed.</p>	

7.2.7 Power Window Limit Low


Table 7.21 Power Window Limit Low Parameters

Parameter	Default	Max. Value	Min. Value
Power Window Limit Low	0%	100%	1%

NOTICE	
--------	--

	Maximum value should be lower than the window limit high value.
---	---

NOTICE	
--------	--

	Set value to 0 to set the window limit high to off.
--	---

NOTICE	
--------	--


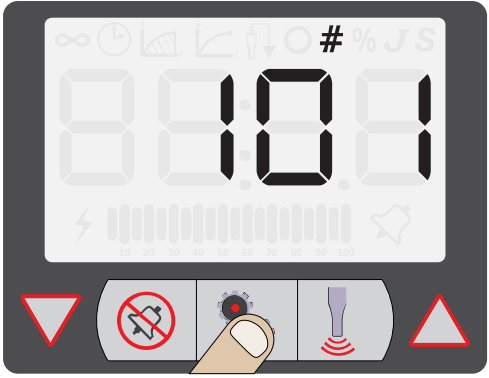


	Power window limits must be set in multiples of 1.
---	--

Table 7.22 Power Window Limit Low Operational Sequence

Step	Action	Reference
1	<p>Press the Configuration key until the number icon (#) appears on the LCD.</p> <p>The power supply will display register 101 at every power up.</p>	
2	<p>Press and release the Up/Down arrow keys to select register 163. For a detailed description of available registers refer to Table 7.26 Power Supply Registers.</p>	
3	<p>Once you have reached register 163, press the Configuration key. The register value will be displayed; this is indicated by the circle icon.</p> <p>Use the Up/Down arrow keys to select the desired power window limit low value, then press the Configuration key to confirm the selection.</p> <p>NOTICE Register 114 (Limits) must be set to On before proceeding. Otherwise, the value of the limits cannot be changed.</p>	

7.2.8 Using the Web Page Interface

Window limits can be set to a user specified value using the web page interface. For more information, refer to the DCX A/F Rack Mount Series Web Page Interface Instruction Manual.

7.3 Setting the Amplitude

7.3.1 Using the Front Panel Controls

At power up the DCX A Rack Mount Power Supply will display the last amplitude setting on the LCD. It can also be set to show weld mode.

Figure 7.2 LCD at Power Up

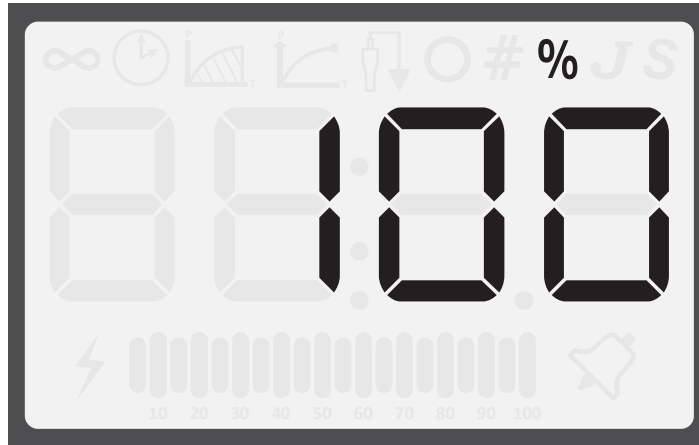



Table 7.23 Setting the Amplitude Using the Front Panel Controls

Step	Action	Reference
1	Press the Configuration key until the percentage icon (%) and no mode icons are displaying on the LCD.	
2	<p>Press and release the Up or Down arrow keys to select the desired amplitude at 1 % increments.</p> <p>Press and hold down the Up or Down arrow keys and the Amplitude will auto increment at 1 % increments every quarter of a second.</p> <p>After holding down an arrow key for four straight seconds, the amplitude will auto increment at 5 % increments every quarter of a second.</p>	

7.3.2 Using External Amplitude Control

When External Amplitude Control is enabled, the front panel amplitude control is disabled and the LCD displays four dashes (see [Figure 7.3 LCD when in External Amplitude Control Mode](#) below).

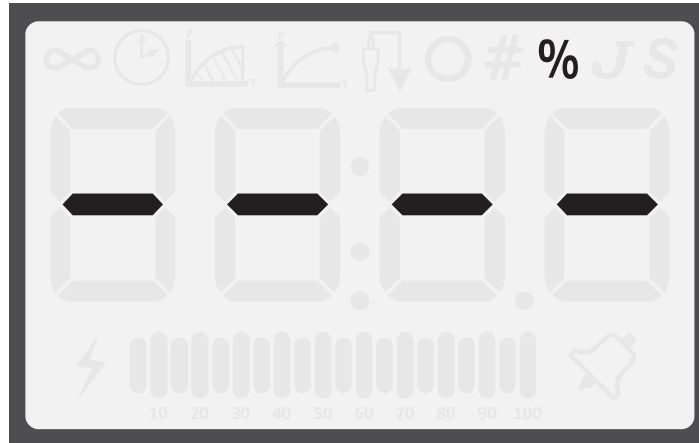Figure 7.3 LCD when in External Amplitude Control Mode



The ultrasonic amplitude can be controlled using one of the two analog input pins on the user I/O connector (pins 17 and 18).

7.3.3 Using the Web Page Interface

The ultrasonic amplitude can be set to a user specified value using the web page interface. For more information, refer to the DCX A/F Series Web Page Instruction Manual.

7.4 Resetting the Power Supply Alarms

You need to reset the weld system when you get an overload. When there is an overload, the alarm icon appears on the front panel LCD and the General Alarm output on the user I/O connector becomes active. The procedure for resetting the power supply depends on the power supply alarm settings. Refer to [Table 7.24 Resetting the DCX A Rack Mount Power Supply](#) for reset procedures.

Table 7.24 Resetting the DCX A Rack Mount Power Supply

Alarm Setting	Reset Procedure
Reset Required	Press the front panel Reset key. You can also send an External Reset signal.
No Reset Required	Remove and re-apply the start signal.

For more information on interfacing the DCX A Rack Mount Power Supply using the user I/O connections refer to [5.4.1 User I/O Connections](#) in [Chapter 5: Installation and Setup](#).

7.5 Configuring the Power Supply Registers

At power up the DCX A Rack Mount Power Supply will display the last amplitude setting, this is indicated by the percentage icon (%) on the LCD. Refer to [Figure 7.2 LCD at Power Up](#).

Table 7.25 Steps to Configure the Power Supply Registers






Step	Action	Reference
1	<p>Press the Configuration key until the number icon (#) appears on the LCD.</p> <p>The power supply will display register 101 at every power up.</p>	
2	<p>Press and release the Up or Down arrow keys to select the desired register. For a detailed description of available registers refer to Table 7.26 Power Supply Registers.</p>	
3	<p>Once you have reached the desired register, press the Configuration key. The register value will be displayed, this is indicated by the circle icon.</p>	

Table 7.25 Steps to Configure the Power Supply Registers

Step	Action	Reference
4	<p>Press and release the Up or Down arrow keys to enter the desired value at 1 increments.</p> <p>Press and hold down the Up and Down arrow keys and the value will auto increment at 1 increments every quarter of a second.</p> <p>After holding down an arrow key for four straight seconds, the value will auto increment at 5 increments every quarter of a second.</p> <p>Or press the Reset key to enter the default value. For detailed default values of available registers refer to Table 7.26 Power Supply Registers.</p>	 <p>The image shows a digital display with the number 150. The display has various icons at the top and bottom, including a power button, a reset button, and a warning icon. A hand is shown pressing the reset button.</p>
5	<p>Press the Configuration key to save the value. The current amplitude setting will be displayed only for continuous mode. For all the other modes, it will display the primary parameter of that mode.</p>	 <p>The image shows a digital display with the number 100. The display has various icons at the top and bottom, including a power button, a reset button, and a warning icon. A hand is shown pressing the configuration key.</p>

7.5.1 Power Supply Registers

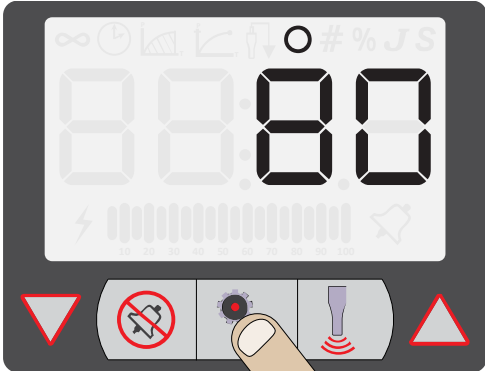Table 7.26 Power Supply Registers

Register	Description	Default Value	Max. Value	Min. Value
101	Software version	N/A	N/A	N/A
102	Bar graph identification after weld complete 0: Power 1: Frequency	0	1	0
104	External amplitude control - user analog input or fieldbus 0: Off 1: On	0	1	0
105	Start ramp time (ms)	80	1000	10
106	Store frequency at end of weld 0: Off 1: On	1	1	0
107	Power up seek/scan 0: Off 1: Seek, 2: Scan	1	2	0
108	Seek ramp time (ms)	80	1000	10
109	Timed seek (every 60 seconds) 0: Off 1: On	0	1	0
110	Seek time (ms)	500	1000	10
111	External Frequency Offset 0: Off 1: On	0	1	0
112	Frequency Offset Value	0		
113	Cutoffs 0: Off 1: On	0	1	0
114	Limits 0: Off 1: On	0	1	0

Table 7.26 Power Supply Registers

Register	Description	Default Value	Max. Value	Min. Value
115	Restore Defaults 0: Off 1: Just weld preset 2: System defaults	0	2	0
116	IP Address - 1	192	255	0
117	IP Address - 2	168	255	0
118	IP Address - 3	10	255	0
119	IP Address - 4	100	255	0
120	Gateway for IP Address - 1	192	255	0
121	Gateway for IP Address - 2	168	255	0
122	Gateway for IP Address - 3	10	255	0
123	Gateway for IP Address - 4	1	255	0
124	Subnet Mask for IP Address - 1	255	255	0
125	Subnet Mask for IP Address - 2	255	255	0
126	Subnet Mask for IP Address - 3	255	255	0
127	Subnet Mask for IP Address - 4	0	255	0
128	DHCP Settings 0: Server 1: Client 2: Static 3: Restore Registers 116-128 to default	2	3	0
134	Backlight Timeout (s) 0: Always on	600	9999	0
135	Auto scroll step size	5	50	1
136	Power on display 0: Weld Mode 1: Amplitude	1	1	0
138	Weld Mode 0: Continuous 1: Time 2: Energy 3: Peak Power 4: Ground Detect	0	4	0
139	MAC Address 1	N/A	FFFF	0

Table 7.26 Power Supply Registers

Register	Description	Default Value	Max. Value	Min. Value
140	MAC Address 2	N/A	FFFF	0
141	MAC Address 3	N/A	FFFF	0
158	-Time Limit 0: Select to disable limit 0.010-30.00s: Set -Time Limit	0	30.00s	0.010s
159	+Time Limit 0: Select to disable limit 0.010-30.00s: Set +Time Limit	0	30.00s	0.010s
160	-Energy Limit 0: Select to disable limit 0.1-9999J: Set -Energy Limit	0	9999J	0.1J
161	+Energy Limit 0: Select to disable limit 0.1-9999J: Set +Energy Limit	0	9999J	0.1J
162	-Power Limit 0: Select to disable limit 1-100%: Set -Power Limit	0	100%	1%
163	+Power Limit 0: Select to disable limit 1-100%: Set +Power Limit	0	100%	1%

7.6 Save/Recall Presets

If you wish to save your current weld cycle settings for later use, you can save it into a preset location. 32 preset locations are available. Preset settings are saved until they are over-written, and are maintained in memory even if the system is turned off or unplugged.

7.6.1 Save Preset

Table 7.27 Save Preset





Step	Action	Reference
1	Set the desired weld mode and parameters. See 7.1 Setting Primary Parameters for more information.	
2	Press the Configuration key until the preset location screen (Pr:XX) appears on the LCD.	
3	<p>Press the Up or Down arrow keys to select the desired preset location to use.</p> <p>Once you have reached the desired preset location, press the Configuration key to select it.</p> <p>You will be returned to the main screen.</p>	

Table 7.27 Save Preset

Step	Action	Reference
4	<p>While on the main screen, press and hold the Reset key. While holding down the Reset key, press the Configuration to save your current control mode and parameters into the selected preset location (Pr:XX).</p> <p>The LCD will blink twice to confirm that the preset was saved correctly.</p>	 <p>The image shows the LCD screen with the number '100' displayed. A hand is shown pressing the Configuration key (a gear icon) on the bottom control panel. The screen also shows various icons at the top and bottom, including a battery level indicator.</p>

7.6.2 Recall Preset

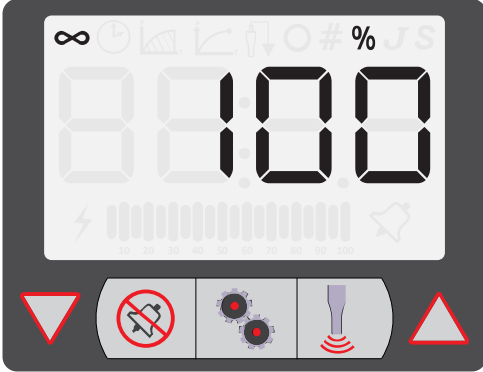Table 7.28 Recall Preset

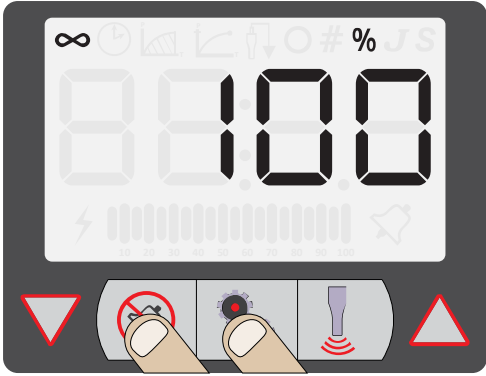


Step	Action	Reference
1	<p>Press the Configuration key until the preset location screen (Pr:XX) appears on the LCD.</p>	 <p>The image shows the LCD screen with 'Pr:00' displayed. A hand is shown pressing the Configuration key (a gear icon) on the bottom control panel. The screen also shows various icons at the top and bottom.</p>
2	<p>Press the Up or Down arrow keys to select the desired preset location to recall.</p> <p>Once you have reached the desired preset location, press and hold the Reset key. While holding down the Reset key, press the Configuration for 3 seconds to recall the selected preset location (Pr:XX).</p> <p>The LCD will blink twice to confirm that the preset was recalled correctly.</p>	 <p>The image shows the LCD screen with 'Pr:05' displayed. A hand is shown pressing the Configuration key (a gear icon) on the bottom control panel. The screen also shows various icons at the top and bottom.</p>

Table 7.28 Recall Preset

Step	Action	Reference
3	You will be returned to the main screen with the recalled preset location settings.	 <p>The screenshot shows a handheld device screen with a digital display showing '100'. Above the display are several icons including an infinity symbol, a power button, a fan, a left arrow, a right arrow, a down arrow, a hash symbol, and a percent sign. Below the display is a battery level indicator. At the bottom of the screen are four main control buttons: a red downward-pointing triangle, a button with a crossed-out mouse cursor, a button with two red dots, and a button with a red exclamation mark. There are also red upward-pointing triangles on the far left and right edges of the bottom bar.</p>

7.7 LCD Bar-Graph

While ultrasonic power is active the LCD will always display the power value on the 20-segment LCD bar-graph as a percentage of the maximum output power.

At the end of a weld or test cycle, the bar-graph is factory set to represent the cycle's peak power as a percentage of the maximum output power.



The power supply can also be configured to show a single bar on the LCD bar-graph to represent the stack operating frequency stored at the end of each weld or test cycle. This option can be used to troubleshoot operating frequency changes as a result of heating effects, coupling, tooling wear, etc.

For information on how to set the power supply registers see [7.5 Configuring the Power Supply Registers](#).

7.7.1 Power Bar-Graph Interpretation

The lightning bolt left of the bar-graph indicates ultrasonic power is running. Each of the segments represent 5 % increments of the maximum output power. The segments will only appear if the output power has exceeded the value represented. For example if the power is 4 % only the lightning bolt will be on. When it reaches 5 % the first bar-graph segment will appear.

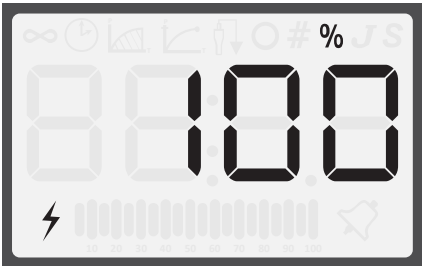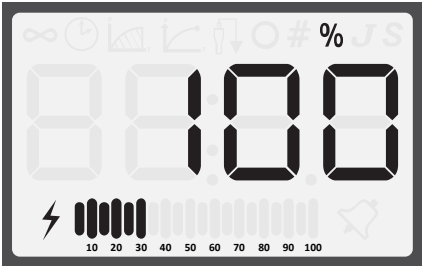Table 7.29 Power Bar-Graph Interpretation Examples

Description	Reference
<p>In this example only the lightning bolt appears left of the bar-graph. This means power is between 0% and 5%. If the power supply is 800 W the actual output power is between 0 W and 40 W.</p>	 <p>The LCD display shows a digital readout of '100' with a '%' symbol to its right. To the left of the display is a lightning bolt icon. Below the display is a 20-segment bar graph where only the first segment (representing 0-5%) is illuminated.</p>
<p>In this example the first six segments appear on the bar-graph. This means power is between 30% and 35%. If the power supply is 800 W, the actual output power is between 240 W and 280 W.</p>	 <p>The LCD display shows a digital readout of '100' with a '%' symbol to its right. To the left of the display is a lightning bolt icon. Below the display is a 20-segment bar graph where the first six segments (representing 0-30%) are illuminated. The bar graph has numerical labels 10, 20, 30, 40, 50, 60, 70, 80, 90, 100 below it.</p>

7.7.2 Frequency Bar-Graph Interpretation

The actual frequency depends on the power supply's operating frequency. Use [Table 7.30](#) to [Table 7.32](#) below to interpret frequency bar-graph readings.


NOTICE	
	<p>If there is a test overload or an external memory reset signal is received, then the 50% segment will be displayed and blinking.</p>

Table 7.30 Frequency Bar-Graph Interpretation - 20 kHz (50 Hz Segment)

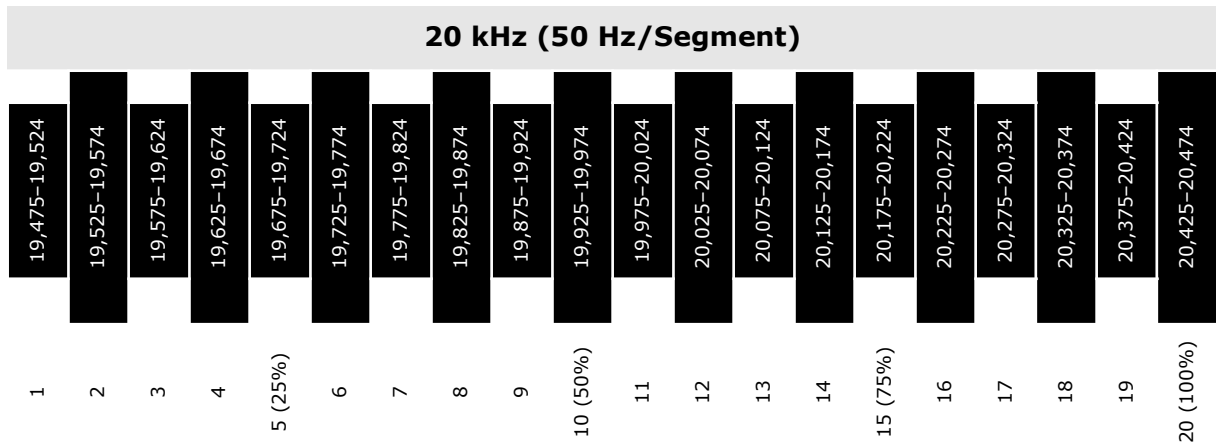


Table 7.31 Frequency Bar-Graph Interpretation - 30 kHz (76 Hz Segment)

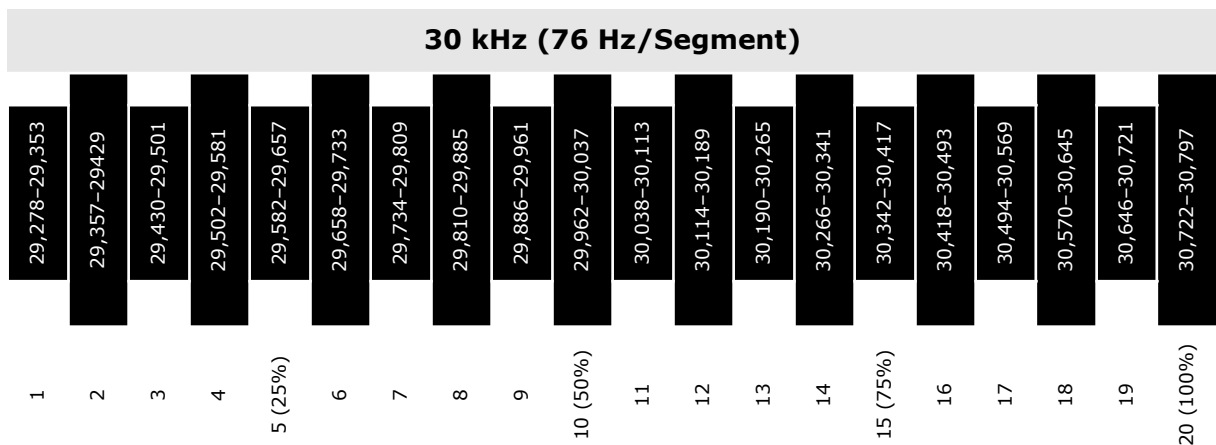


Table 7.32 Frequency Bar-Graph Interpretation - 40 kHz (100 Hz/Segment)

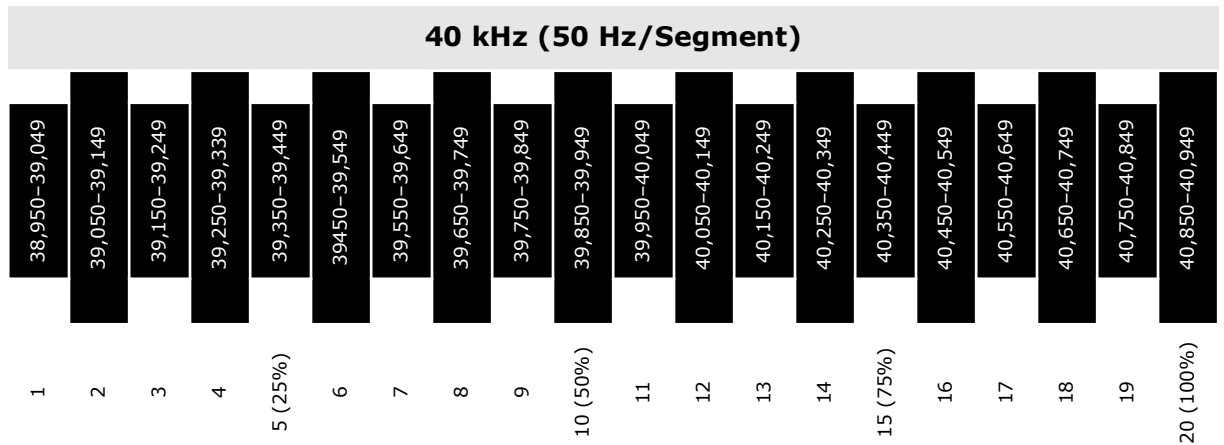




Table 7.33 Frequency Bar-Graph Interpretation Examples

Description	Reference
<p>In this example the bar is located in the 11th segment. If the power supply is a 20 kHz unit, the stack is running in the frequency range of 19,975 Hz to 20,024 Hz.</p>	
<p>In this example the bar is located in the 7th segment. If the power supply is a 20 kHz unit, the stack is running in the frequency range of 19,775 Hz to 19,824 Hz.</p>	

7.8 Ultrasonics Test Procedure

The Ultrasonics Test function measures ultrasonic power dissipated by the ultrasonic stack with no load. The ultrasonics test procedure involves an automatic matching of the frequency of the power supply to the frequency of the converter-booster-horn stack.

WARNING	High Voltage Hazard
	<p>Ensure that no one is in contact with the horn when testing the power supply.</p> <p>Do not cycle the welding system if either the RF cable or converter is disconnected.</p>

WARNING	High Voltage Hazard
	<p>Ensure the power supply is properly connected, as indicated in 5.3 Installation Steps.</p>

7.8.1 Using the Front Panel Controls


NOTICE	
	<p>To use the front panel controls, the DCX A Rack Mount Power Supply unit must be in manual mode.</p>

Table 7.34 Power Supply Ultrasonic Test Procedure (Front Panel)

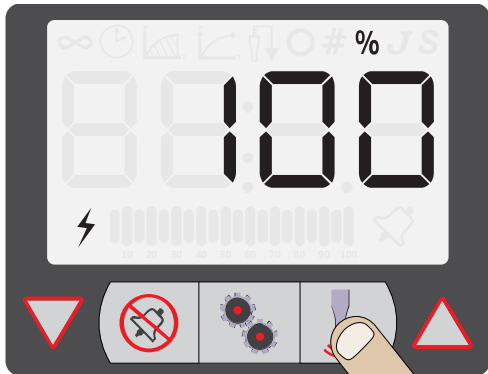

Step	Action	Reference
1	<p>Press the test key for 1-2 seconds, then release. The Sonics Active indicator appears while the test key is pressed. If the power supply alarm indicator does not appear, the test procedure is finished.</p>	

Table 7.34 Power Supply Ultrasonic Test Procedure (Front Panel)

Step	Action	Reference
2	<p>If the alarm indicator appears, press the alarm reset key and repeat step 2 one time only. If the alarm persists, refer to 8.4 Troubleshooting.</p> <p>See Appendix A: Alarms for additional information.</p>	

7.9 Using the I/O Connections

Table 7.35 Power Supply Ultrasonic Test Procedure (User I/O)



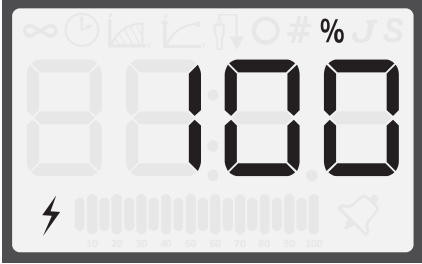
Step	Action	Reference
1	Wire the necessary I/O signals as shown on Figure 7.4 Test Connections , or using a similar setup.	Refer to Figure 7.4 Test Connections below.
2	Send an External Test signal for 1-2 seconds. The Sonics Active output will become active and the Sonics Active indicator appears while the External Start Signal is present. If the General Alarm output/ alarm indicator does not become active, the test procedure is finished. NOTICE Power supply must be in manual mode.	
3	If the General Alarm output/alarm indicator becomes active, send an External Reset signal and repeat step 2 one time only. If the alarm persists, refer to 8.4 Troubleshooting .	





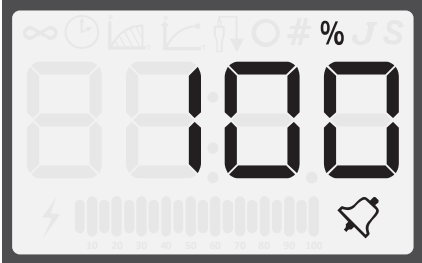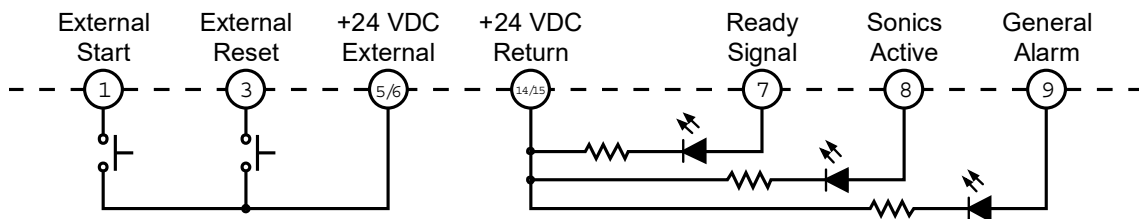
Figure 7.4 Test Connections





Chapter 8: Maintenance


8.1	General Maintenance Considerations	134
8.2	DCX A Rack Mount Power Supply Preventive Maintenance	136
8.3	Recommended Spare Stock.	142
8.4	Troubleshooting	148
8.5	Cold Start Procedure.	152

8.1 General Maintenance Considerations

WARNING	High Voltage Hazard
	<p>Power supplies produce high voltage. To avoid the possibility of an electrical shock, you should always power down your system prior to repairing any portion of it.</p>
CAUTION	General Warning
	<p>When performing maintenance on the welder, make sure that no other automated systems are active.</p>
NOTICE	
	<p>There are no customer replaceable components inside the power supply. Have all servicing done by a qualified Branson technician.</p>
NOTICE	
	<p>When returning printed circuit boards, make sure to enclose them in an anti-static package.</p>
NOTICE	
	<p>Connectors may not be keyed and wires may not be color-coded. Therefore, when disconnecting cables and wires, label them so you can reconnect them properly.</p>

NOTICE	
	<p>To prevent circuit damage from electrostatic discharge, always service the power supply on a static-dissipative surface, while wearing a properly grounded wrist strap.</p>


NOTICE	
	<p>When the battery is worn out, dispose it under the ordinance of each local government.</p>

CAUTION Corrosive Material Hazard	
	<p>First aid measures (in case of electrolyte leakage from the battery):</p> <p>Eye Contact: Flush the eyes with plenty of clean water for at least 15 minutes immediately, without rubbing. Get immediate medical treatment.</p> <p>If appropriate procedures are not taken, this may cause eye injury.</p> <p>Skin Contact: Wash the affected area under tepid running water using a mild soap. If appropriate procedures are not taken, this may cause sores on the skin. Get medical attention if irritation develops or persists.</p> <p>Inhalation: Remove to fresh air immediately. Get medical treatment immediately.</p>

8.2 DCX A Rack Mount Power Supply Preventive Maintenance

The following preventive measures help assure long term operation of your Branson DCX A Rack Mount Power Supply equipment.

8.2.1 Periodically Clean the Equipment

NOTICE	
	Use only anti-static vacuum cleaners to prevent damage from electrostatic discharge to your power supply.

Air is continuously drawn into the power supply. Periodically disconnect the unit from power, remove the cover and vacuum out any accumulated dust and debris. Remove material adhering to:


- Power supply heat sink cooling fins
- Transformers
- Circuit boards
- Cooling intake vents
- Exhaust ports

External covers may be cleaned with a damp sponge or cloth using a solution of mild soap and water. Do not allow cleaning solution to enter the unit.

To prevent rust in areas of high humidity, exposed steel surfaces, may require a very light film of rust preventing oil, such as WD-40®*.

* WD-40 is a registered trademark of WD-40 Manufacturing Company.

8.2.2 Recondition the Stack (Converter, Booster, and Horn)

NOTICE	
	Never clean the converter-booster-horn stack mating surfaces by using a buffing wheel or by filing.

Welding system components work most efficiently when the converter-booster-horn stack mating surfaces are flat, in solid contact, and free from fretting corrosion. Poor contact between mating surfaces wastes power output, makes tuning difficult, increases noise and heat, and may cause damage to the converter.

For standard 20 kHz and 30 kHz products, a Branson Mylar polyester film washer should be installed between the horn and booster, and horn and converter. Replace the washer if torn or perforated. Stacks using Mylar plastic film washers should be inspected every three months.

Stacks used with silicone grease, as with certain 20 kHz, 30 kHz and all 40 kHz products, should be periodically reconditioned to eliminate fretting corrosion. A stack using silicone grease should be inspected every two weeks for corrosion. When experience is gained for specific stacks, the inspection interval can be adjusted to a longer or shorter period as required.

Stack Reconditioning Procedure

To recondition stack mating surfaces, take the following steps:

Table 8.1 Stack Reconditioning Procedure

Step	Action
1	Disassemble the converter-booster-horn stack and wipe the mating surfaces with a clean cloth or paper towel.
2	Examine all mating surfaces. If any mating surface shows corrosion or a hard, dark deposit, recondition it.
3	If necessary, remove the threaded stud from the part.
4	Tape a clean sheet of #400 (or finer) grit emery cloth to a clean, smooth, flat surface (such as a sheet of plate glass), as in Figure 8.1 Reconditioning Stack Mating Surfaces .
5	Place the interface surface on the emery cloth. Grasp the part at the lower end, with your thumb over the spanner-wrench hole, and lap the part in a straight line across the emery cloth. Do not apply downward pressure — the weight of the part alone provides sufficient pressure.
6	Lap the part, two or three times, in the same direction against the emery cloth. (See Figure 8.1 Reconditioning Stack Mating Surfaces .)
7	Rotate the part 120 degrees, placing your thumb over the spanner-wrench hole, and repeat the lapping procedure in step 6.
8	Rotate the part another 120 degrees to the next spanner-wrench hole, and repeat the lapping procedure in step 6.
9	Re-examine the mating surface. If necessary, repeat steps 2-5 until you remove most of the contaminant. Remember, this should not require more than two to three complete rotations for an aluminum horn or booster; a titanium component may require more rotations.
10	<p>Before re-inserting a threaded stud in an aluminum booster or horn: Using a file card or wire brush, clean any aluminum bits from the knurled end of the stud.</p> <p>Using a clean cloth or towel, clean the threaded hole.</p> <p>Examine the knurled end of the stud. If worn, replace the stud. Also, examine the stud and threaded hole for stripped threads.</p> <p>NOTICE Threaded studs cannot be reused in titanium horns or boosters. Replace all studs in these components.</p>
11	Assemble and install the stack.

Figure 8.1 Reconditioning Stack Mating Surfaces

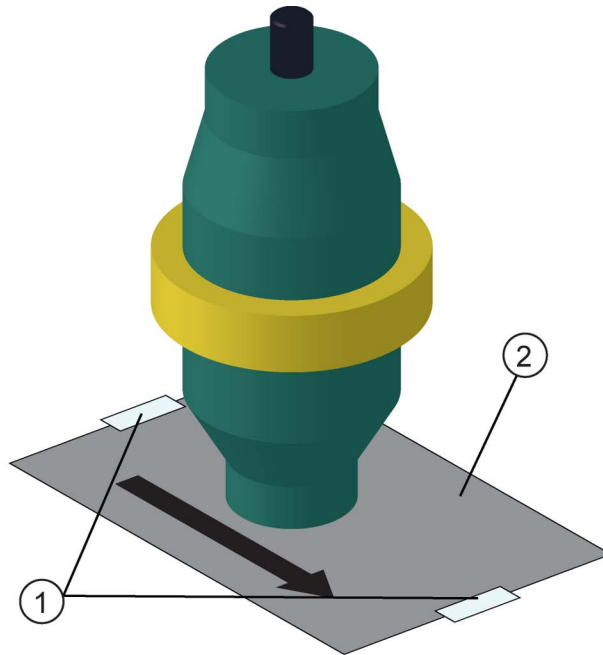


Table 8.2 Reconditioning Stack Mating Surfaces

Item	Description
1	Tape
2	#400 Emery Cloth

8.2.3 Stack Torque Values

Table 8.3 Stack Torque Values

Frequency	Torque
20 kHz	220 in·lb (25 N·m)
30 kHz	185 in·lb (21 N·m)
40 kHz	95 in·lb (11 N·m)

For a 20 kHz System

Table 8.4 Stack Reassembly for a 20 kHz System

Step	Action
1	Clean the mating surfaces of the converter, booster, and horn. Remove any foreign material from the threaded holes.
2	Install the threaded stud into the top of the booster. Torque to 450 in·lb (50.84 N·m). If the stud is dry, apply 1 or 2 drops of a light lubricating oil before installing.
3	Install the threaded stud into the top of the horn. Torque to 450 in·lb (50.84 N·m). If the stud is dry, apply 1 or 2 drops of a light lubricating oil before installing.
4	Install a single Mylar plastic film washer (matching the size of the washer to the stud) to each interface.
5	Assemble the converter to the booster and the booster to the horn.
6	Torque to 220 in·lb (24.85 N·m) at each interface.

For a 30 kHz System

Table 8.5 Stack Reassembly for a 30 kHz System

Step	Action
1	Clean the mating surfaces of the converter, booster, and horn. Remove any foreign material from the threaded holes.
2	Install the threaded stud into the top of the booster. Torque to 290 in·lb (32.76 N·m). If the stud is dry, apply 1 or 2 drops of a light lubricating oil before installing.
3	Install the threaded stud into the top of the horn. Torque to 290 in·lb (32.76 N·m). If the stud is dry, apply 1 or 2 drops of a light lubricating oil before installing.
4	Install a single Mylar plastic film washer (matching the size of the washer to the stud) to each interface.
5	Assemble the converter to the booster and the booster to the horn.
6	Torque to 185 in·lb (21 N·m) at each interface.

For a 40 kHz System

Table 8.6 Stack Reassembly for a 40 kHz System

Step	Action
1	Clean the mating surfaces of the converter, booster, and horn. Remove any foreign material from the threaded holes.
2	Apply a drop of Loctite®* 290 threadlocker (or equivalent) to the studs for the booster and horn.
3	Install the threaded stud into the top of the booster. Torque to 70 in·lb (7.91 N·m). Remove excess Loctite 290 threadlocker from the booster face and let cure for 30 minutes.
4	Install the threaded stud into the top of the horn. Torque to 70 in·lb (7.91 N·m). Remove excess Loctite 290 threadlocker from the horn face and let cure for 30 minutes.
5	Coat each interface surface with a thin film of silicon grease - but do not apply silicon grease to a threaded stud or tip.
6	Torque to 95 in·lb (10.73 N·m) at each interface.

* Loctite is a registered trademark of Henkel Corporation, U.S.A.

8.2.4 Stud Torque Values

Table 8.7 Stud Torque Values

Used on	Stud Size	Torque	EDP #
20 kHz	1/2 in x 20 x 1-1/4 in	450 in·lb, 50.84 N·m	100-098-370
	1/2 in x 20 x 1-1/2 in		100-098-123
30 kHz	3/8 in x 24 x 1 in	290 in·lb, 32.76 N·m	100-298-170R
40 kHz*	M8 x 1.25	70 in·lb, 7.91 N·m	100-098-790

* Add a drop of Loctite 290 threadlocker to the stud. Torque and let cure for 30 minutes before using.

8.3 Recommended Spare Stock

This section provides lists of replacement parts, system cables, and suggested spares.

8.3.1 System Cables

You can order the following cables:

Table 8.8 DCX A Rack Mount Power Supply System Cables

P/N	Description
100-240-383	Cable, RF 8 ft (2.5 m)
100-240-384	Cable, RF 15 ft (4.5 m)
100-240-385	Cable, RF 25 ft (7.5 m)
100-240-387	Cable, RF right angle 8 ft (2.5 m)
100-240-388	Cable, RF right angle 15 ft (4.5 m)
100-240-389	Cable, RF right angle 25 ft (7.5 m)
100-240-392	Cable, User I/O 25 ft (7.5 m)
100-240-393	Cable, User I/O 50 ft (15 m)
200-240-396	Cable Ethernet Cat 5e 7 ft (2.1 m)

8.3.2 Suggested Spares

Table 8.9 Suggested Spares

Description	EDP#	1-4 Units	6-12 Units	14+ Units
Converter	Refer to Table 8.10 Converters Compatible with the DCX A Rack Mount Power Supply	0	1	2
Booster	Refer to Table 8.11 DCX A Rack Mount Power Supply Compatible Boosters	0	1	2
Horn	As Ordered	1	1	2
Studs	Refer to Table 8.12 Other Items used with the DCX A Rack Mount Power Supply	4	6	8
Mylar Plastic Film Washer Kit	Refer to Table 8.12 Other Items used with the DCX A Rack Mount Power Supply	1	1	1

8.3.3 Converters Compatible with the DCX A Rack Mount Power Supply

Table 8.10 Converters Compatible with the DCX A Rack Mount Power Supply

Where used	Model	Connector	Part Number
20 kHz / 1250 W 20 kHz / 2500 W 20 kHz / 4000 W	CR-20S	SHV connector	125-135-115R
	CR-20C	SHV connector with 3 ft (0.9 m) cable	159-135-210R
	CH-20S (932 AH SPL)	SHV connector	159-135-075R
	CH-20C	SHV connector with 3 ft (0.9 m) cable	159-135-211R
	CS-20S	SHV connector	159-135-138R
	CS-20C	SHV connector with 3 ft (0.9 m) cable	159-135-209R
30 kHz / 1500 W	CR-30S	SHV connectors	101-135-081R
	CR-30C	SHV connector with 3 ft (0.9 m) cable	159-135-213R
	CH-30S	SHV connector	101-135-071R
	CH-30C	SHV connector with 3 ft (0.9 m) cable	159-135-214R
	CS-30S	SHV connector	159-135-110R
	CS-30C	SHV connector with 3 ft (0.9 m) cable	159-135-212R
40 kHz / 800 W	4TP	SHV connector (platen mount)	101-135-068R
	CR-40S (4TH)	SHV connector	101-135-067R
	CR-40C	SHV connector with 3 ft (0.9 m) cable	159-135-215R

8.3.4 DCX A Rack Mount Power Supply Compatible Boosters

Table 8.11 DCX A Rack Mount Power Supply Compatible Boosters

Type of Booster	Description	Part Number
Solid Mount (1/2-20 horn stud) 20 kHz	Titanium, 1:0.6 (Purple)	101-149-095
	Titanium, 1:1 (Green)	101-149-096
	Titanium, 1:1.5 (Gold)	101-149-097
	Titanium, 1:2 (Silver)	101-149-098
	Titanium, 1:2.5 (Black)	101-149-099
Solid Mount (M8 x 1.25 horn stud) 40 kHz	Titanium, 1:0.6 (Purple)	109-041-178
	Titanium, 1:1 (Green)	109-041-177
	Titanium, 1:1.5 (Gold)	109-041-176
	Titanium, 1:2 (Silver)	109-041-175
	Titanium, 1:2.5 (Black)	109-041-174
Standard Series (1/2-20 horn stud) 20 kHz	Aluminum, 1:0.6 (Purple)	101-149-055
	Aluminum, 1:1 (Green)	101-149-051
	Aluminum, 1:1.5 (Gold)	101-149-052
	Aluminum, 1:2 (Silver)	101-149-053
	Titanium, 1:0.6 (Purple)	101-149-060
	Titanium, 1:1 (Green)	101-149-056
	Titanium, 1:1.5 (Gold)	101-149-057
	Titanium, 1:2 (Silver)	101-149-058
Standard Series (3/8-24 horn stud) 30 kHz	Titanium, 1:2.5 (Black)	101-149-103
	Titanium, 1:2 (Silver)	101-149-104
	Titanium, 1:1.5 (Gold)	101-149-105
	Titanium, 1:1 (Green)	101-149-106

Table 8.11 DCX A Rack Mount Power Supply Compatible Boosters

Type of Booster	Description	Part Number
Standard Series (M8 x 1.25 horn stud) 40 kHz	Aluminum, 1:0.6 (Purple)	101-149-087
	Aluminum, 1:1 (Green)	101-149-079
	Aluminum, 1:1.5 (Gold)	101-149-080
	Aluminum, 1:2 (Silver)	101-149-081R
	Aluminum, 1:2.5 (Black)	101-149-082
	Titanium, 1:1 (Green)	101-149-085
	Titanium, 1:1.5 (Gold)	101-149-086
	Titanium, 1:2 (Silver)	101-149-083
	Titanium, 1:2.5 (Black)	101-149-084

8.3.5 Other Items used with the DCX A Rack Mount Power Supply

Table 8.12 Other Items used with the DCX A Rack Mount Power Supply


Product	Description	Part No.
Silicone grease	For use with 40 kHz systems	101-053-002
Mylar Plastic Film Washers (for 20 kHz systems)	Kit, 10 each (1/2 in. and 3/8 in.)	100-063-357
	Kit, 150 each (1/2 in.)	100-063-471
	Kit, 150 each (3/8 in.)	100-063-472
Mylar Plastic Film Washers (for 30 kHz systems)	Kit, 10 each (3/8 in.)	100-063-632
	Kit, 150 each (3/8 in)	100-063-712
Tool Kit	20 kHz (spanner wrench and 10 pc washer kit)	101-063-208R
	30 kHz (spanner wrench and 10 pc washer kit)	101-063-636R
	40 kHz (spanner wrench and silicone grease)	101-063-176R
Spanner wrench	20 kHz	101-118-039
	30 kHz	201-118-033
	40 kHz	201-118-024
Studs	1/2-20 x 1-1/4 (titanium horns)	100-098-370
	1/2-20 x 1-1/2 (aluminum horns, 20 kHz boosters)	100-098-123
	3/8-24 x 1 (30 kHz titanium horns and boosters)	100-298-170R
	M8X1.25 X 20 (40 kHz horns and boosters)	100-098-790

8.4 Troubleshooting

If you have a problem operating the DCX A Rack Mount Power Supply, take the following steps:

Table 8.13 Troubleshooting

Step	Action
1	Make sure the converter-booster-horn stack is properly assembled and installed.
2	For instructions on reconditioning stack component surfaces, refer to 8.2.2 Recondition the Stack (Converter, Booster, and Horn) .
3	If you need additional help, call your local Branson representative, refer to 1.3 How to Contact Branson .

NOTICE	
	<p>DCX A Rack Mount Power Supply should be serviced only by qualified technicians using Branson-approved test and repair equipment, repair procedures, and replacement parts. Unauthorized attempts at repair or modification of the power supply will void the warranty.</p>

8.4.1 Common Electrical Problems

Table 8.14 Troubleshooting Common Electrical Problems

Problem	Check	Solution
When touching a component of the weld system, you get a slight electrical shock.	Ensure the Ground cable is connected properly.	N/A
	Inspect the line cables.	If failed, repair or replace.

8.4.2 Ultrasonic Power Problems

Table 8.15 Troubleshooting Ultrasonic Power Problems

Problem	Check	Solution
Ultrasonic power delivered to horn; no indication on bar graph.	Check connector cables, replace if failed.	Replace defective cables.
	Test power supply.	See 7.8 Ultrasonics Test Procedure .
No ultrasonic power generated when Test key pressed; no Alarm indicator.	Failed or missing stack.	Replace.
	RF cable unplugged or failed; replace if failed.	Plug in or replace.
	Test power supply (7.8 Ultrasonics Test Procedure).	If defective, send unit for repair.
Unable to adjust amplitude using the front panel keypad.	Register setting configured to "External Amplitude Control"	Reset if required, See 7.5 Configuring the Power Supply Registers .
Unable to remote control.	I/O cabling	Repair or replace.
	Customer's switching device	Test/inspect/repair/replace.

8.4.3 Weld Cycle Problems

Table 8.16 Troubleshooting Weld Cycle Problems

Problem	Check	Solution
Full ultrasonic power not delivered.	Unsuitable horn or booster selection.	Contact Branson Applications Lab
	Plastic part material varies.	
	Mold release lubricant in weld area.	
	Unsuitable joint design.	
	Unsuitable or misaligned part fixture.	
	Amplitude setting	Adjust if required.
No ultrasonic power passed to horn.	Power supply overheating.	If defective, send unit for repair.
Alarm indicator illuminates when you press the Test key or during the weld cycle.	Check converter-booster-horn stack interface for fretting corrosion.	See 8.2.2 Recondition the Stack (Converter, Booster, and Horn) .
	Check for loose or failed horn converter or booster.	Tighten or replace as needed.
	Check for loose or failed horn or booster stud.	
	Failed RF cable	Replace if failed.
Excessively warm horn, booster, and converter; occasional overloads.	Check converter-booster-horn stack mating surfaces for fretting corrosion.	See 8.2.2 Recondition the Stack (Converter, Booster, and Horn) .
	Be certain proper cooling has been provided.	If defective, send unit for repair.

8.5 Cold Start Procedure

The power supply internal memory stores the system default settings and the registers that you set. It also provides temporary storage to support the power supply internal functions. A cold start clears and restores all the power supply settings back to the original factory defaults. It is not necessary to perform a cold start during normal operation and servicing, but you might find a cold start helpful when:

- You suspect the system is not operating properly.
- You want to make a new setup.
- Some system memory registers, such as Software version, will not be cleared by this Cold Start procedure.

8.5.1 Performing a Cold Start


NOTICE	
	<p>Using the Cold Start procedure will erase the current Amplitude Setting, the IP address and some of the Registers that you set. Be sure you have a record of your setup if you want to retain it or use the system backup feature from the DCX A Rack Mount Power Supply Web Page Interface.</p>

Table 8.17 Steps to Perform a Cold Start

Step	Action
1	Turn off the power supply.
2	Connect together pins 4 and 10 on the 26-pin User I/O Connector.
3	Turn on the power supply.
4	After the power up sequence ends, turn off the power supply
5	Disconnect pins 4 and 10 of the 26-pin on User I/O Connector.

Appendix A: Alarms

A.1	Overload Alarms (Group 0)	154
A.2	Cutoff Alarms (Group 1)	156
A.3	Setup Alarms (Group 2)	157
A.4	Cycle Modified Alarms (Group 3)	158
A.5	Warning Alarms (Group 4)	159
A.6	Limit Alarms (Group 5)	160
A.7	Equipment Failure Alarms (Group 6)	161
A.8	No Cycle Alarms (Group 7)	163
A.9	Communication Failure Alarms (Group 8)	164
A.10	Hardware Alarms (Group A)	165
A.11	Non-Cycle Overload Alarms (Group B)	166

A.1 Overload Alarms (Group 0)

This group includes all overload alarms that can occur during a weld cycle. This overload group will abort the weld cycle after stopping the sonics.

Table A.1 Overload Alarms (Group 0)

LCD Alarm Code	Alarm	Description
E0:01	Weld Overload - Phase	This alarm is generated in case of weld phase is out of weld phase limit for weld phase limit time period.
E0:02	Weld Overload - Current	This alarm is generated in case of weld current reaches to peak RF current limit of the system.
E0:03	Weld Overload - Frequency	This alarm is generated in case of weld frequency is out of weld frequency low and high limit window.
E0:04	Weld Overload - Power	This alarm is generated in case of weld power reaches to peak RF power limit of the system.
E0:05	Weld Overload - Voltage	This alarm is generated in case of voltage during weld reaches to peak RF voltage limit of the system.
E0:06	Weld Overload - Temperature	This alarm is generated in case of temperature inside the system (at the heat sink) reaches to 85°C (±5°C). NOTICE Alarm cannot be cleared until the temperature returns below threshold.
E0:11	Energy Brake Overload - Phase	This alarm is generated in case of phase is out of weld phase limit for weld phase limit time period during energy breaking.
E0:12	Energy Brake Overload - Current	This alarm is generated in case of weld current reaches to peak RF current limit of the system during energy breaking.
E0:13	Energy Brake Overload - Frequency	This alarm is generated in case of weld frequency is out of weld frequency low and high limit window during energy breaking.
E0:14	Energy Brake Overload - Power	This alarm is generated in case of weld power reaches to peak RF power limit of the system during energy breaking.
E0:15	Energy Brake Overload - Voltage	This alarm is generated in case of voltage during weld reaches to peak RF voltage limit of the system during energy breaking.

Table A.1 Overload Alarms (Group 0)

LCD Alarm Code	Alarm	Description
E0:16	Energy Brake Overload - Temperature	<p>This alarm is generated in case of temperature inside the system (at the heat sink) reaches to 85°C ($\pm 5^{\circ}\text{C}$) during energy breaking.</p> <p>NOTICE Alarm cannot be cleared until the temperature returns below threshold.</p>

A.2 Cutoff Alarms (Group 1)

This groups includes all cutoff alarms. Cutoff alarms are defined as a limit on a parameter, that when exceeded, will stop ultrasonics. The remaining portion of a weld cycle will continue.

Table A.2 Cutoff Alarms (Group 1)

LCD Alarm Code	Alarm	Description
E1:02	Energy Cutoff	Energy cutoff alarm is generated if the energy value during sonics on exceeded to the set cutoff value during a weld.
E1:03	Power Cutoff	Power cutoff alarm is generated if the peak power value during sonics on exceeded to the set cutoff value.
E1:04	Custom Input1 Cutoff	User can configure one of the user analog input as a Custom Input1 and also set a cutoff value from that input. System will generate custom Input1 Cutoff alarm if the user input voltage exceeds from the cutoff value set by user.
E1:05	Time Cutoff (Maximum Time-out)	User can set a time cutoff for weld and the alarm will be generated if the sonic on time during weld exceeds to the set value.
E1:06	Frequency Low Cutoff	User can set frequency low cutoff (negative offset to be applied from weld start frequency) for weld and the alarm will be generated if the frequency during weld goes below to the weld start frequency minus set value.
E1:07	Frequency High Cutoff	User can set frequency high cutoff (positive offset to be applied from weld start frequency) for weld and the alarm will be generated if the frequency during weld goes above to the weld start frequency plus set value.
E1:08	Custom Input2 Cutoff	User can configure one of the user analog input as a Custom Input2 and also set a cutoff value from that input. System will generate Custom Input2 cutoff alarm if the user input voltage exceeds from the cutoff value set by user.

A.3 Setup Alarms (Group 2)

This group includes all alarms that can occur during setup.

Table A.3 Setup Alarms (Group 2)

LCD Alarm Code	Alarm	Description
E2:03	Invalid Preset	Recalling invalid preset. Preset > 32.

A.4 Cycle Modified Alarms (Group 3)

Cycle modified alarms cause the cycle to be modified from the intended parameters. This can be caused by the user or equipment conditions changing. This group of alarms will always abort the cycle.

Table A.4 Cycle Modified Alarms (Group 3)

LCD Alarm Code	Alarm	Description
E3:01	Trigger Lost During Weld Or Hold	This alarm is generated during a weld cycle in case actuator is present and trigger input is lost before completing the weld (in case of time, energy, peak power and ground detect mode).
E3:02	Cycle Aborted Via User I/O	This alarm is generated if user aborts the cycle using cycle abort user input.

A.5 Warning Alarms (Group 4)

Warnings occur when a condition is happening that may have been unexpected. This group of alarms does not abort the cycle. This group includes overloads during afterburst because they do not abort the cycle.

Table A.5 Warning Alarms (Group 4)

LCD Alarm Code	Alarm	Description
E4:04	Amplitude Step Not Reached	This alarm is generated if Amplitude Stepping is ON but weld cycle finishes before stepping take places.
E4:05	Sonics Disabled Via User I/O	This alarm indicates the user has enabled an input pin as "Sonics Disable" and has run a cycle with this input active.
E4:11	Afterburst Overload - Phase	This alarm is generated in case of afterburst phase is out of Weld Phase limit for Weld Phase limit time period.
E4:12	Afterburst Overload - Current	This Alarm is generated in case of weld current reaches to peak RF current limit of the system during afterburst.
E4:13	Afterburst Overload - Frequency	This alarm is generated in case of Weld Frequency is out of Weld Frequency Low and High limit window during afterburst.
E4:14	Afterburst Overload - Power	This alarm is generated in case of weld power reaches to peak RF power limit of the system during afterburst.
E4:15	Afterburst Overload - Voltage	This alarm is generated in case of weld voltage reaches to peak RF voltage limit of the system during afterburst.
E4:16	Afterburst Overload - Temperature	<p>The internal heat sink temperature is greater than allowed.</p> <p>NOTICE Alarm cannot be cleared until the temperature returns below threshold.</p>

A.6 Limit Alarms (Group 5)

Limits will be reported at the end of the weld, but, unlike cutoffs, will not stop the sonics or abort the cycle.

Table A.6 Limit Alarms (Group 5)

LCD Alarm Code	Alarm	Description
E5:03	Power - Minus Limit	This alarm is generated at the end of the cycle in case of Weld peak power is lower than the Power Minus limit.
E5:04	Power - Plus Limit	This alarm is generated at the end of the cycle in case of Weld peak power is bigger than the Power Plus limit.
E5:05	Time - Minus Limit	This alarm is generated at the end of the cycle in case of Weld time is lower than the Time Minus limit.
E5:06	Time - Plus Limit	This alarm is generated at the end of the cycle in case of Weld time is bigger than the time Plus limit.
E5:07	Energy - Minus Limit	This alarm is generated at the end of the cycle in case of Weld energy is lower than the energy Minus limit.
E5:08	Energy - Plus Limit	This alarm is generated at the end of the cycle in case of Weld energy is bigger than the energy Plus limit.

A.7 Equipment Failure Alarms (Group 6)

Equipment alarms are caused by user equipment malfunction. These alarms occur before a cycle starts and therefore, will prevent a cycle from starting until the malfunction is corrected.


NOTICE	
	Alarm message will not reset until the malfunction is corrected.

Table A.7 Equipment Failure Alarms (Group 6)

LCD Alarm Code	Alarm	Description
E6:01	Start Input Still Active	This alarm is generated if External Start/Cycle Start/Trigger signal is active for more than 4 seconds after finishing the weld or while system is waiting to come into ready state.
E6:02	Trigger Active While ULS Active	This alarm is generated any time if Trigger and ULS both becomes active.
E6:03	Trigger Active In Ready	This alarm is generated if Trigger signal becomes active while system is in ready state and actuator is present.
E6:04	ULS Not Active In Ready	This alarm is generated if actuator is present and ULS is not active while system is already in ready state.
E6:05	Ground Detect Active In Ready	This alarm is generated if ground detect signal becomes active while system is in ready state.
E6:07	Cable Failure - User I/O	The cable detect user I/O feature has been enabled and detected that the assigned pin does not have the voltage applied.
E6:09	Start Input Lost	This alarm is generated when source of cycle start is removed before Trigger comes.
E6:10	Cycle Abort In Ready	This alarm is generated if Cycle Abort signal becomes active while system is in ready state.
E6:11	ULS Time Out	This alarm is generated if Actuator is present and ULS does not become active with a time-out at the end of the cycle.

Table A.7 Equipment Failure Alarms (Group 6)

LCD Alarm Code	Alarm	Description
E6:12	ULS Active During Weld	This alarm is generated if System is waiting for TRS and ULS becomes active. After TRS is active and system jumps to next state of cycle this alarm is generated when ULS becomes active during cycle along with "TRS active while ULS Active" alarm.

A.8 No Cycle Alarms (Group 7)

No cycle alarms are caused by possible mechanical setup errors or user errors. These are usually time out errors because an expected input did not occur in time. They will prevent a cycle from continuing. So although a cycle may have started, the cycle will be aborted.

Table A.8 No Cycle Alarms (Group 7)

LCD Alarm Code	Alarm	Description
E7:01	ULS Time-Out (Start Of Cycle)	A cycle start has been received but the upper limit switch has not gone inactive within the time-out specified by the system.
E7:02	Trigger Time-Out	A cycle has been started, but the trigger input has not gone active within the time-out specified by the system.
E7:03	External Sonics Delay Time-Out (User I/O)	The system is waiting for an external user defined input (if configured), but has not received the input within the time-out specified by the system.
E7:04	Interlock Not In Place (User I/O)	The system is waiting for a valid status from a user defined Interlock input (if configured), but the input is not active at the time of Cycle start.
E7:05	RF Switch Feedback Failure	A feedback signal from the RF switch not was not received within the time specified by the user.
E7:06	Part Not In Place (User I/O)	The system is waiting for an external user defined input, but the input is not active at the Cycle Start.
E7:07	Stack Number Not Valid For RF Switching	An invalid horn number is being requested from the preset. Any values outside the range of 16 horn numbers will cause an alarm.

A.9 Communication Failure Alarms (Group 8)

This group handles any communication issue that occur between processors. This is generally the result of noisy environments or other conditions that interrupt communications. Physical cable failures will be included in the Hardware Failure group. Because data cannot be transmitted between internal hardware, the cycle will be aborted.


NOTICE	
	Alarm message will not reset until the malfunction is corrected.

Table A.9 Communication Failure Alarms (Group 8)

LCD Alarm Code	Alarm	Description
E8:01	Modbus Communication Failure	Internal communication failure.
E8:02	LCD Communication Failure	Communication between the LCD user interface and the internal weld controller has failed.

A.10 Hardware Alarms (Group A)

This group of alarms will deal with internal equipment failures. This will generally be equipment that is supplied by Branson as part in the internal workings of the power supply. Cycles cannot be started if there is a Hardware alarm. If a cycle is in process when the alarm is detected then the cycle is aborted.


NOTICE	
	Alarm message will not reset until the malfunction is corrected.

Table A.10 Hardware Alarms (Group A)

LCD Alarm Code	Alarm	Description
EA:01	LCD NOVRAM Failure	LCD NOVRAM is not working.
EA:02	FRAM or NOVRAM Failure	FRAM or NOVRAM is not working.
EA:03	SD RAM Failure	SD RAM is now working.
EA:04	Connection Failure - WC to LCD	The physical connection between the WC board and LCD board is missing or broken.
EA:05	Connection Failure - WC to DCP	The physical connection between the WC board and DCP board is missing or broken.
EA:06	AC Line Voltage Lost	The AC line voltage to the system is lost but the 24 V supply is still present.
		ES bit activated, check ZSW1 Low Byte.

A.11 Non-Cycle Overload Alarms (Group B)

This group deals with overloads that occur outside of a weld cycle. By definition a weld is not in process so the weld cycle counter is not affected and the weld is not aborted.

Table A.11 Non-Cycle Overload Alarms (Group B)

LCD Alarm Code	Alarm	Description
Eb:01	Seek Overload - Phase	This alarm is generated in case of phase during Seek reaches to peak RF phase limit of the system.
Eb:02	Seek Overload - Current	This alarm is generated in case of current during Seek reaches to peak RF current limit of the system.
Eb:03	Seek Overload - Frequency	This alarm is generated in case of Frequency during seek is out of Seek Frequency Low and High limit window.
Eb:04	Seek Overload - Power	This alarm is generated in case of Power during seek reaches to peak RF Power limit of the system.
Eb:05	Seek Overload - Voltage	This alarm is generated in case of Voltage during seek reaches to peak RF voltage limit of the system.
Eb:06	Seek Overload - Temperature	This alarm is generated in case of temperature inside the system (at the heat sink) reaches to 85°C (±5°C) during Seek. NOTICE Alarm cannot be cleared until the temperature returns below threshold.
Eb:11	Test Overload - Phase	This alarm is generated in case of phase during Test reaches to peak RF phase limit of the system.
Eb:12	Test Overload - Current	This alarm is generated in case of current during Test reaches to peak RF current limit of the system.
Eb:13	Test Overload - Frequency	This alarm is generated in case of Frequency during seek is out of Test Frequency Low and High limit window.
Eb:14	Test Overload - Power	This alarm is generated in case of Power during Test reaches to peak RF Power limit of the system.
Eb:15	Test Overload - Voltage	This Alarm is generated in case of Voltage during Test reaches to peak RF voltage limit of the system.

Table A.11 Non-Cycle Overload Alarms (Group B)

LCD Alarm Code	Alarm	Description
Eb:16	Test Overload - Temperature	<p>This alarm is generated in case of temperature inside the system (at the heat sink) reaches to 85°C ($\pm 5^{\circ}\text{C}$) during Test.</p> <p>NOTICE Alarm cannot be cleared until the temperature returns below threshold.</p>


Appendix B: Timing Diagrams

B.1 Timing Diagrams170

B.1 Timing Diagrams


B.1.1 RF Switching I/O Direct With Feedback With And Without Alarm

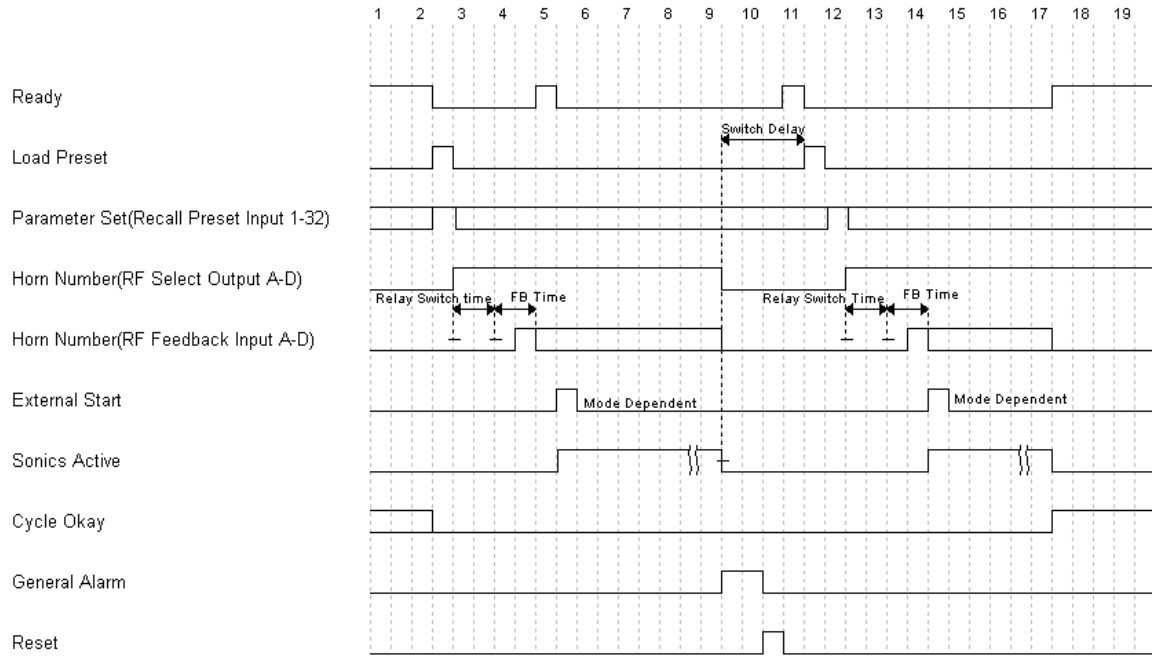Figure B.1 RF Switching I/O Direct With Feedback With And Without Alarm




B.1.2 RF Switching I/O Direct With Feedback With And Without Alarm And Load On Start

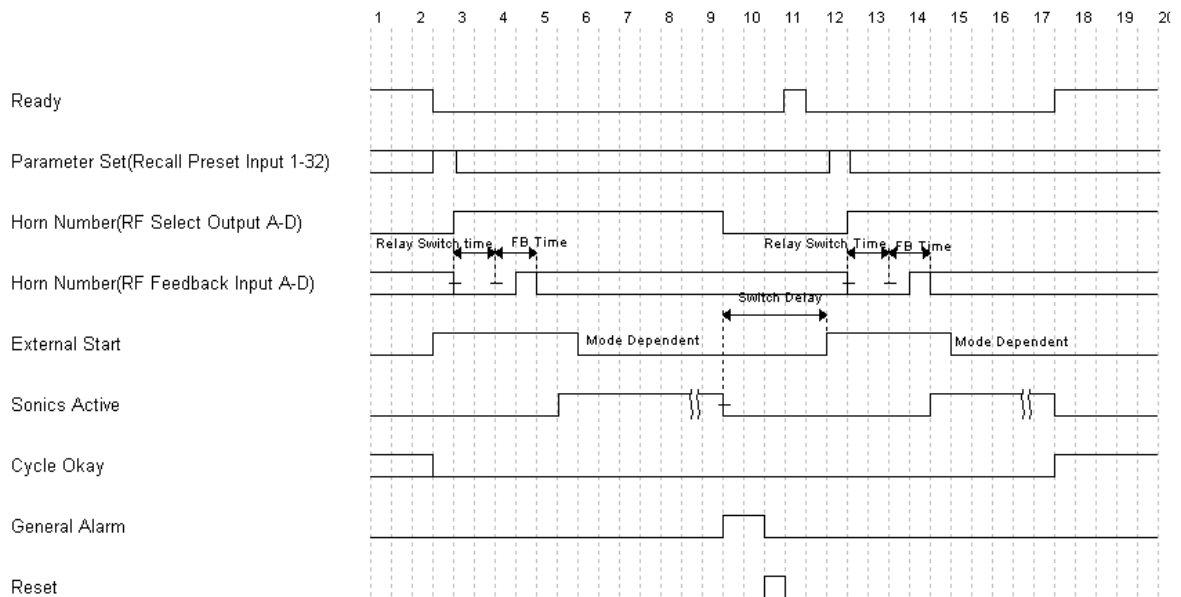Figure B.2 RF Switching I/O Direct With Feedback With And Without Alarm And Load On Start




B.1.3 RF Switching I/O With Off With And Without Alarm And Load On Start

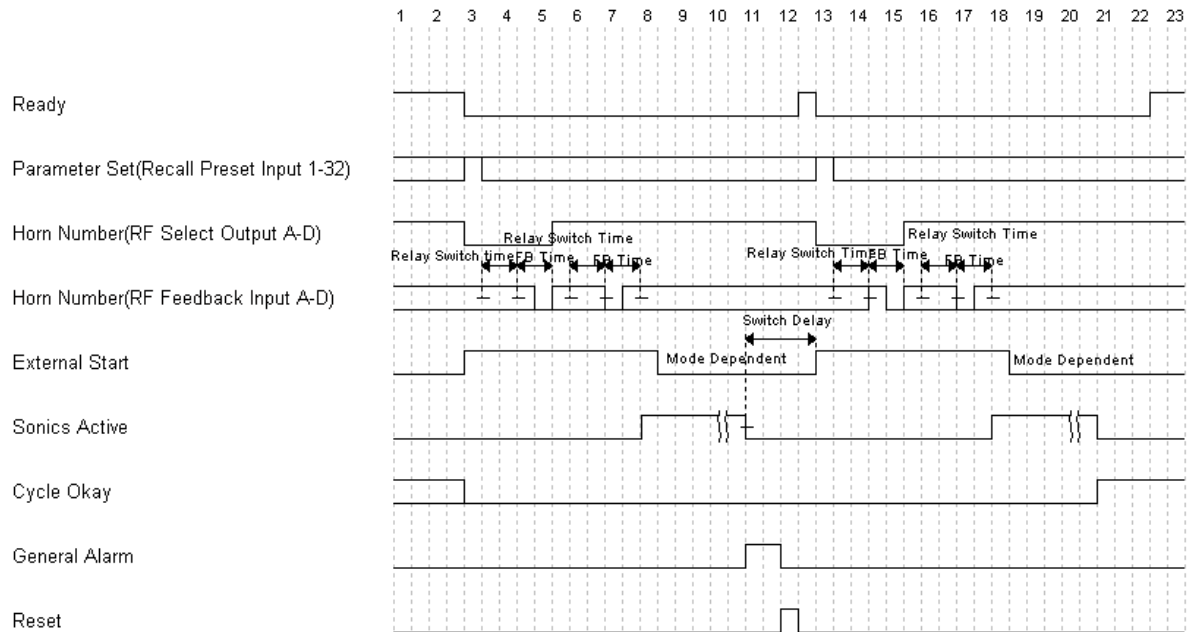Figure B.3 RF Switching I/O With Off With And Without Alarm And Load On Start




B.1.4 RF Switching I/O With Off With Feedback With And Without Alarm

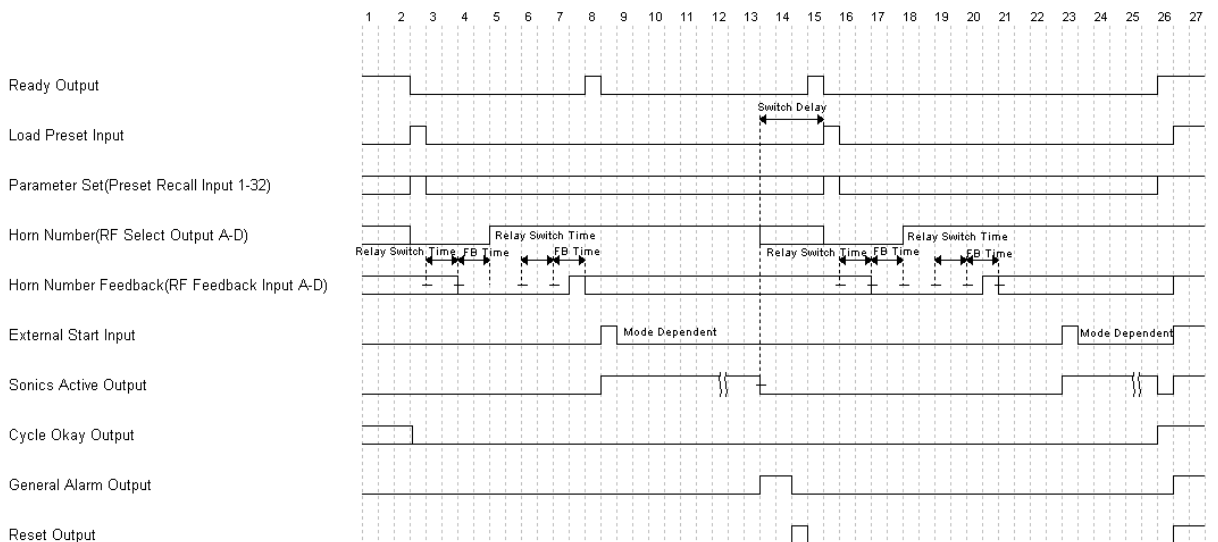Figure B.4 RF Switching I/O With Off With Feedback With And Without Alarm




B.1.5 Timing Diagram For All Other Modes With Actuator

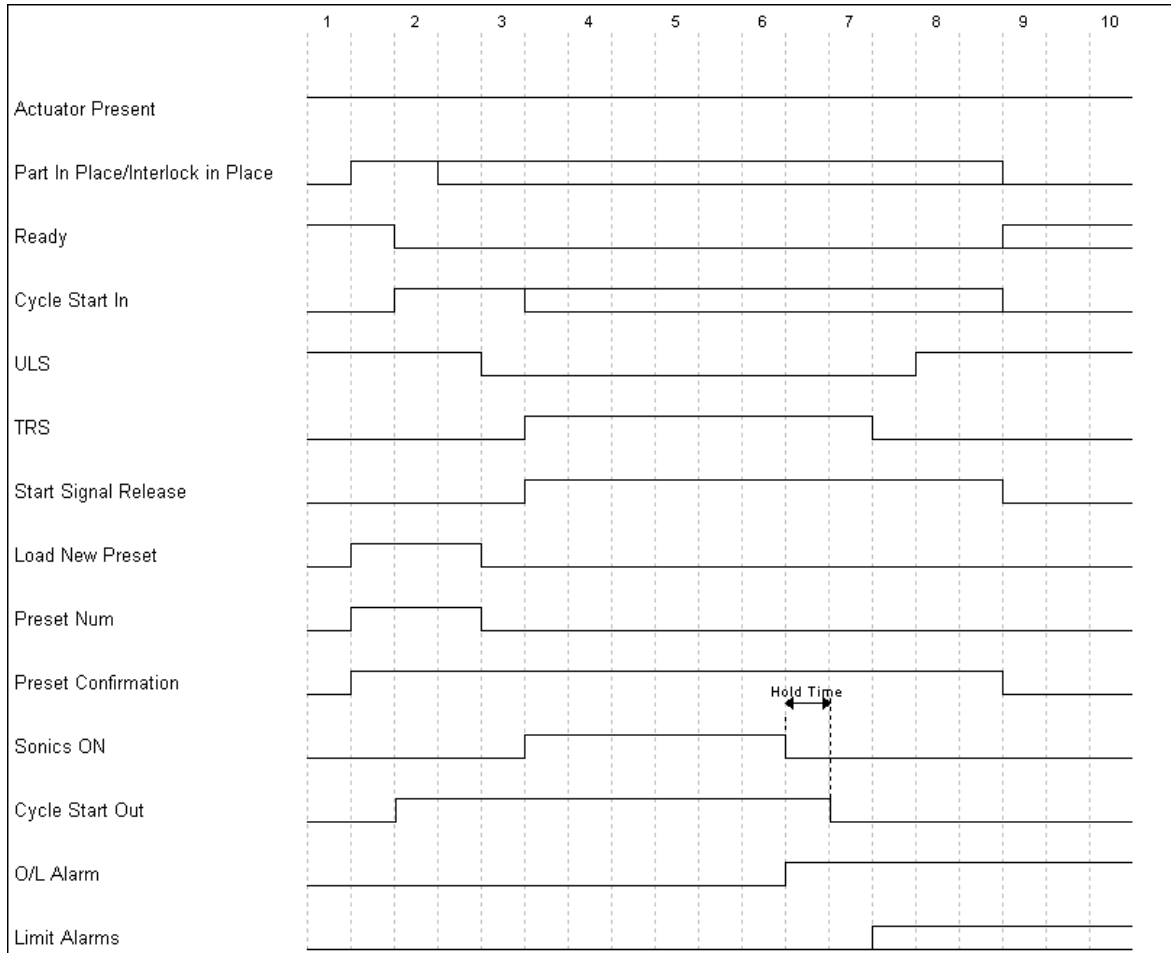Figure B.5 Timing Diagram For All Other Modes With Actuator




B.1.6 Timing Diagram For Cycle Abort With Actuator

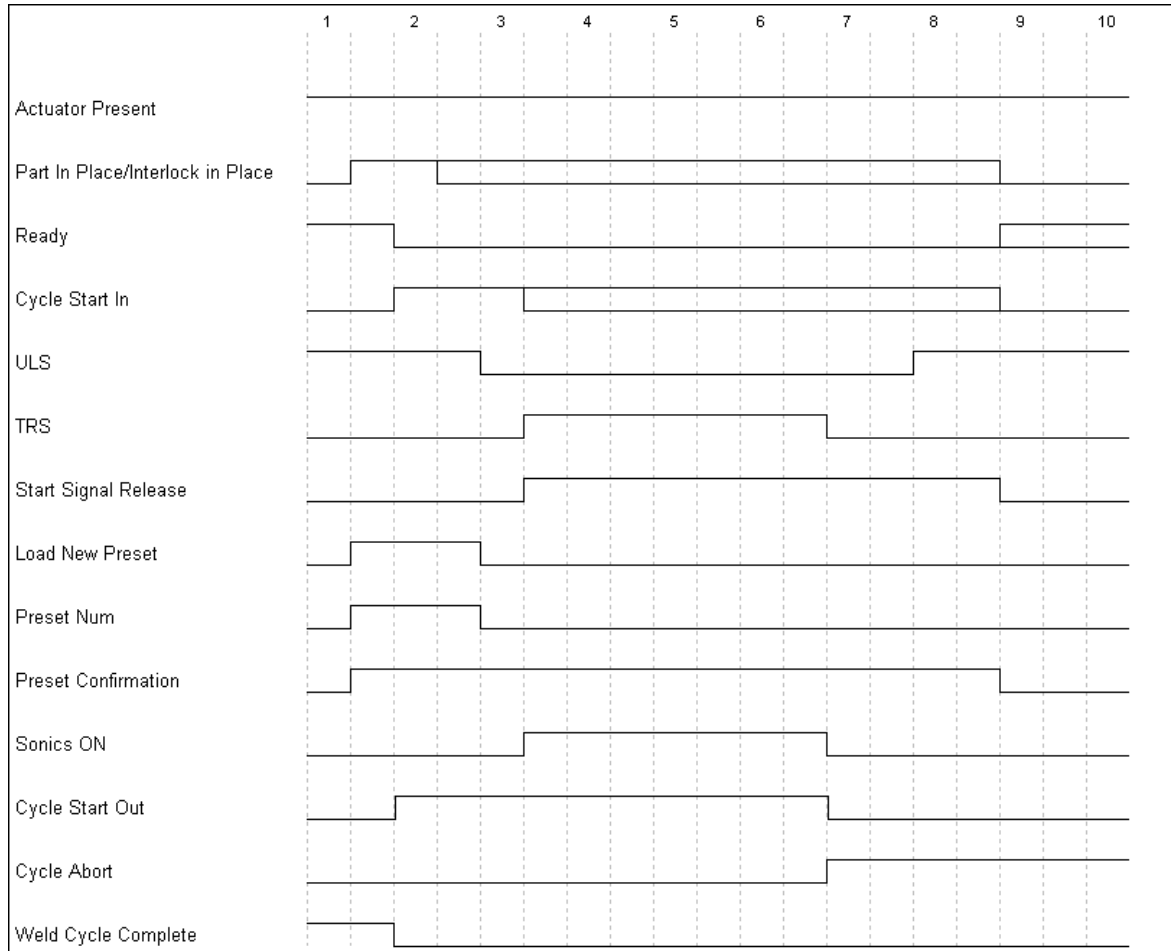Figure B.6 Timing Diagram For Cycle Abort With Actuator



B.1.7 Timing Diagram For Ground Detect With Actuator

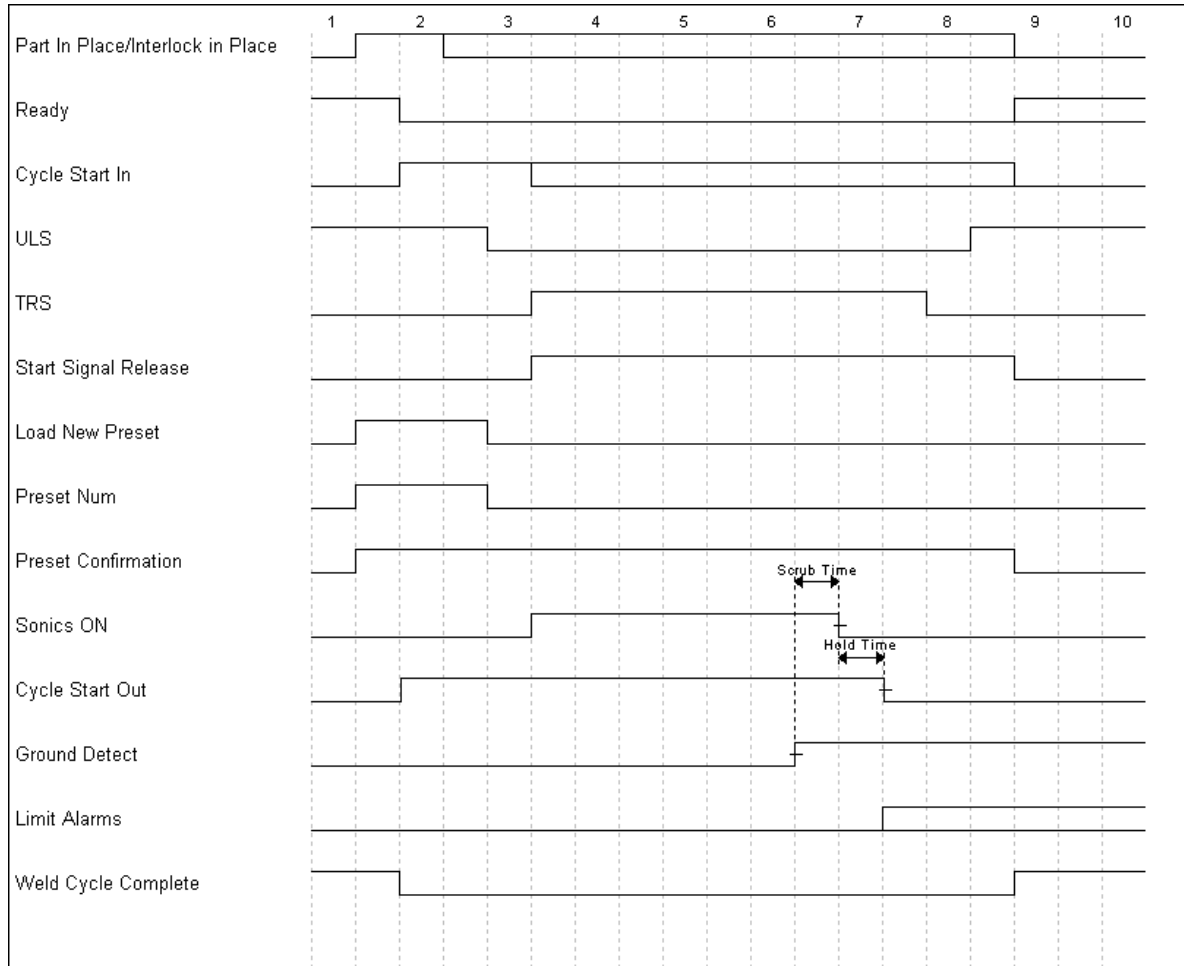Figure B.7 Timing Diagram For Ground Detect With Actuator



Appendix C: Manual's Revisions

C.1 Manual's Revisions 176

C.1 Manual's Revisions

Refer to the table below for the appropriate manual revision depending on your Power Supply's manufacturing date.

Table C.1 Manual's Revisions

Manual's Revisions	Power Supply's Manufacturing Date	
	From	To
00	May 2022	September 2024
01	October 2024	To date

Figure C.1 Manufacturing date on the Information label


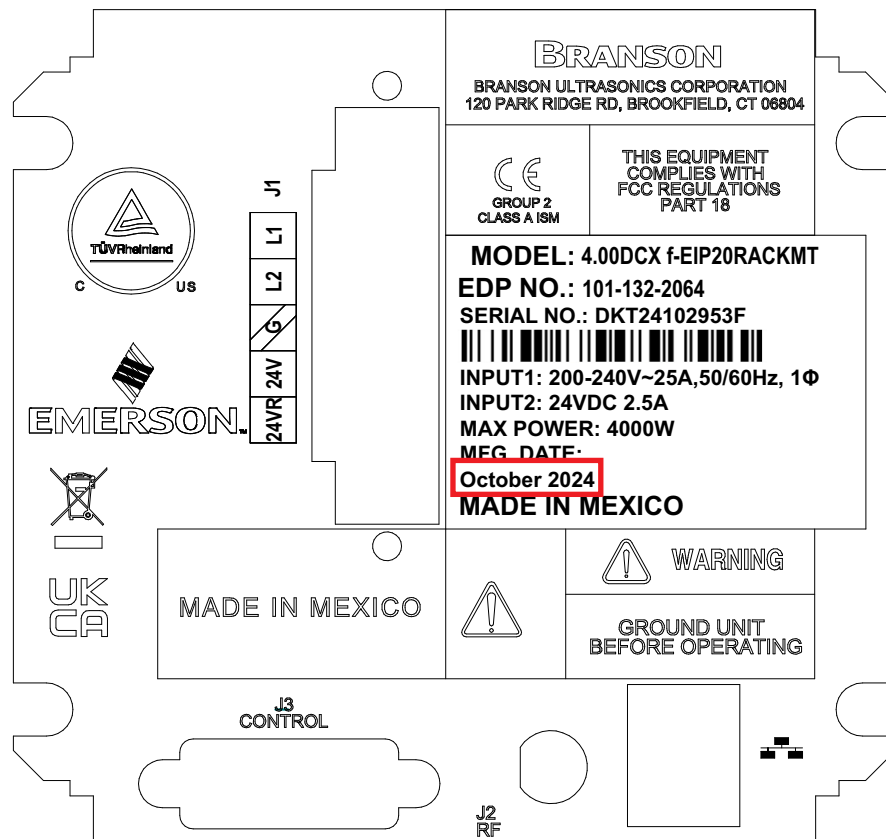
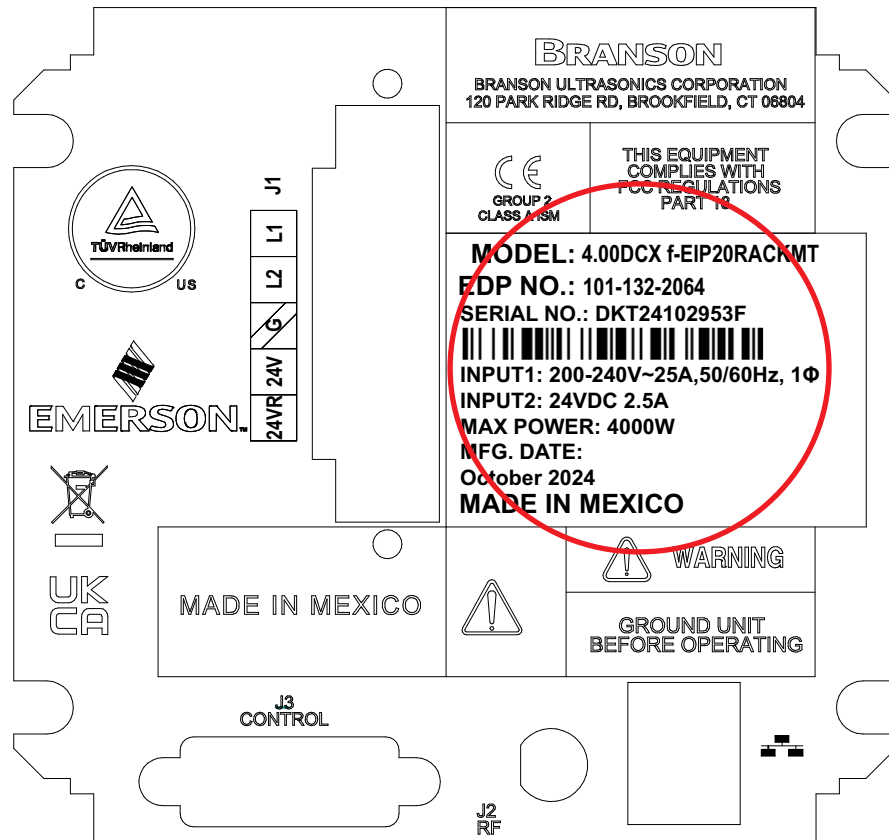


Figure C.2 Location of the Information label on the back of the DCX A Rack Mount Power Supply

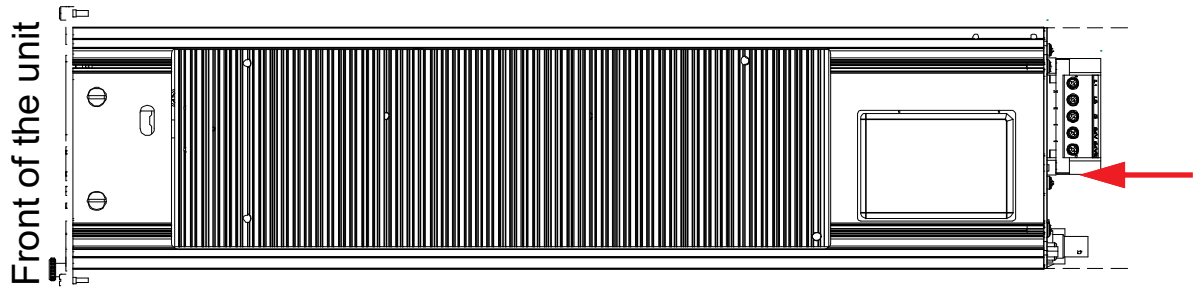

Index

Numerics

24 V Indicator 21

A

Acoustic Stack 68

Actuator 19, 27

Afterburst 67

Alarm 27

Alarm Icon 24

Alarm Reset Key 20

Alarms 116, 151

Amplitude 27, 114

Amplitude Control 27

Analog Input Functions 61

Analog Output Functions 62

Authorized Service Center (North America) 8

Authorized Service Centers (Asia) 9

Authorized Service Centers (Europe) 11

Authorized Service Centers (South America) 8

autotune with memory (AT/M) 15

Autotuning 17

B

Booster 19, 27

Boosters 143

C

Cables 33

Circle Icon 24

Clamping Force 27

Cold Start 27, 150

Communication Failure Alarms 162

Compatibility 16

Configuration Key 21

Connections 25

Contact 8

Continuous 90

Continuous Mode 91

Continuous Mode Icon 22

Controls and Indicators 20

Converter 19, 27

Converter Cooling 73

Converters 142

Converters and Boosters 77

Counters 27

Cutoff Alarms 154

Cutoffs 67

Cycle Modified Alarms 156

D

- Degating 27
- Delivery and Handling 29
- Digital Amplitude Setting 17
- Digital Input Functions 57
- Digital Output Functions 59
- Drop Test 30

E

- Electrical Connections 50
- Electrical Input Power Ratings 47
- Electrical Problems 147
- Electrical Specifications 36
- Emissions 7
- End of Weld Store 67
- Energy 90
- Energy Brake 67
- Energy Director 27
- Energy Mode 95
- Energy Mode Icon 22
- Environmental Requirements 47
- Environmental Specifications 30, 36
- Equipment Failure Alarms 159
- Ethernet Port 21, 25, 50
- External Amplitude Control 27, 115
- External Frequency Control 27

F

- Features 17
- Fixture 27
- Flash 27
- Forming 27
- Frequency 27
- Frequency Offset 17, 28, 67
- Fretting Corrosion 27
- Front Panel 20

G

- Gain 28
- General Maintenance 132
- General Precautions 6
- Glossary 27
- Ground Detect 90
- Ground Detect Icon 23
- Ground Detect Mode 99

H

- Hardware Alarms 163
- Horn 19, 28
- Horn Amplitude 28
- Horn Signature 17, 28
- Humidity 30

I

- I/O Connections 129

- Input Power Connection 65
- Insertion 28
- Installation 42
- Installation and Setup 41
- Installation Requirements 43
- Installation Steps 48
- Interface 28
- Introduction 13
- Inventory 33

J

- Joint 28
- Joule Icon 23

L

- LCD 17, 20
- LCD Bar-Graph 125
- Limit Alarms 158
- Limits 67
- Line Input Connector 25, 50
- Line Regulation 17
- line regulation 15
- Load Regulation 17
- load regulation 15
- Location 43

M

- Maintenance 131
- Membrane Keys 17
- Mode 67
- Models Covered 14
- Mount the Power Supply 49

N

- No Cycle Alarms 161
- Non-Cycle Overload Alarms 164
- Number Sign Icon 23
- Numeric Display 22

O

- Operation 89
- Output Power (RF Cable) Connection 64
- Overload Alarms 152

P

- Parameter 28
- Parameter Range 28
- Passcodes 17
- Peak Power 90
- Peak Power Icon 23
- Peak Power Mode 97
- Percentage Icon 23
- Physical Description 38
- Pneumatic Requirements 47
- Power Supply 17, 28

- Power Supply Setup 67
- Power Up 67
- Power/Frequency Bar-Graph 24
- Power-On Indicator 21
- Preventive Maintenance 134
- Primary Parameters 90

R

- Ramp Starting 17
- Receiving 31
- Recondition the Stack 135
- Registers 117, 119
- Regulatory Compliance 7
- Returning Equipment 34
- RF Connector 25, 50

S

- Safety and Support 1
- Safety Requirements 2
- Scope of Delivery 31
- Seek 18, 28
 - seek
 - timed 15
- Seek Ramp 67
- Setup Alarms 155
- Shipping and Handling 30
- Shock / Vibration (transit) 30
- Sonics Active Indicator 23
- Spare Stock 140
- Staking 28
- Start Ramp 67
- Start-up Diagnostics 18
- Storage / Shipping Temperature 30
- Suggested Spares 141
- Swaging 28
- Symbols 2
- System Cables 140
- System Protection 18

T

- Technical Specifications 35
- Test Procedure 127
- Testing the Installation 75
- Thermoplastic 28
- Thermoset 28
- Time 90
- Time Icon 23
- Time Mode 93
- Time Mode Icon 22
- Timed Seek 18, 67
 - timed seek 15
- Timing Diagrams 167
- Token 28
- Troubleshooting 146
- True Wattmeter 18

U

- Ultrasonic Power 28
- Ultrasonic Power Problems 148
- Ultrasonic Welding 28
- Ultrasonics Test Key 21
- Unpacking 32
- Up/Down Keys 20
- User I/O Cable Pin Assignments 53
- User I/O Connections 51
- User I/O Connector 25, 50
- User ID 17, 28

W

- Warning Alarms 157
- Warnings 2
- Web Page Interface 18
- web page interface 15
- Weld Amplitude 67
- Weld Cycle Problems 149
- Weld System 28
- Welding System 17
- Window Limit High 110
- Window Limit Low 112
- Window Limits 109

